

AUDI													
1,1 HB HC HD	37-44 kW (50-60 PS)	50	→8661 590 000 08/74→										
Ltr.			<b>1</b>	<b>S30579-00</b> <sup>12</sup> <sup>13</sup> 052198001 <b>D30579-00</b> <sup>12</sup> 052 198 012 <b>B30579-00</b> <sup>13</sup> 052 198 011 A	<b>H03693-00</b> 052 103 383 AA 71 Ø 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>X03744-01</b> ✕ Kork  <b>X53151-01</b> 052 103 483 C Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X03745-01</b> 030 129 717 D 8x 		<b>X03743-01</b> 030 253 039 A <b>X51310-01</b> <sup>13</sup> 861 253 115 A 	2x <b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
1,1 HB HC HD	37-44 kW (50-60 PS)	50	8661 590 001→ 08/74→	<b>S30580-00</b> <sup>12</sup> <sup>13</sup> 052198001L <b>D30580-00</b> <sup>12</sup> 052 198 012 AF <b>B30579-00</b> <sup>13</sup> 052 198 011 A	<b>H04132-00</b> 052 103 383 AB 71 Ø 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>X03744-01</b> ✕ Kork  <b>X53151-01</b> 052 103 483 C Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X03742-01</b> 036 129 717 C 8x 		<b>X03743-01</b> 030 253 039 A <b>X51310-01</b> <sup>13</sup> 861 253 115 A 	2x <b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
1,2 ANY	45 kW (61 PS)	A2 TDI	03/01-08/05	<b>D36624-00</b> <sup>12</sup>  <b>B32959-00</b> <sup>13</sup> <sup>38</sup> 	<b>H09197-00</b> 045 103 383 C 1,45 mm 1 MLS <b>H19197-10</b> 045 103 383 D 1,53 mm 2 MLS <b>H29197-20</b> 045 103 383 E 77,5 Ø 1,61 mm 3 MLS 		<b>X83111-01</b> 045 103 483 C NBR 	<b>N92001-00</b> 027 109 675 (6x) <b>P76532-00</b> 027 109 675	<b>X86491-01</b> 045 129 717 6x 		<b>X52968-01</b> 045 253 039 	<b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,2 CBZA CBZB	63-77 kW (86-105 PS)	A1 TFSI A3 TSI	03/10→	<b>D40579-00</b>  <b>B38301-00</b> <sup>13</sup> <sup>35</sup> 	<b>H40579-00</b> 03F 103 383 E 72 Ø MLS 	<b>T40579-00</b> WHT 004 790 (10x) 	<b>X59883-01</b> ✕ 03F 103 483 A Metall  <b>70-31414-10</b> 	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	<b>X59475-01</b> 03F 129 717 A 8x  <b>X59480-01</b> 03F 129 717 4x 	1x 	<b>X82520-01</b> 03F 253 041 P 	<b>70-31414-10</b> 	<b>P77181-01</b> K ← 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77479-01</b> K → 036 103 171B PTFE
1,2 CJZA CJZB	63-77 kW (86-105 PS)	A3 TFSI	02/13→	<b>D38726-00</b> <sup>12</sup> <b>B38725-00</b> <sup>13</sup> <sup>38</sup>	<b>H40705-00</b> 04E 103 383 T 72 Ø MLS 	<b>T40706-00</b> WHT 004 926 (10x) 	<b>X59930-01</b> 04E 103 483 H 	<b>N93196-00</b> 04E 109 675 (8x) +04E 109 675 A (8x) <b>P76960-00</b> AS 04E 109 675 A <b>P76961-00</b> ES 04E 109 675	<b>X58997-01</b> 036 129 717 E 8x  8x 	4x 	<b>X59925-01</b> 04E 253 039 D 	<b>70-31414-10</b> 	<b>P77841-01</b> K ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>P77881-01</b> K → 04E 103 170 A PTFE <b>P77843-01</b> N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>P77844-01</b> N → 04E 103 085 24x39x8 A SL LD PTFE

AUDI														
1,2	CYVB <b>[NEW]</b>	81 kW (110 PS)	A3 TFSI	05/14→	<b>D38726-00</b> <sup>12</sup> <b>B38725-00</b> <sup>13 38</sup>	<b>H40705-00</b> 04E 103 383 T 72 Ø MLS 	<b>T40706-00</b> WHT 004 926 (10x) 	<b>X59930-01</b> 04E 103 483 H 	<b>N93196-00</b> 04E 109 675 (8x) +04E 109 675 A (8x) <b>P76960-00</b> AS 04E 109 675 A <b>P76961-00</b> ES 04E 109 675	<b>X58997-01</b> 036 129 717 E 4x 	<b>X59925-01</b> 04E 253 039 D 	<b>70-31414-10</b> 	<b>P77841-01</b> K ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>P77843-01</b> N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>P77844-01</b> N → 04E 103 085 24x39x8 A SL LD PTFE	
1,3	EP	44 kW (60 PS)	80	→81 D 250 000 09/78-07/86	<b>D30584-00</b> <sup>12</sup> 056 198 012 D <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04128-00</b> 049 103 383 M 78,5 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A 4x <b>X07854-01</b> 841 253 115 B 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,3	EP	44 kW (60 PS)	80	81 E 000 001→ 09/78-07/86	<b>S31194-00</b> <sup>12 13</sup> <b>D31194-00</b> <sup>12</sup> 056 198 012 G <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H07850-00</b> 056 103 383 L 79 Ø 1,8 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A 4x <b>X07854-01</b> 841 253 115 B 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,3	FY HH	40-44 kW (55-60 PS)	50 80	08/77-07/81	<b>S30583-00</b> <sup>12 13</sup> <b>D30583-00</b> <sup>12</sup> 052 198 012 AB <b>B30579-00</b> <sup>13</sup> 052 198 011 A	<b>H04125-00</b> 030 103 383 K 76,5 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	<b>X03744-01</b> Kork  <b>X53151-01</b> 052 103 483 C Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X03742-01</b> 036 129 717 C 8x  <b>X03745-01</b> 030 129 717 D 	<b>X03743-01</b> 030 253 039 A 2x <b>X51310-01</b> 861 253 115 A 	<b>X03370-01</b> 032 103 609 B 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,3	ZA ZF	40-44 kW (55-60 PS)	80	→82 42 202 719 05/72-07/78	<b>D30584-00</b> <sup>12</sup> 056 198 012 D	<b>H04128-00</b> 049 103 383 M 78,5 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> 056 198 025 6,5 mm 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A 4x <b>X07854-01</b> 841 253 115 B 	<b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI														
1,3 ZF	40-44 kW (55-60 PS)	80	85 52 000 099 →	05/72-07/78	<b>S30584-00</b> <sup>12</sup> <sup>13</sup> 056198001A <b>D30584-00</b> <sup>12</sup> 056 198 012 D <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04128-00</b> 049 103 383 M 78,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> <sup>X</sup> 056 198 025 6,5 mm 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A  <b>X07854-01</b> <sup>A</sup> 841 253 115 B 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,4 AMF ATL BHC	55-66 kW (75-90 PS)	A2 TDI		02/00-08/05	<del><b>D36624-00</b> <sup>12</sup></del> <del></del> <del><b>B32959-00</b> <sup>13</sup> <sup>38</sup></del> 	<b>H09198-00</b> 045 103 383 AA 1,45 mm 1 <b>H19198-10</b> 045 103 383 AB 1,53 mm 2 <b>H29198-20</b> 045 103 383 AC 80,5 Ø 1,61 mm 3 MLS 	<b>T09198-00</b> 038 103 384 (8x) 	<b>X83111-01</b> 045 103 483 C NBR 	<b>N92001-00</b> 027 109 675 (6x) <b>P76532-00</b> 027 109 675	<b>X86491-01</b> 045 129 717 6x 	<b>X52968-01</b> 045 253 039  <b>X52970-01</b> <sup>A</sup> <sup>X</sup> 1H0 253 115 A 	<b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01</b> K → <sup>A</sup> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM	
1,4 AUA BBY	55 kW (75 PS)	A2	→8Z 2 008 000	02/00-08/05	<b>D36621-00</b> <sup>12</sup> <b>B32957-00</b> <sup>13</sup> <sup>38</sup> 036 198 011	<b>H80140-00</b> 036 103 383 AL 77,5 Ø MLS 	<b>T50943-00</b> 036 103 384 B (10x) 		<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X58997-01</b> 036 129 717 E 4x 16x	<b>X51579-01</b> 036 253 039 F 	<b>70-31414-10</b> 	<b>P77313-01</b> K ← 036 103 085 H 32x42x6/7 A SL RD NBR <b>P77818-01</b> K → <sup>A</sup> 030 103 171 H PTFE <b>P77329-01</b> N 2x 036 103 085 A 27x42x8 A SL RD NBR	
1,4 CAVG CAXC CMSA CNVA CTHG CTJA	90-136 kW (122-185 PS)	A1 TFSI A3 TFSI		09/07 →	<b>S37091-00</b> <sup>12</sup> <sup>13</sup> <sup>38</sup>	<b>H80752-00</b> 03C 103 383 AM 77,5 Ø MLS 	<b>T80752-00</b> WHT 000 912 (10x) 	<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X87493-01</b> 03C 129 717 C 16x  <b>X89175-01</b> <sup>10</sup> 03C 129 717 A 4x 	<b>X81446-01</b> 03C 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77479-01</b> K → <sup>A</sup> 036 103 171 B PTFE	
1,4 CHPB CMBA CPWA CUKB CXSA CXSB CZCA <b>[NEW]</b>	81-110 kW (110-150 PS)	A1 TFSI A3 TFSI Q3 TFSI		04/12 →	<b>D84797-00</b> <sup>12</sup> <b>B38725-00</b> <sup>13</sup> <sup>38</sup>	<b>H40706-00</b> 04E 103 383 BJ 75 Ø MLS 	<b>T40706-00</b> WHT 004 926 (10x) 	<b>X59930-01</b> 04E 103 483 H 	<b>N95992-00</b> 04E 109 675 (16x) <b>P76961-00</b> 04E 109 675	<b>X58997-01</b> 036 129 717 E 4x 16x	<b>X59925-01</b> 04E 253 039 D 	<b>70-31414-10</b> 	<b>P77841-01</b> K ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>P77881-01</b> K → <sup>A</sup> 04E 103 170 A PTFE <b>P77843-01</b> N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>P77844-01</b> N → 04E 103 085 24x39x8 A SL LD PTFE	

AUDI												
1,4 CPTA CZEA <b>[NEW]</b>	103-110 kW (140-150 PS)	A1 TFSI A3 TFSI Q3 TFSI	04/12→ 	<b>D84798-00</b> <sup>12</sup> <b>B38725-00</b> <sup>13 38</sup>	<b>H40706-00</b> 04E 103 383 BJ 75 Ø MLS 	<b>T40706-00</b> WHT 004 926 (10x) 	<b>X59930-01</b> 04E 103 483 H 	<b>N95992-00</b> 04E 109 675 (16x) <b>P76961-00</b> 04E 109 675 16x	<b>X58997-01</b> 036 129 717 E 4x 	<b>X59925-01</b> 04E 253 039 D 	<b>70-31414-10</b> 	<b>P77841-01 K</b> ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>P77881-01 K</b> → 04E 103 170 A PTFE <b>P77843-01 N</b> ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>P77840-01 N</b> → 04E 103 085 C 28x39x7 A SL LD PTFE
1,4 CSSA <b>[NEW]</b>	110 kW (150 PS)				<b>H84831-00</b> 04E 103 383 BF 75 Ø MLS 	<b>T40706-00</b> WHT 004 926 (10x) 	<b>X59930-01</b> 04E 103 483 H 	<b>N93196-00</b> 04E 109 675 (8x) +04E 109 675 A (8x) <b>P76960-00 AS</b> 04E 109 675 A <b>P76961-00 ES</b> 04E 109 675 8x 8x	<b>X58997-01</b> 036 129 717 E 4x 	<b>X59925-01</b> 04E 253 039 D 	<b>70-31414-10</b> 	<b>P77841-01 K</b> ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>P77843-01 N</b> ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>P77844-01 N</b> → 04E 103 085 24x39x8 A SL LD PTFE
1,5 YJ	55 kW (75 PS)	80	05/72-08/75	<b>D30584-00</b> <sup>12</sup> 056 198 012 D	<b>H04128-00</b> 049 103 383 M 78,5 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> ✗ 056 198 025 6,5 mm 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A  <b>X07854-01</b> 841 253 115 B	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,6 ABB	75 kW (102 PS)	80	→8C P 220 000 08/90-10/91	<b>S31443-00</b> <sup>12 13</sup> <b>D31443-00</b> <sup>12</sup> <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe <b>X53263-01</b> ✗ 051 103 483 A ACM  2 Dichtlippen	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A  <b>X51157-01</b> 433 253 115 <b>X51169-01</b> 431 253 115 A	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

AUDI													
Ltr.			<b>1</b>										
1,6 ABB	75 kW (102 PS)	80	8C P 220 001→ 08/90-10/91	D31443-00 <sup>12</sup> B32952-00 <sup>13</sup>	H04843-00 026 103 383 P 82 Ø 1,75 mm 	T04125-00 049 103 384 B (10x) 	V30584-00 026 198 025 A 8,5 mm Kork  V53509-00 ✗ 026 198 025 C 6,5 mm Gummi 1 Dichtlippe  X53263-01 ✗ 051 103 483 A ACM 2 Dichtlippen 	N90300-00 026 109 675 (8x) P76531-00 026 109 675	X04875-01 026 129 717 D 8x 	X03747-01 026 129 589 A  X51157-01 <sup>10</sup> 433 253 115  X51169-01 <sup>10</sup> 431 253 115 A 	4x X54624-01 044 103 609 D ACM 	P76087-01 K ← 068 103 085 E 32x47x10 A SL WD FPM P76355-11 K → 068 103 051 P 85x105x9 A SL LD FPM P76087-01 N 068 103 085 E 32x47x10 A SL WD FPM	
1,6 ABM	52 kW (71 PS)	80	→8C S 170 000 09/91-12/94	B32952-00 <sup>13</sup>	H04843-00 026 103 383 P 82 Ø 1,75 mm 	T04125-00 049 103 384 B (10x) 	X53263-01 051 103 483 A ACM 2 Dichtlippen 	N90300-00 026 109 675 (8x) P76531-00 026 109 675	X04875-01 026 129 717 D 8x  X07853-01 <sup>10</sup> 035 121 171 C 	X03747-01 026 129 589 A  X51169-01 <sup>10</sup> 431 253 115 A 	4x X54624-01 044 103 609 D ACM 	P76087-01 K ← 068 103 085 E 32x47x10 A SL WD FPM P76355-11 K → 068 103 051 P 85x105x9 A SL LD FPM P76087-01 N 068 103 085 E 32x47x10 A SL WD FPM	
1,6 ABM	52 kW (71 PS)	80	8C S 170 001→ 09/91-12/94	D36400-00 <sup>12</sup> B32952-00 <sup>13</sup>	H80097-00 050 103 383 B 82,5 Ø 1,65 mm MLS 	T50469-00 050 103 384 (10x) 	X53263-01 051 103 483 A ACM 2 Dichtlippen 	N91190-00 027 109 675 (8x) P76532-00 027 109 675	X86528-01 048 129 717 D 8x  X07853-01 <sup>10</sup> 035 121 171 C 	X03747-01 026 129 589 A  X51169-01 <sup>10</sup> 431 253 115 A 	4x X54624-01 044 103 609 D ACM 	P76087-01 K ← 068 103 085 E 32x47x10 A SL WD FPM P76355-11 K → 068 103 051 P 85x105x9 A SL LD FPM P76087-01 N 068 103 085 E 32x47x10 A SL WD FPM	
1,6 ADA	74 kW (101 PS)	80	→8C S 170 000 06/93-01/96	B32952-00 <sup>13</sup>	H04843-00 026 103 383 P 82 Ø 1,75 mm 	T04125-00 049 103 384 B (10x) 	V53509-00 ✗ 026 198 025 C 6,5 mm Gummi 1 Dichtlippe  X53263-01 051 103 483 A ACM 2 Dichtlippen 	N90300-00 026 109 675 (8x) Mot.→ADA 034 669 N91190-00 027 109 675 (8x) Mot.ADA 034 670→ P76531-00 026 109 675 Mot.→ADA 034 669 P76532-00 027 109 675 Mot.ADA 034 670→	X55626-01 048 129 717 A 8x 	X03747-01 026 129 589 A  X51169-01 <sup>10</sup> 431 253 115 A 	4x X54624-01 044 103 609 D ACM 	P76087-01 K ← 068 103 085 E 32x47x10 A SL WD FPM P76355-11 K → 068 103 051 P 85x105x9 A SL LD FPM P76087-01 N 068 103 085 E 32x47x10 A SL WD FPM	

































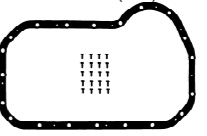















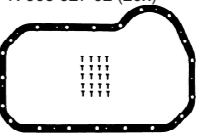















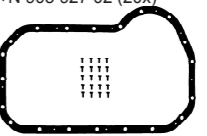
AUDI													
1,6 ADA Ltr.	74 kW (101 PS)	80 	1 	8C S 170 001→ 06/93-01/96	<b>B32952-00</b> <sup>13</sup>	<b>H80097-00</b> 050 103 383 B 82,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 	<b>V53509-00</b> ✕ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe  <b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N90300-00</b> 026 109 675 (8x) Mot.→ADA 034 669 <b>N91190-00</b> 027 109 675 (8x) Mot.ADA 034 670→ <b>P76531-00</b> 8x 026 109 675 <b>P76532-00</b> 8x 027 109 675 Mot.→ADA 034 669 Mot.ADA 034 670→	<b>X55626-01</b> 048 129 717 A 	<b>X03747-01</b> 026 129 589 A  <b>X51169-01</b> <sup>13</sup> 431 253 115 A 	4x <b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
1,6 ADP	74 kW (100 PS)	A4		11/94-09/01	<b>S32242-00</b> <sup>12</sup> <sup>13</sup> <b>D32242-00</b> <sup>12</sup> 050 198 012 B <b>B32242-00</b> <sup>13</sup> 050 198 011	<b>H50475-00</b> 050 103 383 82,5 Ø MLS 	<b>T50469-00</b> 050 103 384 (10x) 	<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57668-01</b> 037 129 717 C 8x 	<b>X51641-01</b>  <b>X51156-01</b> <sup>13</sup> 443 253 115 A 	<b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
1,6 AEH AKL	74 kW (101 PS)	A3		09/96-05/03	<b>S32239-00</b> <sup>12</sup> <sup>13</sup> <b>D32239-00</b> <sup>12</sup> 06A 198 012 <b>B32239-00</b> <sup>13</sup> <sup>35</sup> 06A 198 011	<b>H50474-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57666-01</b> 4x 06A 133 398 F 	<b>X51638-01</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01</b> K → <sup>13</sup> 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
1,6 AHL	74 kW (100 PS)	A4		11/94-09/01	<b>D36630-00</b> <sup>12</sup> <b>B32936-00</b> <sup>13</sup> <sup>35</sup>	<b>H50474-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	<b>X53263-01</b> 051 103 483 A ACM  2 Dichtlippen	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X57668-01</b> 8x 037 129 717 C  <b>X87424-01</b> 4x 06B 129 717 A 	<b>X03747-01</b> 4x 026 129 589 A  <b>X51169-01</b> <sup>13</sup> 431 253 115 A 	<b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01</b> K → <sup>13</sup> 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,6 ALZ	75 kW (102 PS)	A4		07/00-06/08	<b>D36631-00</b> <sup>12</sup> <b>B32936-00</b> <sup>13</sup> <sup>35</sup>	<b>H50474-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	<b>X83001-01</b> 06B 103 483 L NBR 	<b>N92991-00</b> 036 109 675 (8x) <b>P76662-00</b> 036 109 675	<b>X87424-01</b> 4x 06B 129 717 A 	<b>X03747-01</b> 4x 026 129 589 A 	<b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01</b> K → <sup>13</sup> 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM

AUDI													
Ltr.													
1,6 ANA ARM	74 kW (100 PS)	A4	11/94-09/01	D36630-00 <sup>12</sup> B32936-00 <sup>13 35</sup>	H50474-00 06B 103 383 H 82,5 Ø 1,2 mm MLS 	T50474-00 06A 103 384 C (10x) 	X53263-01 051 103 483 A ACM 2 Dichtlippen 	N91190-00 027 109 675 (8x) P76532-00 027 109 675 	X87424-01 06B 129 717 A 4x 	X03747-01 026 129 589 A 4x 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77318-01 K → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM	
1,6 APF	74 kW (101 PS)	A3	09/96-05/03	D36632-00 <sup>12</sup> B32936-00 <sup>13 35</sup>	H50474-00 06B 103 383 H 82,5 Ø 1,2 mm MLS 	T50474-00 06A 103 384 C (10x) 	X53263-01 051 103 483 A ACM 2 Dichtlippen 	N91190-00 027 109 675 (8x) P76532-00 027 109 675 	X57666-01 06A 133 398 F 4x 	X52965-01 06A 253 039 L 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77318-01 K → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM	
1,6 AVU BFQ CCSA CMXA	75 kW (102 PS)	A3	08/00-03/13	D36633-00 <sup>12</sup> B32936-00 <sup>13 35</sup>	H50474-00 06B 103 383 H 82,5 Ø 1,2 mm MLS 	T50474-00 06A 103 384 C (10x) 	X83001-01 06B 103 483 L NBR 	N92991-00 036 109 675 (8x) P76662-00 036 109 675 	X57666-01 06A 133 398 F 4x 	X52965-01 06A 253 039 L  X07867-01 533 253 115 D 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77318-01 K → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM	
1,6 BAD	81 kW (110 PS)	A2 FSI	05/02-08/05	D36705-00 <sup>12</sup> B36705-00 <sup>13 35</sup>	H80344-00 036 103 383 AB 77 Ø MLS 	T80344-00 036 103 384 E (10x) 	70-31414-10 	N92990-00 036 109 675 (16x) P76662-00 036 109 675 	X87493-01 03C 129 717 C 16x  X87494-01 <sup>10</sup> 036 129 717 K 	X51579-01 036 253 039 F 	70-31414-10 	P77313-01 K ← 036 103 085 H 32x42x6/7 A SL RD NBR P77351-01 K → 030 103 171 L PTFE P77329-01 N ← 036 103 085 A 27x42x8 A SL RD NBR P77342-01 N → 036 103 085 F 35x46x7 A SL RD FPM	
1,6 BAG BLP	85 kW (115 PS)	A3 FSI	08/03-09/07	S36776-00 <sup>12 13 35</sup> D36776-00 <sup>12</sup>	H80622-00 03C 103 383 D 77,5 Ø MLS 	T50943-00 036 103 384 B (10x) 	70-31414-10 	N92990-00 036 109 675 (16x) P76662-00 036 109 675 	X87493-01 03C 129 717 C 16x  X89175-01 <sup>10</sup> 03C 129 717 A 4x 	X81446-01 03C 253 039 D  X52978-01 1J0 253 115 S 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77350-01 K → 030 103 171 K PTFE	

AUDI												
1,6 BGU BSE BSF	75 kW (102 PS)	A3	05/03-03/13	 D36633-00 <sup>12</sup> B36706-00 <sup>13 35</sup>	H50474-00 06B 103 383 H 82,5 Ø 1,2 mm MLS 	T50474-00 06A 103 384 C (10x) 	X83001-01 06B 103 483 L NBR 	N92991-00 036 109 675 (8x) P76662-00 036 109 675	X57666-01 06A 133 398 F 8x  X88303-01 <sup>10</sup> 06A 133 227 B 4x 	X52965-01 06A 253 039 L 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77352-01 K → 06B 103 171 E P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,6 BLF	85 kW (115 PS)	A3 FSI	→8P 4 103 000 08/03-09/07	S36776-00 <sup>12 13 38</sup> D36776-00 <sup>12</sup>	H80622-00 03C 103 383 D 77,5 Ø MLS 	T50943-00 036 103 384 B (10x) 	70-31414-10 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X87493-01 03C 129 717 C 16x X89175-01 <sup>10</sup> 03C 129 717 A 4x 	X81446-01 03C 253 039 D  X52978-01 1J0 253 115 S	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77350-01 K → 030 103 171 K PTFE
1,6 BLF	85 kW (115 PS)	A3 FSI	8P 4 103 001→ 08/03-09/07	S36776-00 <sup>12 13 38</sup> D36776-00 <sup>12</sup>	H80622-00 03C 103 383 D 77,5 Ø MLS 	T50943-00 036 103 384 B (10x) 	70-31414-10 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X87493-01 03C 129 717 C 16x X89175-01 <sup>10</sup> 03C 129 717 A 4x 	X81446-01 03C 253 039 D  X52978-01 1J0 253 115 S	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77376-01 K → 030 103 171 S PTFE
1,6 BRY	74 kW (101 PS)				H80447-00 06A 103 383 AE MLS 	T50474-00 06A 103 384 C (10x) 	X83001-01 06B 103 483 L NBR 	N92991-00 036 109 675 (8x) P76662-00 036 109 675	X57666-01 06A 133 398 F 8x  X88303-01 <sup>10</sup> 06A 133 227 B 4x 	X52965-01 06A 253 039 L 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77318-01 K → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,6 CAYB CAYC	66-77 kW (90-105 PS)	A1 TDI	05/10→	D38310-00 <sup>12</sup>  B38300-00 <sup>13 35</sup> 	H40582-00 03L 103 383 BQ 80,5 Ø 1,55 mm 1 □ MLS H40582-10 03L 103 383 BR 80,5 Ø 1,63 mm 2 □ MLS H40582-20 03L 103 383 BS 80,5 Ø 1,71 mm 3 □ MLS 	T50034-00 WHT 002 131 (10x) 	V59500-00 03L 103 483 C +03L 103 070 (4x) X59500-01 03L 103 483 C 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X59477-01 03L 129 717 J 16x  X59479-01 03L 129 717 H 4x 	X59496-01 03L 253 039 E 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77689-01 K → 03L 103 171 A PTFE P77774-01 N 03L 103 085 32x47x10 A RD FPM



AUDI												
Ltr.												
1,6 CAYB CAYC	66-77 kW (90-105 PS)	A3 TDI	05/09-05/13	<p><b>D38310-00</b> <sup>12</sup></p> <p>10/09→</p> <p></p> <p></p> <p><b>B38300-00</b> <sup>13 35</sup></p>	<p><b>H40582-00</b></p> <p>03L 103 383 BQ</p> <p>80,5 Ø</p> <p>1,55 mm 1 □</p> <p>MLS</p> <p><b>H40582-10</b></p> <p>03L 103 383 BR</p> <p>80,5 Ø</p> <p>1,63 mm 2 □</p> <p>MLS</p> <p><b>H40582-20</b></p> <p>03L 103 383 BS</p> <p>80,5 Ø</p> <p>1,71 mm 3 □</p> <p>MLS</p> <p></p>	<p><b>T50034-00</b></p> <p>WHT 002 131 (10x)</p> <p></p>	<p><b>V59484-01</b></p> <p>03L 103 483 H</p> <p>+03L 103 070 A (4x)</p> <p></p> <p><b>V59500-00</b></p> <p>03L 103 483 C</p> <p>+03L 103 070 (4x)</p> <p></p> <p><b>X59484-01</b></p> <p>03L 103 483 H</p> <p></p> <p><b>X59500-01</b></p> <p>03L 103 483 C</p> <p></p>	<p><b>N92990-00</b></p> <p>036 109 675 (16x)</p> <p><b>P76662-00</b></p> <p>036 109 675</p> <p>16x</p>	<p><b>X59477-01</b></p> <p>03L 129 717 J</p> <p>4x</p> <p></p> <p><b>X59479-01</b></p> <p>03L 129 717 H</p> <p>4x</p> <p></p>	<p><b>X59496-01</b></p> <p>03L 253 039 E</p> <p></p>	<p><b>70-31414-10</b></p> <p></p>	<p><b>P76096-11 K</b> ←</p> <p>038 103 085 E</p> <p>35x48x10</p> <p>A SL RD PTFE ACM</p> <p><b>P77689-01 K</b> → </p> <p>03L 103 171 A</p> <p>PTFE</p> <p><b>P77181-01 N</b></p> <p>038 103 085 A</p> <p>32x47x10</p> <p>A SL RD PTFE ACM</p> <p>→09/09</p> <p><b>P77774-01 N</b></p> <p>03L 103 085</p> <p>32x47x10</p> <p>A RD FPM</p> <p>10/09→</p>
1,6 CLHA CRKB	77-81 kW (105-110 PS)	A3 TDI	10/12→	<p><b>D38750-00</b> <sup>12</sup></p> <p></p> <p></p>	<p><b>H40700-00</b></p> <p>04L 103 383 C</p> <p>80,5 Ø</p> <p>1,55 mm 1 □</p> <p>MLS</p> <p><b>H40700-10</b></p> <p>04L 103 383 D</p> <p>80,5 Ø</p> <p>1,63 mm 2 □</p> <p>MLS</p> <p><b>H40700-20</b></p> <p>04L 103 383 E</p> <p>80,5 Ø</p> <p>1,71 mm 3 □</p> <p>MLS</p> <p></p>	<p><b>T40709-00</b></p> <p>WHT 005 673 (10x)</p> <p></p>	<p><b>V59933-00</b></p> <p>03L 103 483 S</p> <p>+04L 103 070 (4x)</p> <p></p> <p><b>V90072-00</b></p> <p></p> <p><b>X59933-01</b></p> <p>03L 103 483 S</p> <p></p> <p><b>X90116-01</b></p> <p>04L 103 483</p> <p></p>	<p><b>N92990-00</b></p> <p>036 109 675 (16x)</p> <p><b>P76662-00</b></p> <p>036 109 675</p> <p>16x</p>	<p><b>X59929-01</b></p> <p>04L 129 717 B</p> <p>16x</p> <p></p>	<p><b>X59927-01</b></p> <p>04L 253 039 G</p> <p></p>	<p><b>70-31414-10</b></p> <p></p>	<p><b>P77831-01 K</b> → </p> <p>04L 103 171</p> <p>PTFE</p> <p><b>P77774-01 N</b></p> <p>03L 103 085</p> <p>32x47x10</p> <p>A RD FPM</p>

AUDI													
Ltr. 													
1,6 CR	40 kW (54 PS)	80 D	08/80-08/86	<b>S30435-00</b> <sup>12</sup> <sup>13</sup> 068 198 001  <b>D30435-00</b> <sup>12</sup> 068 198 012 L  <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H02633-00</b> 068 103 383 ES 1,5 mm 1  Mot.→CR 176 338 <b>H12633-10</b> 068 103 383 ET 1,6 mm 2  Mot.→CR 176 338 <b>H22633-20</b> 068 103 383 FA 78 Ø 1,7 mm 3  Mot.→CR 176 338  <b>H02673-00</b> 068 103 383 FE 1,4 mm 1  Mot.CR 176 339→ <b>H12673-10</b> 068 103 383 FF 1,5 mm 2  Mot.CR 176 339→ <b>H22673-20</b> 068 103 383 FG 78 Ø 1,6 mm 3  Mot.CR 176 339→ 	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x  <b>X55899-01</b> 068 129 717 E 	<b>X03747-01</b> 026 129 589 A  <b>X07854-01</b> <sup>A</sup> 841 253 115 B  <b>X51157-01</b> <sup>A</sup> 433 253 115 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,6 CY JK	40-51 kW (54-70 PS)	80 D 80 TD 90 TD	08/80-07/89	<b>S30435-00</b> <sup>12</sup> <sup>13</sup> 068 198 001  <b>D30435-00</b> <sup>12</sup> 068 198 012 L  <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H02673-00</b> 068 103 383 FE 1,4 mm 1  <b>H12673-10</b> 068 103 383 FF 1,5 mm 2  <b>H22673-20</b> 068 103 383 FG 78 Ø 1,6 mm 3  	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> <sup>X</sup> 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x  <b>X55899-01</b> 068 129 717 E 	<b>X03747-01</b> 026 129 589 A  <b>X07854-01</b> <sup>A</sup> 841 253 115 B  <b>X51157-01</b> <sup>A</sup> 433 253 115 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,6 CY JK	40-51 kW (54-70 PS)	80 D 80 TD 90 TD	08/80-07/89	<b>S30435-00</b> <sup>12</sup> <sup>13</sup> 068 198 001  <b>D30435-00</b> <sup>12</sup> 068 198 012 L  <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H02674-00</b> 068 103 383 EH 1,6 mm 1  <b>H12674-10</b> 068 103 383 EJ 1,65 mm 2  <b>H22674-20</b> 068 103 383 EK 78 Ø 1,7 mm 3  	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> <sup>X</sup> 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x  <b>X55899-01</b> 068 129 717 E 	<b>X03747-01</b> 026 129 589 A  <b>X07854-01</b> <sup>A</sup> 841 253 115 B  <b>X51157-01</b> <sup>A</sup> 433 253 115 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI													
1,6 DT DTA JU PP SA	51-55 kW (69-75 PS)	80	08/78→	<b>S31446-00</b> <sup>12</sup> <sup>13</sup> <b>D31446-00</b> <sup>12</sup> 050 198 012 A <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	8x <b>X04875-01</b> 026 129 717 D  <b>X55170-01</b> 026 129 717 F  <b>X07853-01</b> <sup>10</sup> 035 121 171 C 	 <b>X03747-01</b> 026 129 589 A  <b>X07854-01</b> <sup>11</sup> 841 253 115 B  <b>X51156-01</b> <sup>11</sup> 443 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,6 FS YV YZ	53-81 kW (72-110 PS)	100 80	01/76-02/83	<b>S30587-00</b> <sup>12</sup> <sup>13</sup> <b>D30587-00</b> <sup>12</sup> 049 198 012 H <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04129-00</b> 049 103 383 K 81 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> ✗ 056 198 025 6,5 mm  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	8x <b>X04875-01</b> 026 129 717 D 	 <b>X03747-01</b> 026 129 589 A  <b>X07854-01</b> <sup>11</sup> 841 253 115 B 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,6 RA SB	59 kW (80 PS)	80 TD 90 TD	09/86-09/91	<b>S30435-00</b> <sup>12</sup> <sup>13</sup> 068 198 001  <b>D30435-00</b> <sup>12</sup> 068 198 012 L  <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H02674-00</b> 068 103 383 EH 1,6 mm 1 <b>H12674-10</b> 068 103 383 EJ 1,65 mm 2 <b>H22674-20</b> 068 103 383 EK 78 Ø 1,7 mm 3 	<b>T02673-00</b> 068 103 384 A (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	8x <b>X04875-01</b> 026 129 717 D  <b>X55899-01</b> 068 129 717 E 	 <b>X03747-01</b> 026 129 589 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
1,6 RN	55 kW (75 PS)	80	09/86-08/91	<b>S31448-00</b> <sup>12</sup> <sup>13</sup> <b>D31448-00</b> <sup>12</sup> 026 198 012 AD <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	8x <b>X04875-01</b> 026 129 717 D  <b>X55170-01</b> 026 129 717 F 	 <b>X03747-01</b> 026 129 589 A  <b>X51169-01</b> <sup>11</sup> 431 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI												
1,6 WV XX YN YP YS YT YY	51-81 kW (70-110 PS)	COUPE 80	→8192 242 682 09/73-07/86 →8192 242 682	<b>D30584-00</b> <sup>12</sup> 056 198 012 D <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04129-00</b> 049 103 383 K 81 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> ✗ 056 198 025 6,5 mm 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A <b>X07854-01</b> <sup>13</sup> 841 253 115 B 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
1,6 WV WZ XX YG YH YN YP YS YT YY	51-81 kW (70-110 PS)	COUPE 80	8192 242 683→ 09/73→ 8192 242 683→	<b>S30587-00</b> <sup>12</sup> <sup>13</sup> <b>D30587-00</b> <sup>12</sup> 049 198 012 H <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04129-00</b> 049 103 383 K 81 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> ✗ 056 198 025 6,5 mm 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A <b>X07854-01</b> <sup>13</sup> 841 253 115 B 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
1,6 YK	59-61 kW (79-83 PS)			<b>S30587-00</b> <sup>12</sup> <sup>13</sup> <b>D30587-00</b> <sup>12</sup> 049 198 012 H <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04128-00</b> 049 103 383 M 78,5 Ø 1,75 mm  <b>H04129-00</b> 049 103 383 K 81 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> ✗ 056 198 025 6,5 mm  <b>V53509-00</b> ✗ 026 198 025 C 6,5 mm Gummi  - 1 Dichtlippe 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A <b>X07854-01</b> <sup>13</sup> 841 253 115 B 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
1,7 WT	55-58 kW (74-79 PS)			<b>S30587-00</b> <sup>12</sup> <sup>13</sup> <b>D30587-00</b> <sup>12</sup> 049 198 012 H <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04129-00</b> 049 103 383 K 81 Ø 1,75 mm 	<b>T04132-00</b> 049 103 385 (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V31265-00</b> ✗ 056 198 025 6,5 mm 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x 	<b>X03747-01</b> 026 129 589 A <b>X07854-01</b> <sup>13</sup> 841 253 115 B 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM



AUDI												
1,8 AJL	132 kW (180 PS)	A4 T A6 T	12/97-01/05	<b>S32232-00</b> <sup>12</sup> <sup>13</sup> <b>D32232-00</b> <sup>12</sup> 058 198 012 +058 198 025 A <b>B37030-00</b> <sup>13</sup> <sup>35</sup> 	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T10468-00</b> 058 103 385 A (10x) 	<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X57659-01</b> 058 129 717 B 	<b>X51632-01</b> 058 253 039 L 	<b>X54226-01</b> 058 103 609 Aluminium  <b>70-31414-10</b> 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P77317-01</b> K → 028 103 171 B PTFE <b>P76087-01</b> N 2x 068 103 085 E 32x47x10 A SL WD FPM
1,8 AJP AQE ARH	92 kW (125 PS)	A6	07/97-01/05	<b>D32936-00</b> <sup>12</sup> 06B 198 012 <b>B32936-00</b> <sup>13</sup> <sup>35</sup> <b>Z36190-00</b> <sup>8</sup> 058 198 217	<b>H50997-00</b> 06B 103 383 B 82 Ø 1,6 mm MLS 	<b>T80109-00</b> 06A 103 385 C (10x) 	<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X57659-01</b> 058 129 717 B 	<b>X51632-01</b> 058 253 039 L  <b>X51169-01</b> 431 253 115 A	<b>X54808-01</b> 06B 103 609 Aluminium  <b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01</b> K → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
1,8 AMB BEX BFB	120-140 kW (163-190 PS)	A4 T	→8E 3 500 000 07/01-03/09	<b>D32934-00</b> <sup>12</sup> <b>B32934-00</b> <sup>13</sup> <sup>38</sup> <b>Z36190-00</b> <sup>8</sup> 058 198 217	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T50468-00</b> 06A 103 385 A (10x) 	<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X57659-01</b> 058 129 717 B 	<b>X51632-01</b> 058 253 039 L 	<b>70-31414-10</b> 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P77183-01</b> K → 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01</b> N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,8 AMB BEX BFB	120-140 kW (163-190 PS)	A4 T	8E 4 000 001→ 07/01-03/09	<b>D36707-00</b> <sup>12</sup> <b>B32934-00</b> <sup>13</sup> <sup>38</sup> <b>Z36190-00</b> <sup>8</sup> 058 198 217	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T50468-00</b> 06A 103 385 A (10x) 	<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X81684-01</b> 06B 129 717 F 	<b>X51632-01</b> 058 253 039 L 	<b>70-31414-10</b> 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P77183-01</b> K → 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01</b> N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,8 ANB APT APU ARG AVV	92-110 kW (125-150 PS)	A4 A4 T A6 T	01/95-01/05	<b>D32232-00</b> <sup>12</sup> 058 198 012 +058 198 025 A <b>B37030-00</b> <sup>13</sup> <sup>35</sup> <b>Z36190-00</b> <sup>8</sup> 058 198 217	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T10468-00</b> 058 103 385 A (10x) 	<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X57659-01</b> 058 129 717 B 	<b>X51632-01</b> 058 253 039 L 	<b>X54226-01</b> 058 103 609 Aluminium  <b>70-31414-10</b> 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P77317-01</b> K → 028 103 171 B PTFE <b>P76087-01</b> N 2x 068 103 085 E 32x47x10 A SL WD FPM

AUDI													
1,8 ANQ	92 kW (125 PS)	A6	07/97-01/05	<b>D32934-00</b> <sup>12</sup> <b>B32934-00</b> <sup>13 38</sup> 06A 198 011 A <b>Z36190-00</b> <sup>8</sup> 058 198 217	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T50468-00</b> 06A 103 385 A (10x) 	<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X57659-01</b> 058 129 717 B 		<b>X51632-01</b> 058 253 039 L  <b>X07867-01</b> <sup>1</sup> 533 253 115 D 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01 N</b> → <sup>2x</sup> 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,8 APG	92 kW (125 PS)	A3	09/96-05/03	<b>D36707-00</b> <sup>12</sup> <b>B36707-00</b> <sup>13 35</sup> <b>Z36190-00</b> <sup>8</sup> 058 198 217	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T50468-00</b> 06A 103 385 A (10x) 	<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X88304-01</b> 4x 06A 133 398 D 		<b>X51632-01</b> 058 253 039 L 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77183-01 K</b> → <sup>2x</sup> 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,8 AWL	110 kW (150 PS)	A6 T	01/97-01/05	<b>D32240-00</b> <sup>12</sup> 06A 198 012 A <b>B32934-00</b> <sup>13 38</sup> 06A 198 011 A <b>Z36190-00</b> <sup>8</sup> 058 198 217	<b>H50468-00</b> 058 103 383 Q 82,5 Ø MLS 	<b>T50468-00</b> 06A 103 385 A (10x) 	<b>V53271-00</b> 058 198 025 A 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 20x	<b>X57659-01</b> 058 129 717 B 		<b>X51632-01</b> 058 253 039 L  <b>X07867-01</b> <sup>1</sup> 533 253 115 D 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01 N</b> → <sup>2x</sup> 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,8 BYT	118 kW (160 PS)	A3 TFSI	11/06-03/13		<b>H80727-00</b> 06H 103 383 Q 82,5 Ø MLS 	<b>T80727-00</b> 06D 103 385 D (10x) 	<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X89272-01</b> 06J 129 717 		<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P77451-01 K</b> ← 06H 103 383 G 45x60x8 AB SL RD FPM <b>P77754-01 K</b> → <sup>2x</sup> 06H 103 171 F 85x132/152x15,7 PTFE
1,8 BZB CABA CABB CABD	88-125 kW (120-170 PS)	A3 TFSI A4 TFSI A5 TFSI	11/06→	<b>D40567-00</b> <sup>12</sup> <b>B38289-00</b> <sup>13 35</sup>	<b>H40567-00</b> 06H 103 383 AC 83 Ø MLS 	<b>T80727-00</b> 06D 103 385 D (10x) 	<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X89272-01</b> 06J 129 717  <b>X89273-01</b> 06F 129 717 D 		<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P77451-01 K</b> ← 06H 103 383 G 45x60x8 AB SL RD FPM <b>P77754-01 K</b> → <sup>2x</sup> 06H 103 171 F 85x132/152x15,7 PTFE
1,8 CUA CDAA CDHA CDHB	88-118 kW (120-160 PS)	A3 TFSI A4 TFSI A5 TFSI TT TFSI	11/06→	<b>D40567-00</b> <sup>12</sup> <b>B38289-00</b> <sup>13 35</sup>	<b>H40567-00</b> 06H 103 383 AC 83 Ø MLS 	<b>T40708-00</b> WHT 005 305 (10x)  <b>T80727-00</b> 06D 103 385 D (10x) 	<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X89272-01</b> 06J 129 717  <b>X89273-01</b> 06F 129 717 D 		<b>X81829-01</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>P77451-01 K</b> ← 06H 103 383 G 45x60x8 AB SL RD FPM <b>P77754-01 K</b> → <sup>2x</sup> 06H 103 171 F 85x132/152x15,7 PTFE
1,8 CJEB	125 kW (170 PS)	A4 TFSI A5 TFSI	10/07→	<b>D40708-01</b> <sup>12</sup> <b>B38749-00</b> <sup>13 35</sup>	<b>H40708-00</b> 06K 103 383 K 83 Ø MLS 	<b>T40708-00</b> WHT 005 305 (10x) 	<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x	<b>X59914-01</b> 06K 129 717 A 		<b>X59924-01</b> 06L 253 039 	<b>X59956-01</b> 06L 103 649  <b>70-31414-10</b> 	<b>P77842-01 K</b> ← 06L 103 085 B 45x60x8 A SL RD PTFE ACM <b>P77846-01 K</b> → <sup>2x</sup> 06K 103 171 A PTFE →02/14

AUDI												
1,8 CJSB CJSB CNSB <b>[NEW]</b>	125-132 kW (170-180 PS)	A3 TFSI TT TFSI	04/12→ 	<b>D40708-01</b> <sup>12</sup> <b>B82501-00</b> <sup>13</sup>	<b>H40708-00</b> 06K 103 383 K 83 Ø MLS 	<b>T40708-00</b> WHT 005 305 (10x) 	<b>70-31414-10</b> 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X59914-01</b> 06K 129 717 A 16x 	<b>X59924-01</b> 06L 253 039 	<b>X90114-01</b> 06K 103 649  <b>70-31414-10</b> 	<b>P77842-01 K</b> ← 06L 103 085 B 45x60x8 A SL RD PTFE ACM <b>P77846-01 K</b> → 06K 103 171 A PTFE
1,8 DD DR DS JV JW NP SH 4B	55-66 kW (75-90 PS)	COUPE 100 80	08/81-11/90	<b>S31192-00</b> <sup>12</sup> <sup>13</sup> <b>D31192-00</b> <sup>12</sup> 026 198 012 AB <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✕ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x  <b>X55170-01</b> 026 129 717 F  <b>X07853-01</b> <sup>10</sup> 035 121 171 C 	<b>X03747-01</b> 026 129 589 A  <b>X07854-01</b> <sup>10</sup> 841 253 115 B  <b>X07867-01</b> <sup>10</sup> ✕ 533 253 115 D 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,8 DZ MU NE RU SF	55-82 kW (75-112 PS)	COUPE 80	08/84→	<b>S31448-00</b> <sup>12</sup> <sup>13</sup> <b>D31448-00</b> <sup>12</sup> 026 198 012 AD <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✕ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x  <b>X55170-01</b> 026 129 717 F 	<b>X03747-01</b> 026 129 589 A  <b>X51169-01</b> <sup>10</sup> 431 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,8 JN PH PM PV RS	55-81 kW (75-110 PS)	COUPE 100 80	08/82-10/91	<b>S31443-00</b> <sup>12</sup> <sup>13</sup> <b>D31443-00</b> <sup>12</sup> <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H04843-00</b> 026 103 383 P 82 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✕ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x  <b>X55170-01</b> 026 129 717 F 	<b>X03747-01</b> 026 129 589 A  <b>X51157-01</b> <sup>10</sup> 433 253 115 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
1,8 SD	83 kW (113 PS)	80	09/86-08/90	<b>S31449-00</b> <sup>12</sup> <sup>13</sup> <b>D31449-00</b> <sup>12</sup> 053198012A <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✕ 026 198 025 C 6,5 mm Gummi  1 Dichtlippe	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X55170-01</b> 026 129 717 F 8x 	<b>X03747-01</b> 026 129 589 A  <b>X51169-01</b> <sup>10</sup> 431 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM





AUDI												
Ltr.												
1,9 AFF	55 kW (75 PS)	A4 TDI	12/95-09/01	<p><b>S32231-00</b> <sup>12</sup> <sup>13</sup> Mot.→AFF 002 000</p> <p></p> <p><b>S32721-00</b> <sup>12</sup> <sup>13</sup> Mot.AFF 002 001→</p> <p></p> <p><b>D32231-00</b> <sup>12</sup> 028 198 012 C Mot.→AFF 002 000</p> <p></p> <p><b>D32721-00</b> <sup>12</sup> 028 198 012 F Mot.AFF 002 001→</p> <p></p> <p><b>B32231-00</b> <sup>13</sup> 028 198 011 D</p> <p></p> <p><b>B37015-00</b> <sup>13</sup> <sup>35</sup></p> <p></p>	<p><b>H02392-00</b> 028 103 383 BL 1,45 mm 1 </p> <p>MLS</p> <p><b>H12392-10</b> 028 103 383 BM 1,53 mm 2 </p> <p>MLS</p> <p><b>H22392-20</b> 028 103 383 BN 81 Ø</p> <p>1,61 mm 3 </p> <p>MLS</p> <p></p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p> <p></p>	<p><b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x)</p> <p></p>	<p><b>N90300-00</b> 026 109 675 (8x) Mot.→AFF 002 000</p> <p><b>N91190-00</b> 027 109 675 (8x) Mot.AFF 002 001→</p> <p><b>P76531-00</b> 8x 026 109 675 Mot.→AFF 002 000</p> <p><b>P76532-00</b> 8x 027 109 675 Mot.AFF 002 001→</p>	<p><b>X55431-01</b> 028 129 717 D</p> <p></p>	<p><b>X03747-01</b> 026 129 589 A</p> <p></p>	<p>4x <b>X54361-01</b> 037 115 220 B NBR</p> <p></p> <p><b>X54624-01</b> 044 103 609 D ACM</p> <p></p> <p><b>70-31414-10</b></p> <p></p>	<p><b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM →12/97</p> <p><b>P77317-01 K</b> → </p> <p>PTFE 01/98→</p> <p><b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
1,9 AFN	81 kW (110 PS)	A4 TDI A6 TDI	10/95-09/01	<p><b>S32231-00</b> <sup>12</sup> <sup>13</sup> Mot.→AFN 002 000</p> <p></p> <p><b>S32721-00</b> <sup>12</sup> <sup>13</sup> Mot.AFN 002 001→</p> <p></p> <p><b>D32231-00</b> <sup>12</sup> 028 198 012 C Mot.→AFN 002 000</p> <p></p> <p><b>D32721-00</b> <sup>12</sup> 028 198 012 F Mot.AFN 002 001→</p> <p></p> <p><b>B32231-00</b> <sup>13</sup> 028 198 011 D Mot.→AFN 576 000</p> <p></p> <p><b>B37015-00</b> <sup>13</sup> <sup>35</sup> Mot.AFN 576 001→</p> <p></p>	<p><b>H02392-00</b> 028 103 383 BL 1,45 mm 1 </p> <p>MLS</p> <p><b>H12392-10</b> 028 103 383 BM 1,53 mm 2 </p> <p>MLS</p> <p><b>H22392-20</b> 028 103 383 BN 81 Ø</p> <p>1,61 mm 3 </p> <p>MLS</p> <p></p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p> <p></p>	<p><b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x)</p> <p></p>	<p><b>N90300-00</b> 026 109 675 (8x) Mot.→AFN 002 000</p> <p><b>N91190-00</b> 027 109 675 (8x) Mot.AFN 002 001→</p> <p><b>P76531-00</b> 8x 026 109 675 Mot.→AFN 002 000</p> <p><b>P76532-00</b> 8x 027 109 675 Mot.AFN 002 001→</p>	<p><b>X55431-01</b> 028 129 717 D</p> <p></p>	<p><b>X03747-01</b> 026 129 589 A</p> <p></p>	<p>4x <b>X54361-01</b> 037 115 220 B NBR</p> <p></p> <p><b>X54624-01</b> 044 103 609 D ACM</p> <p></p> <p><b>70-31414-10</b></p> <p></p>	<p><b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM</p> <p><b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>

AUDI												
Ltr.												
1,9 AGR	66 kW (90 PS)	A3 TDI	09/96-07/01	<p><b>S32241-00</b> <sup>12</sup> <sup>13</sup></p> <p><b>D32241-00</b> <sup>12</sup></p> <p>038 198 012</p> <p><b>B32241-00</b> <sup>13</sup> <sup>38</sup></p> <p>038 198 011</p>	<p><b>H06033-00</b></p> <p>038 103 383 G</p> <p>1,45 mm 1 </p> <p>MLS</p> <p>Mot.→AGR 151 000</p> <p><b>H16033-10</b></p> <p>038 103 383 F</p> <p>1,53 mm 2 </p> <p>MLS</p> <p>Mot.→AGR 151 000</p> <p><b>H26033-20</b></p> <p>038 103 383 E</p> <p>80,5 Ø</p> <p>1,61 mm 3 </p> <p>MLS</p> <p>Mot.→AGR 151 000</p> <p><b>H03518-00</b></p> <p>038 103 383 AL</p> <p>1,47 mm 1 </p> <p>MLS</p> <p>Mot.AGR 151 001→</p> <p><b>H13518-10</b></p> <p>038 103 383 AM</p> <p>1,57 mm 2 </p> <p>MLS</p> <p>Mot.AGR 151 001→</p> <p><b>H23518-20</b></p> <p>038 103 383 AN</p> <p>80,5 Ø</p> <p>1,67 mm 3 </p> <p>MLS</p> <p>Mot.AGR 151 001→</p>	<p><b>T02673-00</b></p> <p>068 103 384 A (10x)</p>	<p><b>N91190-00</b></p> <p>027 109 675 (8x)</p> <p><b>P76532-00</b></p> <p>027 109 675</p>	<p><b>X55431-01</b></p> <p>028 129 717 D</p> <p>8x </p>	<p><b>X03747-01</b></p> <p>026 129 589 A</p> <p><b>X51638-01</b> </p> <p>037 253 039 D</p> <p><b>X51706-01</b> </p> <p>3A0 253 115</p> <p><b>X52970-01</b> </p> <p>1H0 253 115 A</p>	<p>4x <b>70-31414-10</b></p>	<p><b>P76096-01 K</b> ←</p> <p>069 115 147 C</p> <p>35x48x10</p> <p>A SL RD FPM</p> <p><b>P77183-01 K</b> → </p> <p>06A 103 171 A</p> <p>85x131/152x15,7</p> <p>PTFE</p> <p><b>P76087-01 N</b></p> <p>068 103 085 E</p> <p>32x47x10</p> <p>A SL WD FPM</p>	

AUDI													
Ltr.													
1,9 AHF	81 kW (110 PS)	A3 TDI	08/97-07/01	<p><b>S32241-00</b> <sup>12</sup> <sup>13</sup></p> <p><b>D32241-00</b> <sup>12</sup></p> <p><b>B32241-00</b> <sup>13</sup> <sup>38</sup></p>	<p><b>H06033-00</b> 038 103 383 G 1,45 mm 1 </p> <p>MLS Mot.→AHF 140 000</p> <p><b>H16033-10</b> 038 103 383 F 1,53 mm 2 </p> <p>MLS Mot.→AHF 140 000</p> <p><b>H26033-20</b> 038 103 383 E 80,5 Ø 1,61 mm 3 </p> <p>MLS Mot.→AHF 140 000</p> <p><b>H03518-00</b> 038 103 383 AL 1,47 mm 1 </p> <p>MLS Mot.AHF 140 001→</p> <p><b>H13518-10</b> 038 103 383 AM 1,57 mm 2 </p> <p>MLS Mot.AHF 140 001→</p> <p><b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 </p> <p>MLS Mot.AHF 140 001→</p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p>		<p><b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675</p>	<p><b>X55431-01</b> 028 129 717 D</p> <p>8x </p>		<p><b>X03747-01</b> 026 129 589 A</p> <p>4x </p> <p><b>X51638-01</b> </p> <p>037 253 039 D</p> <p><b>X51706-01</b> </p> <p>3A0 253 115</p> <p><b>X52970-01</b> </p> <p>1H0 253 115 A</p>	<p><b>70-31414-10</b></p>	<p><b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM</p> <p><b>P77183-01</b> K → </p> <p>06A 103 171 A 85x131/152x15,7 PTFE</p> <p><b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM</p>
1,9 AHH AVG	66-81 kW (90-110 PS)	A4 TDI A6 TDI	01/95-09/01	<p><b>D32721-00</b> <sup>12</sup></p> <p><b>B37015-00</b> <sup>13</sup> <sup>35</sup></p>	<p><b>H02392-00</b> 028 103 383 BL 1,45 mm 1 </p> <p>MLS</p> <p><b>H12392-10</b> 028 103 383 BM 1,53 mm 2 </p> <p>MLS</p> <p><b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3 </p> <p>MLS</p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p>	<p><b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x)</p>	<p><b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675</p>	<p><b>X55431-01</b> 028 129 717 D</p> <p>8x </p>		<p><b>X03747-01</b> 026 129 589 A</p> <p>4x </p>	<p><b>X54624-01</b> 044 103 609 D ACM</p> <p><b>70-31414-10</b></p>	<p><b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>P77317-01</b> K → </p> <p>028 103 171 B PTFE</p> <p><b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM</p>

AUDI												
1.9 AHU	66 kW (90 PS)	A4 TDI A6 TDI CABRIOLET TDI	06/94-09/01	<p><b>S32721-00</b> <sup>12</sup> <sup>13</sup></p> <p><b>D32721-00</b> <sup>12</sup></p> <p>028 198 012 F</p> <p><b>B32231-00</b> <sup>13</sup></p> <p>028 198 011 D</p>	<p><b>H02392-00</b></p> <p>028 103 383 BL</p> <p>1,45 mm 1 </p> <p>MLS</p> <p><b>H12392-10</b></p> <p>028 103 383 BM</p> <p>1,53 mm 2 </p> <p>MLS</p> <p><b>H22392-20</b></p> <p>028 103 383 BN</p> <p>81 Ø</p> <p>1,61 mm 3 </p> <p>MLS</p>	<p><b>T02673-00</b></p> <p>068 103 384 A (10x)</p>	<p><b>V32231-00</b></p> <p>028 103 483 G</p> <p>+028 103 532 A (3x)</p> <p>+028 103 533 (3x)</p>	<p><b>N91190-00</b></p> <p>027 109 675 (8x)</p> <p><b>P76532-00</b></p> <p>027 109 675</p>	<p><b>X55431-01</b></p> <p>028 129 717 D</p> <p>8x</p>	<p><b>X03747-01</b></p> <p>026 129 589 A</p>	<p>4x <b>X54361-01</b></p> <p>037 115 220 B</p> <p>NBR</p> <p><b>X54624-01</b></p> <p>044 103 609 D</p> <p>ACM</p>	<p><b>P76087-01 K</b> ←</p> <p>068 103 085 E</p> <p>32x47x10</p> <p>A SL WD FPM</p> <p><b>P76355-11 K</b> →</p> <p>068 103 051 P</p> <p>85x105x9</p> <p>A SL LD FPM</p> <p><b>P76087-01 N</b></p> <p>068 103 085 E</p> <p>32x47x10</p> <p>A SL WD FPM</p>
1.9 AJM ASZ ATD ATJ AVB AVF AWX AXR BKE BRB	74-96 kW (100-130 PS)	A3 TDI A4 TDI A6 TDI	03/00-06/08	<p><b>D32937-00</b> <sup>12</sup></p> <p><b>B32937-00</b> <sup>13</sup> <sup>35</sup></p>	<p><b>H09538-00</b></p> <p>038 103 383 DE</p> <p>80,5 Ø</p> <p>1,45 mm 1 </p> <p>MLS</p> <p><b>H19538-10</b></p> <p>038 103 383 DF</p> <p>80,5 Ø</p> <p>1,53 mm 2 </p> <p>MLS</p> <p><b>H29538-20</b></p> <p>038 103 383 DG</p> <p>80,5 Ø</p> <p>1,61 mm 3 </p> <p>MLS</p>	<p><b>T03518-00</b></p> <p>038 103 384 (10x)</p>	<p><b>X53715-01</b></p> <p>038 103 483 D</p> <p>ACM</p>	<p><b>N91190-00</b></p> <p>027 109 675 (8x)</p> <p><b>P76532-00</b></p> <p>027 109 675</p>	<p><b>X55431-01</b></p> <p>028 129 717 D</p> <p>8x</p>	<p><b>X03747-01</b></p> <p>026 129 589 A</p> <p><b>X51638-01</b> ✕</p> <p>037 253 039 D</p> <p><b>X51706-01</b> ✕</p> <p>3A0 253 115</p>	<p>4x <b>70-31414-10</b></p>	<p><b>P76096-11 K</b> ←</p> <p>038 103 085 E</p> <p>35x48x10</p> <p>A SL RD PTFE ACM</p> <p><b>P77183-01 K</b> → </p> <p>06A 103 171 A</p> <p>85x131/152x15,7</p> <p>PTFE</p> <p><b>P77181-01 N</b></p> <p>038 103 085 A</p> <p>32x47x10</p> <p>A SL RD PTFE ACM</p>

AUDI													
Ltr.													
1,9 ALH	66 kW (90 PS)	A3 TDI	09/96-07/01	<p><b>S32241-00</b> <sup>12</sup> <sup>13</sup></p> <p><b>D32241-00</b> <sup>12</sup></p> <p><b>B32241-00</b> <sup>13</sup> <sup>38</sup></p>	<p><b>H06033-00</b> 038 103 383 G 1,45 mm 1 </p> <p>MLS Mot.→ALH 085 000</p> <p><b>H16033-10</b> 038 103 383 F 1,53 mm 2 </p> <p>MLS Mot.→ALH 085 000</p> <p><b>H26033-20</b> 038 103 383 E 80,5 Ø 1,61 mm 3 </p> <p>MLS Mot.→ALH 085 000</p> <p><b>H03518-00</b> 038 103 383 AL 1,47 mm 1 </p> <p>MLS Mot.ALH 085 001→</p> <p><b>H13518-10</b> 038 103 383 AM 1,57 mm 2 </p> <p>MLS Mot.ALH 085 001→</p> <p><b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 </p> <p>MLS Mot.ALH 085 001→</p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p>		<p><b>N91190-00</b> 027 109 675 (8x)</p> <p><b>P76532-00</b> 027 109 675</p>	<p><b>X55431-01</b> 028 129 717 D</p> <p>8x </p>		<p><b>X03747-01</b> 026 129 589 A</p> <p>4x </p> <p><b>X51638-01</b> </p> <p>037 253 039 D</p> <p><b>X51706-01</b> </p> <p>3A0 253 115</p> <p><b>X52970-01</b> </p> <p>1H0 253 115 A</p>	<p><b>70-31414-10</b></p>	<p><b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM</p> <p><b>P77183-01 K</b> → </p> <p>06A 103 171 A 85x131/152x15,7 PTFE</p> <p><b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
1,9 ASV	81 kW (110 PS)	A3 TDI	08/97-07/01	<p><b>S32241-00</b> <sup>12</sup> <sup>13</sup></p> <p><b>D32241-00</b> <sup>12</sup></p> <p><b>B32241-00</b> <sup>13</sup> <sup>38</sup></p>	<p><b>H03518-00</b> 038 103 383 AL 1,47 mm 1 </p> <p>MLS</p> <p><b>H13518-10</b> 038 103 383 AM 1,57 mm 2 </p> <p>MLS</p> <p><b>H23518-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 </p> <p>MLS</p>	<p><b>T02673-00</b> 068 103 384 A (10x)</p>		<p><b>N91190-00</b> 027 109 675 (8x)</p> <p><b>P76532-00</b> 027 109 675</p>	<p><b>X55431-01</b> 028 129 717 D</p> <p>8x </p>		<p><b>X03747-01</b> 026 129 589 A</p> <p>4x </p> <p><b>X51638-01</b> </p> <p>037 253 039 D</p> <p><b>X51706-01</b> </p> <p>3A0 253 115</p> <p><b>X52970-01</b> </p> <p>1H0 253 115 A</p>	<p><b>70-31414-10</b></p>	<p><b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM</p> <p><b>P77183-01 K</b> → </p> <p>06A 103 171 A 85x131/152x15,7 PTFE</p> <p><b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>

AUDI												
Ltr.												
1,9 BKC BXE	77 kW (105 PS)	A3 TDI	05/03-05/10	<b>D32937-00</b> <sup>12</sup>  <b>B36708-00</b> <sup>13 35</sup>	<b>H09538-00</b> 038 103 383 DE 80,5 Ø 1,45 mm 1 MLS <b>H19538-10</b> 038 103 383 DF 80,5 Ø 1,53 mm 2 MLS <b>H29538-20</b> 038 103 383 DG 80,5 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 	<b>X53715-01</b> 038 103 483 D ACM 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x 	<b>X51638-01</b> 037 253 039 D <b>X51706-01</b> 3A0 253 115 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K</b> → 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,9 BLS	77 kW (105 PS)	A3 TDI	05/03-05/10	<b>D37051-00</b> <sup>12</sup>  <b>B36708-00</b> <sup>13 35</sup>	<b>H09538-00</b> 038 103 383 DE 80,5 Ø 1,45 mm 1 MLS <b>H19538-10</b> 038 103 383 DF 80,5 Ø 1,53 mm 2 MLS <b>H29538-20</b> 038 103 383 DG 80,5 Ø 1,61 mm 3 MLS 	<b>T03518-00</b> 038 103 384 (10x) 	<b>X83120-01</b> 03G 103 483 D NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675	<b>X55431-01</b> 028 129 717 D 8x 	<b>X81833-01</b> 03G 253 039 A 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77353-11 K</b> → 038 103 171 S PTFE <b>P77181-01 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,9 WH WN	74-85 kW (100-115 PS)	COUPE 100 80	08/80-07/84	<b>S31200-00</b> <sup>12 13</sup> <b>D31200-00</b> <sup>12</sup> 035 198 012 L <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	<b>X02658-01</b> 034 129 717 M 10x 	<b>X03747-01</b> 026 129 589 A <b>X51169-01</b> 431 253 115 A 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM

AUDI												
Ltr.												
1,9 1Y	50 kW (68 PS)	80 D	08/89-08/91	<p><b>S31598-00</b> <sup>12</sup> <sup>13</sup> </p> <p><b>D31598-00</b> <sup>12</sup> 028 198 012 B </p> <p><b>B31598-00</b> <sup>13</sup> 028 198 011 B </p>	<p><b>H02390-00</b> 028 103 383 BB 1,6 mm 1  Mot.→1Y315599</p> <p><b>H12390-10</b> 028 103 383 BC 1,65 mm 2  Mot.→1Y315599</p> <p><b>H22390-20</b> 028 103 383 BD 81 Ø 1,7 mm 3  Mot.→1Y315599</p> <p><b>H02391-00</b> 028 103 383 BH 1,53 mm 1  MLS Mot.1Y315600→</p> <p><b>H12391-10</b> 028 103 383 BJ 1,57 mm 2  MLS Mot.1Y315600→</p> <p><b>H22391-20</b> 028 103 383 BK 81 Ø 1,61 mm 3  MLS Mot.1Y315600→</p>	<p><b>T02673-00</b> 068 103 384 A (10x) </p>	<p><b>V31598-00</b> 028 198 025 </p> <p><b>X53152-01</b> 028 103 483 B ACM </p>	<p><b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675</p>	<p><b>X55431-01</b> 028 129 717 D 8x </p>	<p><b>X03747-01</b> 026 129 589 A </p> <p><b>X81385-01</b> </p> <p>155 253 115</p>	<p>4x <b>X54361-01</b> 037 115 220 B NBR </p>	<p><b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM</p> <p><b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
1,9 1Z	66 kW (90 PS)	A4 TDI A6 TDI CABRIOLET TDI 80 TDI	09/91-09/01	<p><b>S32231-00</b> <sup>12</sup> <sup>13</sup> Mot.→1Z 770 000 </p> <p><b>S32721-00</b> <sup>12</sup> <sup>13</sup> Mot.1Z 770 001→ </p> <p><b>D32231-00</b> <sup>12</sup> 028 198 012 C Mot.→1Z 770 000 </p> <p><b>D32721-00</b> <sup>12</sup> 028 198 012 F Mot.1Z 770 001→ </p> <p><b>B32231-00</b> <sup>13</sup> 028 198 011 D </p>	<p><b>H02392-00</b> 028 103 383 BL 1,45 mm 1  MLS</p> <p><b>H12392-10</b> 028 103 383 BM 1,53 mm 2  MLS</p> <p><b>H22392-20</b> 028 103 383 BN 81 Ø 1,61 mm 3  MLS</p>	<p><b>T02673-00</b> 068 103 384 A (10x) </p>	<p><b>V32231-00</b> 028 103 483 G +028 103 532 A (3x) +028 103 533 (3x) </p>	<p><b>N90300-00</b> 026 109 675 (8x) Mot.→1Z 770 000</p> <p><b>N91190-00</b> 027 109 675 (8x) Mot.1Z 770 001→</p> <p><b>P76531-00</b> 026 109 675 8x</p> <p>Mot.→1Z 770 000</p> <p><b>P76532-00</b> 027 109 675 8x Mot.1Z 770 001→</p>	<p><b>X55431-01</b> 028 129 717 D </p>	<p><b>X03747-01</b> 026 129 589 A </p>	<p>4x <b>X54361-01</b> 037 115 220 B NBR </p> <p><b>X54624-01</b> 044 103 609 D ACM </p>	<p><b>P76087-01 K</b> ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM</p> <p><b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>



AUDI													
2,0 AAD	82-85 kW (112-115 PS)	COUPE 100 80	05/89-12/96	<b>S31636-00</b> <sup>(12)</sup> <sup>(13)</sup> <b>D31636-00</b> <sup>(12)</sup> 048 198 012 <b>B31640-00</b> <sup>(13)</sup> 037 198 011 E	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork  <b>V53509-00</b> ✕ 026 198 025 C 6,5 mm Gummi  - 1 Dichtlippe	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x  <b>X55626-01</b> 048 129 717 A 	<b>X03747-01</b> 026 129 589 A  <b>X51169-01</b> <sup>(A)</sup> 431 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)  <b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,0 AAE	74 kW (100 PS)	100	→4A P 075 000 12/90-06/94	<b>D31636-00</b> <sup>(12)</sup> 048 198 012 <b>B32233-00</b> <sup>(13)</sup> 037 198 011 G	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x  <b>X55430-01</b> 048 129 717 A  <b>X07853-01</b> <sup>(10)</sup> 035 121 171 C 	<b>X03747-01</b> 026 129 589 A  <b>X51947-01</b> 037 253 039  <b>X51169-01</b> <sup>(A)</sup> 431 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)  <b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,0 AAE	74 kW (100 PS)	100	4A P 075 001→ 12/90-06/94	<b>D32688-00</b> <sup>(12)</sup> 048 198 012 B <b>B32233-00</b> <sup>(13)</sup> 037 198 011 G	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>X53263-01</b> 051 103 483 A ACM  - 2 Dichtlippen	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675	<b>X04875-01</b> 026 129 717 D 8x  <b>X55430-01</b> 048 129 717 A  <b>X07853-01</b> <sup>(10)</sup> 035 121 171 C 	<b>X03747-01</b> 026 129 589 A  <b>X51947-01</b> 037 253 039  <b>X51169-01</b> <sup>(A)</sup> 431 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)  <b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,0 AAE	74 kW (100 PS)	A6	06/94-12/97	<b>D37006-00</b> <sup>(12)</sup> 048 198 012 C Mot.→AAE 032 209 <b>D32234-00</b> <sup>(12)</sup> 048 198 012 D Mot.AAE 032 210→ <b>B32233-00</b> <sup>(13)</sup> 037 198 011 G	<b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS 	<b>T50469-00</b> 050 103 384 (10x) 	<b>X53263-01</b> 051 103 483 A ACM  - 2 Dichtlippen	<b>N90300-00</b> 026 109 675 (8x) Mot.→AAE 032 209 <b>N91190-00</b> 027 109 675 (8x) Mot.AAE 032 210→ <b>P76531-00</b> 026 109 675 Mot.→AAE 032 209 <b>P76532-00</b> 027 109 675 Mot.AAE 032 210→	<b>X04875-01</b> 026 129 717 D 8x  <b>X55430-01</b> 048 129 717 A  <b>X07853-01</b> <sup>(10)</sup> 035 121 171 C 	<b>X03747-01</b> 026 129 589 A Mot.→AAE 032 209  <b>X51947-01</b> 037 253 039 Mot.AAE 032 210→  <b>X51169-01</b> <sup>(A)</sup> 431 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)  <b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI													
2,0 ABK	85 kW (115 PS)	A6	06/94-06/96	<p><b>D32688-00</b> <sup>12</sup> 048 198 012 B Ch.→4A S 110 000</p> <p><b>D37006-00</b> <sup>12</sup> 048 198 012 C Ch.4A S 110 001→ Mot.→ABK 245 263</p> <p><b>D32234-00</b> <sup>12</sup> 048 198 012 D Mot.ABK 245 264→</p> <p><b>B32233-00</b> <sup>13</sup> 037 198 011 G</p>	<p><b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm Ch.→4A S 110 000</p> <p><b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS Ch.4A S 110 001→</p>	<p><b>T04125-00</b> 049 103 384 B (10x) Ch.→4A S 110 000</p> <p><b>T50469-00</b> 050 103 384 (10x) Ch.4A S 110 001→</p>	<p><b>X53263-01</b> 051 103 483 A</p> <p>2 Dichtlippen</p>	<p><b>N90300-00</b> 026 109 675 (8x) Mot.→ABK 245 263</p> <p><b>N91190-00</b> 027 109 675 (8x) Mot.ABK 245 264→</p> <p><b>P76531-00</b> 026 109 675</p> <p><b>P76532-00</b> 027 109 675 Mot.ABK 245 264→</p>	<p><b>X55626-01</b> 048 129 717 A</p> <p><b>X57858-01</b> 048 129 717 B</p>	<p><b>X03747-01</b> 026 129 589 A</p> <p><b>X51947-01</b> 037 253 039</p> <p><b>X51169-01</b> <sup>13</sup> 431 253 115 A</p>	<p>4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)</p> <p><b>X54624-01</b> 044 103 609 D</p>	<p><b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM</p> <p><b>P76087-01</b> N 068 103 085 E 32x47x10</p>	
2,0 ABK	85 kW (115 PS)	CABRIOLET	01/93-09/98	<p><b>D31636-00</b> <sup>12</sup> 048 198 012 Ch.→8G P 006 500</p> <p><b>D32688-00</b> <sup>12</sup> 048 198 012 B Ch.8G P 006 501→ Ch.→8G S 009 000</p> <p><b>D37006-00</b> <sup>12</sup> 048 198 012 C Ch.8G S 009 001→ Mot.→ABK 245 263</p> <p><b>D32234-00</b> <sup>12</sup> 048 198 012 D Mot.ABK 245 264→</p> <p><b>B32233-00</b> <sup>13</sup> 037 198 011 G</p>	<p><b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm Ch.→8G S 009 000</p> <p><b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS Ch.8G S 009 001→</p>	<p><b>T04125-00</b> 049 103 384 B (10x) Ch.→8G S 009 000</p> <p><b>T50469-00</b> 050 103 384 (10x) Ch.8G S 009 001→</p>	<p><b>V30584-00</b> 026 198 025 A Ch.→8G P 006 500</p> <p><b>X53509-00</b> Ch.→8G P 006 500</p> <p><b>X53263-01</b> 051 103 483 A Ch.8G P 006 501→</p> <p>2 Dichtlippen</p>	<p><b>N90300-00</b> 026 109 675 (8x) Mot.→ABK 245 263</p> <p><b>N91190-00</b> 027 109 675 (8x) Mot.ABK 245 264→</p> <p><b>P76531-00</b> 026 109 675</p> <p><b>P76532-00</b> 027 109 675 Mot.ABK 245 264→</p>	<p><b>X55626-01</b> 048 129 717 A</p> <p><b>X57858-01</b> 048 129 717 B</p>	<p><b>X03747-01</b> 026 129 589 A</p> <p><b>X51947-01</b> 037 253 039</p> <p><b>X51169-01</b> <sup>13</sup> 431 253 115 A</p>	<p>4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)</p> <p><b>X54624-01</b> 044 103 609 D</p>	<p><b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM</p> <p><b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM</p>	
2,0 ABK	85 kW (115 PS)	COUPE	08/91-12/95	<p><b>D31636-00</b> <sup>12</sup> 048 198 012 Ch.→8B P 006 500</p> <p><b>D32688-00</b> <sup>12</sup> 048 198 012 B Ch.8B P 006 501→ Ch.→8B S 009 000</p> <p><b>D37006-00</b> <sup>12</sup> 048 198 012 C Ch.8B S 009 001→ Mot.→ABK 245 263</p> <p><b>D32234-00</b> <sup>12</sup> 048 198 012 D Mot.ABK 245 264→</p> <p><b>B32233-00</b> <sup>13</sup> 037 198 011 G</p>	<p><b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm Ch.→8B S 009 000</p> <p><b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS Ch.8B S 009 001→</p>	<p><b>T04125-00</b> 049 103 384 B (10x) Ch.→8B S 009 000</p> <p><b>T50469-00</b> 050 103 384 (10x) Ch.8B S 009 001→</p>	<p><b>V30584-00</b> 026 198 025 A Ch.→8B P 006 500</p> <p><b>X53509-00</b> Ch.→8B P 006 500</p> <p><b>X53263-01</b> 051 103 483 A Ch.8B P 006 501→</p> <p>2 Dichtlippen</p>	<p><b>N90300-00</b> 026 109 675 (8x) Mot.→ABK 245 263</p> <p><b>N91190-00</b> 027 109 675 (8x) Mot.ABK 245 264→</p> <p><b>P76531-00</b> 026 109 675</p> <p><b>P76532-00</b> 027 109 675 Mot.ABK 245 264→</p>	<p><b>X55626-01</b> 048 129 717 A</p> <p><b>X57858-01</b> 048 129 717 B</p>	<p><b>X03747-01</b> 026 129 589 A</p> <p><b>X51947-01</b> 037 253 039</p> <p><b>X51169-01</b> <sup>13</sup> 431 253 115 A</p>	<p>4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)</p> <p><b>X54624-01</b> 044 103 609 D</p>	<p><b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM</p> <p><b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM</p> <p><b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM</p>	

AUDI													
Ltr.													
2,0 ABK	85 kW (115 PS)	100	01/93-07/94	<b>D32688-00</b> ⑫ 048 198 012 B <b>B32233-00</b> ⑬ 037 198 011 G	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>X53263-01</b> 051 103 483 A 2 Dichtlippen 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x 	<b>X55626-01</b> 048 129 717 A  <b>X57858-01</b> 048 129 717 B 		<b>X03747-01</b> 026 129 589 A  <b>X51947-01</b> 037 253 039  <b>X51169-01</b> ⚠ 431 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)  <b>X54624-01</b> 044 103 609 D 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
2,0 ABK	85 kW (115 PS)	80	01/91-07/95	<b>D31636-00</b> ⑫ 048 198 012 Ch.→8C P 185 164 <b>D32688-00</b> ⑫ 048 198 012 B Ch.8C P 185 165→ Ch.→8C S 170 000 <b>D37006-00</b> ⑫ 048 198 012 C Ch.8C S 170 001→ Mot.→ABK 245 263 <b>D32234-00</b> ⑫ 048 198 012 D Mot.ABK 245 264→ <b>B32233-00</b> ⑬ 037 198 011 G	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm Ch.→8C S 170 000  <b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS Ch.8C S 170 001→ 	<b>T04125-00</b> 049 103 384 B (10x) Ch.→8C S 170 000  <b>T50469-00</b> 050 103 384 (10x) Ch.8C S 170 001→ 	<b>V30584-00</b> 026 198 025 A Ch.→8C P 185 164  <b>X53509-00</b> Ch.→8C P 185 164 <b>X53263-01</b> 051 103 483 A Ch.8C P 185 165→ 2 Dichtlippen 	<b>N90300-00</b> 026 109 675 (8x) Mot.→ABK 245 263 <b>N91190-00</b> 027 109 675 (8x) Mot.ABK 245 264→ <b>P76531-00</b> 026 109 675 8x Mot.→ABK 245 263 <b>P76532-00</b> 027 109 675 8x Mot.ABK 245 264→	<b>X55626-01</b> 048 129 717 A  <b>X57858-01</b> 048 129 717 B 		<b>X03747-01</b> 026 129 589 A  <b>X51947-01</b> 037 253 039  <b>X51169-01</b> ⚠ 431 253 115 A 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)  <b>X54624-01</b> 044 103 609 D 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
2,0 ABT	66 kW (90 PS)	80	→8C P 185 164 09/91-01/96	<b>S31636-00</b> ⑫ ⑬ <b>D31636-00</b> ⑫ 048 198 012 <b>B32688-00</b> ⑬	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork 	<b>N90300-00</b> 026 109 675 (8x) Mot.→ABT 246 861 <b>N91190-00</b> ✗ 027 109 675 (8x) Mot.ABT 246 862→ <b>P76531-00</b> 026 109 675 8x Mot.→ABT 246 861 <b>P76532-00</b> ✗ 027 109 675 Mot.ABT 246 862→	<b>X55626-01</b> 048 129 717 A 		<b>X03747-01</b> 026 129 589 A  <b>X51947-01</b> 037 253 039 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)  <b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
2,0 ABT	66 kW (90 PS)	80	8C P 185 165→ 09/91-01/96	<b>S32688-00</b> ⑫ ⑬ <b>D32688-00</b> ⑫ 048 198 012 B Mot.→ABT 246 861 <b>B32688-00</b> ⑬	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>X53263-01</b> 051 103 483 A ACM 2 Dichtlippen 	<b>N90300-00</b> 026 109 675 (8x) Mot.→ABT 246 861 <b>N91190-00</b> ✗ 027 109 675 (8x) Mot.ABT 246 862→ <b>P76531-00</b> 026 109 675 8x Mot.→ABT 246 861 <b>P76532-00</b> ✗ 027 109 675 Mot.ABT 246 862→	<b>X57858-01</b> 048 129 717 B 		<b>X03747-01</b> 026 129 589 A  <b>X51947-01</b> 037 253 039 	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x)  <b>X54624-01</b> 044 103 609 D ACM 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM

AUDI													
2,0 ACE	103 kW (140 PS)	A6 CABRIOLET COUPE 100 80	01/92-12/97	<b>S31638-00</b> <sup>(12)</sup> <sup>(13)</sup> Mot.→ACE 017 542 <b>S32233-00</b> <sup>(12)</sup> <sup>(13)</sup> Mot.ACE 017 543→ <b>D31638-00</b> <sup>(12)</sup> 053 198 012 C Mot.→ACE 017 542 <b>D32233-00</b> <sup>(12)</sup> 053198012D Mot.ACE 017 543→ <b>B31640-00</b> <sup>(13)</sup> 037 198 011 E Mot.→ACE 017 542 <b>B32233-00</b> <sup>(13)</sup> 037 198 011 G Mot.ACE 017 543→	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm Mot.→ACE 017 542  <b>H50469-00</b> 048 103 383 D 83,5 Ø 1,65 mm MLS Mot.ACE 017 543→ 	<b>T04843-00</b> 027 103 385 C (10x) Mot.→ACE 017 542  <b>T50151-00</b> 053 103 385 (10x) Mot.ACE 017 543→ 	<b>V31196-00</b> 027 198 025 Mot.→ACE 017 542  <b>V32233-00</b> 051 198 025 Mot.ACE 017 543→ 	<b>N92850-00</b> 027 109 675 (16x) <b>P76532-00</b> 027 109 675 	<b>X07866-01</b> 037 129 717 F  <b>X07865-01</b> <sup>(10)</sup> 027 129 717 D 	<b>X07855-01</b> 027 129 589 A Mot.→ACE 017 542  <b>X03747-01</b> 026 129 589 A Mot.ACE 017 543→ 	<b>X04116-01</b> 026 103 609 D Mot.→ACE 017 542  <b>X54624-01</b> 044 103 609 D ACM Mot.ACE 017 543→ 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 2x 068 103 085 E 32x47x10 A SL WD FPM	
2,0 ALT	96 kW (130 PS)	A4 A6	11/00-06/08	<b>D36711-00</b> <sup>(12)</sup> <b>B36711-00</b> <sup>(13)</sup> <sup>(38)</sup>	<b>H50827-00</b> 06B 103 383 R 83,5 Ø MLS 	<b>T50827-00</b> 06B 103 385 (10x) 	<b>X83031-01</b> 06B 103 483 H NBR 	<b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 	<b>X88305-01</b> 058 129 717 C 	<b>X81686-01</b> 06B 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01</b> K → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77352-01</b> K → 06B 103 171 E <b>P77181-01</b> N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM	
2,0 AWA AXW BMB	110 kW (150 PS)	A3 FSI A4 FSI	07/02-06/08	<b>D36713-00</b> <sup>(12)</sup> <b>B36711-00</b> <sup>(13)</sup> <sup>(38)</sup>	<b>H80451-00</b> 06D 103 383 L 84 Ø MLS 	<b>T80450-00</b> 06D 103 385 (10x) 	<b>X83032-01</b> 06D 103 483 D 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 	<b>X88306-01</b> 06D 129 717 D 	<b>X81686-01</b> 06B 253 039 E 	<b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77318-01</b> K → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE <b>P77352-01</b> K → 06B 103 171 E <b>P77181-01</b> N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM	
2,0 AXA	85 kW (115 PS)			<b>D36712-00</b> <sup>(12)</sup> <b>B32937-00</b> <sup>(13)</sup> <sup>(35)</sup>	<b>H80098-00</b> 06A 103 383 AN 83,5 Ø MLS 	<b>T50474-00</b> 06A 103 384 C (10x) 	<b>X53809-01</b> NBR 	<b>N91190-00</b> 027 109 675 (8x) <b>P76532-00</b> 027 109 675 	<b>X57668-01</b> 037 129 717 C  <b>X52681-01</b> <sup>(10)</sup> X 	<b>X52965-01</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>P77183-01</b> K → 06A 103 171 A 85x131/152x15,7 PTFE <b>P77181-01</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM	

AUDI													
2,0 AXX BGB BHZ BPG BPJ BPY BUL BWA BWE BWT BYK BZC CDLA CDLB CDLC CDLH CDMA	125-200 kW (170-272 PS)	A1 TFSI A3 S3 A3 TFSI A4 FSI A4 TFSI A6 TFSI S3 TT TFSI	09/04 →	D37050-00 <sup>12</sup> B36707-00 <sup>13 35</sup>	H80449-00 06F 103 383 G 83,5 Ø MLS 	T80727-00 06D 103 385 D (10x) 	X83119-01 06F 103 483 D NBR 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X89273-01 06F 129 717 D 16x 		X81829-01 06F 253 039 F 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77183-01 K → 06A 103 171 A 85x131/152x15,7 PTFE P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,0 AZV BKD	100-103 kW (136-140 PS)	A3 TDI	05/03-03/13	D36710-00 <sup>12</sup>  B36708-00 <sup>13 35</sup>	H08124-00 03G 103 383 1,55 mm 1 MLS H18124-10 03G 103 383 A 1,63 mm 2 MLS H28124-20 03G 103 383 B 82 Ø 1,7 mm 3 MLS 	T08124-00 03G 103 384 (10x) 	X83030-01 03G 103 483 NBR 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X87466-01 03G 129 717 B 16x 		X81685-01 03G 253 039 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77353-11 K → 038 103 171 S PTFE P77181-01 N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,0 BJZ	85 kW (115 PS)			D36712-00 <sup>12</sup> B32937-00 <sup>13 35</sup>	H80098-00 06A 103 383 AN 83,5 Ø MLS 	T50474-00 06A 103 384 C (10x) 	X53809-01 NBR 	N91190-00 027 109 675 (8x) P76532-00 027 109 675	X75011-01 4x 8x 		X52965-01 06A 253 039 L 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77183-01 K → 06A 103 171 A 85x131/152x15,7 PTFE P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,0 BLB BNA BRD BRE BRF BVA BVF BVG	89-125 kW (121-170 PS)	A4 TDI A6 TDI	07/04 →	D36709-00 <sup>12</sup>  B36708-00 <sup>13 35</sup>	H08124-00 03G 103 383 1,55 mm 1 MLS H18124-10 03G 103 383 A 1,63 mm 2 MLS H28124-20 03G 103 383 B 82 Ø 1,7 mm 3 MLS 	T08124-00 03G 103 384 (10x) 	X83029-01 03G 103 483 B NBR 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X87466-01 03G 129 717 B 16x 		X81685-01 03G 253 039 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77353-11 K → 038 103 171 S PTFE P77181-01 N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM

AUDI													
2,0 BLR BLX BLY BVY BVZ	110 kW (150 PS)	A3 FSI	05/03-06/08	 D37018-00 <sup>12</sup> B36711-00 <sup>13 38</sup>	H80451-00 06D 103 383 L 84 Ø MLS 	T80450-00 06D 103 385 (10x) 	X83112-01 06D 103 483 E NBR 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X88306-01 06D 129 717 D 16x 		X81686-01 06B 253 039 E 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77318-01 K → 06B 103 171 B 85x131/152x15,7 Aluminium PTFE P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,0 BMM	103 kW (140 PS)	A3 TDI	06/05-06/08	 D37051-00 <sup>12</sup> B36708-00 <sup>13 35</sup>	H08008-00 038 103 383 CP 1,45 mm 1 MLS H18008-10 038 103 383 CQ 1,53 mm 2 MLS H28008-20 038 103 383 CR 82 Ø 1,61 mm 3 MLS 	T03518-00 038 103 384 (10x) 	X83120-01 03G 103 483 D NBR 	N91190-00 027 109 675 (8x) P76532-00 027 109 675	X55431-01 028 129 717 D 8x 		X81833-01 03G 253 039 A 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77353-11 K → 038 103 171 S PTFE P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,0 BMN BUY	120-125 kW (163-170 PS)	A3 TDI	03/06-03/13	 D37052-00 <sup>12</sup> B36708-00 <sup>13 35</sup>	H08124-00 03G 103 383 1,55 mm 1 MLS H18124-10 03G 103 383 A 1,63 mm 2 MLS H28124-20 03G 103 383 B 82 Ø 1,7 mm 3 MLS 	T08124-00 03G 103 384 (10x) 	X83121-01 03G 103 483 C NBR 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X87466-01 03G 129 717 B 16x  X89274-01 03G 129 717 C 		X81981-01 03G 253 039 C 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77353-11 K → 038 103 171 S PTFE P77181-01 N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM
2,0 BPW BRC	100-103 kW (136-140 PS)	A4 TDI	11/04→	 D32937-00 <sup>12</sup> B32937-00 <sup>13 35</sup>	H08008-00 038 103 383 CP 1,45 mm 1 MLS H18008-10 038 103 383 CQ 1,53 mm 2 MLS H28008-20 038 103 383 CR 82 Ø 1,61 mm 3 MLS 	T03518-00 038 103 384 (10x) 	X53715-01 038 103 483 D ACM 	N91190-00 027 109 675 (8x) P76532-00 027 109 675	X55431-01 028 129 717 D 8x 		X51638-01 037 253 039 D 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77183-01 K → 06A 103 171 A 85x131/152x15,7 PTFE P77181-01 N 038 103 085 A 32x47x10 A SL RD PTFE ACM

AUDI												
2,0 CADA CAEA CAEB CAWB CBFA CCTA CCZA CESA CETA CFKA	132-155 kW (180-211 PS)	A3 TFSI A4 TFSI A5 TFSI A6 TFSI Q5 TFSI TT TFSI	09/04→									
2,0 CAED CCZC CDNA CDNB CDNC CDZA CHJA CPMA CPMB CPSA	125-162 kW (170-220 PS)	A4 TFSI A5 TFSI A6 TFSI A8 TFSI Q3 TFSI Q5 TFSI	06/08→									
2,0 CAGA CAGB CAHA CAHB CBAA CBAB CBBB CMEA	100-125 kW (136-170 PS)	A3 TDI A4 TDI A5 TDI A6 TDI Q5 TDI TT TDI	05/03→									
2,0 CCTA	147 kW (200 PS)	A3 TFSI	09/04-08/12									

[NEW]

AUDI												
2.0 CFFA CFFB CFHB CFHD CGLE CJCA CJC CJCC CJCD CMFA CMFB [NEW]	88-110 kW (120-150 PS)	A1 TDI A4 TDI A5 TDI A6 TDI Q3 TDI Q5 TDI	11/07→	D38308-00 <sup>12</sup>  B38299-01 <sup>13 38</sup>	H40584-00 03L 103 383 BM 82 Ø 1,55 mm 1 □ MLS H40584-10 03L 103 383 BN 82 Ø 1,63 mm 2 □ MLS H40584-20 03L 103 383 BP 82 Ø 1,71 mm 3 □ MLS 	T50034-00 WHT 002 131 (10x) 	V59500-00 03L 103 483 C +03L 103 070 (4x)  X59500-01 03L 103 483 C 	N92990-00 036 109 675 (16x) P76662-00 036 109 675 	X59474-01 03L 129 717 E 16x 	X59496-01 03L 253 039 E 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77689-01 K → 03L 103 171 A PTFE P77774-01 N 03L 103 085 32x47x10 A RD FPM
2.0 CFFA CFFB CGLA CGLB CLJA CMGA	100-125 kW (136-170 PS)	A3 TDI Q3 TDI Q5 TDI	05/03→	D38308-00 <sup>12</sup>  B38299-00 <sup>13 35</sup>	H40584-00 03L 103 383 BM 82 Ø 1,55 mm 1 □ MLS H40584-10 03L 103 383 BN 82 Ø 1,63 mm 2 □ MLS H40584-20 03L 103 383 BP 82 Ø 1,71 mm 3 □ MLS 	T50034-00 WHT 002 131 (10x) 	V59500-00 03L 103 483 C +03L 103 070 (4x)  X59500-01 03L 103 483 C 	N92990-00 036 109 675 (16x) P76662-00 036 109 675 	X59474-01 03L 129 717 E 16x 	X59496-01 03L 253 039 E 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77689-01 K → 03L 103 171 A PTFE P77774-01 N 03L 103 085 32x47x10 A RD FPM
2.0 CFGB CFGC CFGD CGLC CGLD CLLB CMGB	120-130 kW (163-177 PS)	A3 TDI A4 TDI A5 TDI A6 TDI Q3 TDI Q5 TDI TT TDI	03/06→	D38731-00 <sup>12</sup>  B38299-01 <sup>13 38</sup>	H40584-00 03L 103 383 BM 82 Ø 1,55 mm 1 □ MLS H40584-10 03L 103 383 BN 82 Ø 1,63 mm 2 □ MLS H40584-20 03L 103 383 BP 82 Ø 1,71 mm 3 □ MLS 	T50034-00 WHT 002 131 (10x) 	V59500-00 03L 103 483 C +03L 103 070 (4x)  X59500-01 03L 103 483 C 	N92990-00 036 109 675 (16x) P76662-00 036 109 675 	X59474-01 03L 129 717 E 16x 	X59891-01 04L 253 039 D 	70-31414-10 	P76096-11 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM P77689-01 K → 03L 103 171 A PTFE P77774-01 N 03L 103 085 32x47x10 A RD FPM



AUDI												
2,0 CGLD	120 kW (163 PS)	Q5 TDI	11/08→	<p><b>D38731-00</b> <sup>12</sup></p> <p><b>B38299-01</b> <sup>13</sup> <sup>38</sup></p>	<p><b>H40584-00</b> 03L 103 383 BM 82 Ø 1,55 mm 1 □ MLS</p> <p><b>H40584-10</b> 03L 103 383 BN 82 Ø 1,63 mm 2 □ MLS</p> <p><b>H40584-20</b> 03L 103 383 BP 82 Ø 1,71 mm 3 □ MLS</p>	<p><b>T50034-00</b> WHT 002 131 (10x)</p>	<p><b>V59500-00</b> 03L 103 483 C +03L 103 070 (4x)</p> <p><b>X59500-01</b> 03L 103 483 C</p>	<p><b>N92990-00</b> 036 109 675 (16x)</p> <p><b>P76662-00</b> 036 109 675</p>	<p><b>X59474-01</b> 03L 129 717 E</p> <p>16x</p>	<p><b>X59891-01</b> 04L 253 039 D</p>	<p><b>70-31414-10</b></p>	<p><b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p><b>P77689-01 K</b> → </p> <p>03L 103 171 A PTFE</p> <p><b>P77774-01 N</b> 03L 103 085 32x47x10 A RD FPM</p>
2,0 CGMA CRHA <b>[NEW]</b>	125-147 kW (170-200 PS)			<p><b>D40567-00</b> <sup>12</sup></p>	<p><b>H40567-00</b> 06H 103 383 AC 83 Ø MLS</p>	<p><b>T80727-00</b> 06D 103 385 D (10x)</p>	<p><b>70-31414-10</b></p>	<p><b>N92990-00</b> 036 109 675 (16x)</p> <p><b>P76662-00</b> 036 109 675</p>	<p><b>X89273-01</b> 06F 129 717 D</p> <p>16x</p>	<p><b>X81829-01</b> 06F 253 039 F</p>	<p><b>70-31414-10</b></p>	<p><b>P77842-01 K</b> ← 06L 103 085 B 45x60x8 A SL RD PTFE ACM</p>
2,0 CHHB CJXB CJXC CJXF CNTC CWZA CYFB <b>[NEW]</b>	162-221 kW (220-300 PS)	S1 S3 TT TT TFSI	11/12→	<p><b>D40708-01</b> <sup>12</sup></p> <p><b>B82501-00</b> <sup>13</sup></p>	<p><b>H40708-00</b> 06K 103 383 K 83 Ø MLS</p>	<p><b>T40708-00</b> WHT 005 305 (10x)</p>	<p><b>70-31414-10</b></p>	<p><b>N92990-00</b> 036 109 675 (16x)</p> <p><b>P76662-00</b> 036 109 675</p>	<p><b>X59914-01</b> 06K 129 717 A</p> <p>16x</p>	<p><b>X59924-01</b> 06L 253 039</p>	<p><b>X90114-01</b> 06K 103 649</p> <p><b>70-31414-10</b></p>	<p><b>P77842-01 K</b> ← 06L 103 085 B 45x60x8 A SL RD PTFE ACM</p> <p><b>P77846-01 K</b> → </p> <p>06K 103 171 A PTFE</p>
2,0 CN	51 kW (70 PS)	100 D	08/78-11/90	<p><b>D30568-00</b> <sup>12</sup> 069198012B Ch.43 B 077 979→</p> <p><b>B30567-00</b> <sup>13</sup> 034 198 011 C</p>	<p><b>H17895-00</b> 78,5 Ø 1,5 mm 1 □</p> <p><b>H27895-20</b> 78,5 Ø 1,6 mm 3 □ Ch.43 B 077 979→ Ch.→44 F 300 000</p> <p><b>H07896-00</b> 069 103 383 CM 78 Ø 1,53 mm 1 □</p> <p><b>H17896-10</b> 069 103 383 CN 78 Ø 1,57 mm 2 □</p> <p><b>H27896-20</b> 069 103 383 CP 78 Ø 1,61 mm 3 □ Ch.44 G 000.001→</p>	<p><b>T07896-00</b> 068 103 384 A (12x) Ch.43 B 077 979→</p>	<p><b>V31163-00</b> 069 198 025 C Ch.43 B 077 979→</p>	<p><b>N90710-01</b> 026 109 675 (10x)</p> <p><b>P76531-00</b> 026 109 675</p>	<p><b>X07945-01</b> 034 129 717 L</p> <p>10x</p>	<p><b>X03747-01</b> 026 129 589 A</p> <p><b>X51157-01</b> </p> <p>433 253 115</p>	<p>5x <b>X02643-01</b> 054 103 609</p>	<p><b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM</p> <p><b>P76355-11 K</b> → 068 103 051 P 85x105x9/11 A SL LD FPM</p> <p><b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>

AUDI													
2.0 CNCB CNCD	132-165 kW (180-224 PS)	A4 TFSI A5 TFSI Q5 TFSI	08/09→										
				D40708-01 <sup>12</sup> B38749-00 <sup>13 35</sup>	H40708-00 06K 103 383 K 83 Ø MLS 	T40708-00 WHT 005 305 (10x) 	70-31414-10 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X59914-01 06K 129 717 A 16x 		X59924-01 06L 253 039 	X59956-01 06L 103 649 	P77842-01 K ← 06L 103 085 B 45x60x8 A SL RD PTFE ACM P77846-01 K → 06K 103 171 A PTFE →02/14
2.0 CNHA CNHC CRBC CRBD CRLB CRLC CRUA CSUA CSUB CUNA CUPA <b>[NEW]</b>	100-140 kW (136-190 PS)	A3 TDI A4 TDI A5 TDI A6 TDI Q5 TDI TT TDI	08/08→										
				D38750-00 <sup>12</sup> 	H40701-00 04L 103 383 BJ 82 Ø 1,55 mm 1 MLS H40701-10 04L 103 383 BK 82 Ø 1,63 mm 2 MLS H40701-20 04L 103 383 BL 82 Ø 1,71 mm 3 MLS 	T40709-00 WHT 005 673 (10x) 	V59933-00 03L 103 483 S +04L 103 070 (4x)  V90072-00  X59933-01 03L 103 483 S  X90116-01 04L 103 483 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X59929-01 04L 129 717 B 16x 		X59927-01 04L 253 039 G 	70-31414-10 	P77831-01 K → 04L 103 171 PTFE P77774-01 N 03L 103 085 32x47x10 A RD FPM
2.0 CNHC CSUB <b>[NEW]</b>	100-120 kW (136-163 PS)	A4 TDI Q5 TDI	11/07→										
				D38750-00 <sup>12</sup> 	H40701-00 04L 103 383 BJ 82 Ø 1,55 mm 1 MLS H40701-10 04L 103 383 BK 82 Ø 1,63 mm 2 MLS H40701-20 04L 103 383 BL 82 Ø 1,71 mm 3 MLS 	T40709-00 WHT 005 673 (10x) 	V59933-00 03L 103 483 S +04L 103 070 (4x)  V90072-00  X59933-01 03L 103 483 S  X90116-01 04L 103 483 	N92990-00 036 109 675 (16x) P76662-00 036 109 675	X59929-01 04L 129 717 B 16x 		X59927-01 04L 253 039 G 	70-31414-10 	P77831-01 K → 04L 103 171 PTFE P77774-01 N 03L 103 085 32x47x10 A RD FPM

AUDI												
Ltr.												
2,0 CRFA CRFC	81-105 kW (110-143 PS) A3 TDI	09/12→										
			<b>D38750-01</b> <sup>12</sup>  	<b>H40701-00</b> 04L 103 383 BJ 82 Ø 1,55 mm 1 MLS <b>H40701-10</b> 04L 103 383 BK 82 Ø 1,63 mm 2 MLS <b>H40701-20</b> 04L 103 383 BL 82 Ø 1,71 mm 3 MLS 	<b>T40709-00</b> WHT 005 673 (10x) 	<b>V59933-00</b> 03L 103 483 S +04L 103 070 (4x)  <b>V90072-00</b>  <b>X59933-01</b> 03L 103 483 S  <b>X90116-01</b> 04L 103 483 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 16x 	<b>X59929-01</b> 04L 129 717 B 	<b>X59891-01</b> 04L 253 039 D 	<b>70-31414-10</b> 	<b>P77831-01 K</b> → 04L 103 171 PTFE <b>P77774-01 N</b> 03L 103 085 32x47x10 ARD FPM	
2,0 DE	64 kW (87 PS) 100 D 100 TD	→44 F 300 000 →44 F 300 000 08/82-02/88	<b>S31163-00</b> <sup>12</sup> <sup>13</sup>  <b>D31163-00</b> <sup>12</sup> 069 198 012 C  <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07895-00</b> 069 103 383 CT 1,4 mm 1 <b>H17895-10</b> 069 103 383 DB 1,5 mm 2 <b>H27895-20</b> 78,5 Ø 1,6 mm 3 	<b>T07896-00</b> 068 103 384 A (12x) 	<b>V31163-00</b> 069 198 025 C 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
2,0 DE	64 kW (87 PS) 100 D 100 TD	44 G 000 001→ 44 G 000 001→ 08/82-02/88	<b>S31163-00</b> <sup>12</sup> <sup>13</sup>  <b>D31163-00</b> <sup>12</sup> 069 198 012 C  <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07896-00</b> 069 103 383 CM 1,53 mm 1 <b>H17896-10</b> 069 103 383 CN 1,57 mm 2 <b>H27896-20</b> 069 103 383 CP 78 Ø 1,61 mm 3 	<b>T07896-00</b> 068 103 384 A (12x) 	<b>V31163-00</b> 069 198 025 C 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
2,0 HP JL JS KP RT SK SL	81-85 kW (110-115 PS) COUPE 100 80 90	09/83→	<b>S30567-00</b> <sup>12</sup> <sup>13</sup> <b>D30567-00</b> <sup>12</sup> 035 198 012 N <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H02641-00</b> 034 103 383 AA 82,7 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> <sup>X</sup> 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A  <b>X51169-01</b> <sup>A</sup> 431 253 115 A 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	

AUDI													
2.0 NC	74 kW (100 PS)	100 D 100 TD	03/88-11/90	 <b>S31163-00</b> <sup>12</sup> <sup>13</sup>  <b>D31163-00</b> <sup>12</sup> 069 198 012 C  <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07896-00</b> 069 103 383 CM 1,53 mm 1 <b>H17896-10</b> 069 103 383 CN 1,57 mm 2 <b>H27896-20</b> 069 103 383 CP 78 Ø 1,61 mm 3 	<b>T07896-00</b> 068 103 384 A (12x) 	<b>V31163-00</b> 069 198 025 C 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 034 129 717 M  <b>X57857-01</b> <sup>10</sup> 069 129 717	<b>X03747-01</b> 026 129 589 A  <b>X81078-01</b> 433 253 115 A	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2.0 PS	85 kW (115 PS)	90	07/88-09/91	<b>S31634-00</b> <sup>12</sup> <sup>13</sup> <b>D31634-00</b> <sup>12</sup> 034 198 012 H <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H02641-00</b> 034 103 383 AA 82,7 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X55159-01</b> 034 129 717 F  <b>X55158-01</b> <sup>10</sup> 034 129 717 E 	<b>X03747-01</b> 026 129 589 A 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2.0 WA WF	77-85 kW (105-115 PS)	100	06/76→	<b>D31645-00</b> <sup>12</sup> 047 198 012 B <b>B37007-00</b> <sup>13</sup> 060 198 011 B	<b>H50164-00</b> 046 103 383 J 88,5 Ø 1,55 mm 		<b>V31645-00</b> 060 198 025 A 	<b>N92632-00</b> 046 109 675 A (8x) <b>P76661-00</b> 046 109 675 A 8x	<b>X56304-01</b> 060 129 717 A 	<b>X52208-01</b> 048 129 589 A  <b>X51169-01</b> 431 253 115 A	4x <b>E37007-00</b> 060 198 041 A 	<b>P77438-01</b> K ← 048 115 147 35x54x10 A SL RD FPM <b>P77439-01</b> K → 059 103 051 D 96x117x10,5/12 A SL LD NBR <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2.0 3A	82-83 kW (112-113 PS)	COUPE 80	08/88-10/90	<b>S31449-00</b> <sup>12</sup> <sup>13</sup> <b>D31449-00</b> <sup>12</sup> 053198012A <b>B30584-00</b> <sup>13</sup> 037 198 011 C	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30584-00</b> 026 198 025 A 8,5 mm Kork 	<b>N90300-00</b> 026 109 675 (8x) <b>P76531-00</b> 026 109 675 8x	<b>X55170-01</b> 026 129 717 F 	<b>X03747-01</b> 026 129 589 A  <b>X51169-01</b> 431 253 115 A	4x <b>E30584-00</b> 044 103 609 D +N 905 927 02 (20x) 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2.0 6A	101 kW (137 PS)	COUPE 80	03/90-07/92	<b>S31638-00</b> <sup>12</sup> <sup>13</sup> <b>D31638-00</b> <sup>12</sup> 053 198 012 C <b>B31640-00</b> <sup>13</sup> 037 198 011 E	<b>H50151-00</b> 048 103 383 B 83,5 Ø 1,75 mm 	<b>T50151-00</b> 053 103 385 (10x) 	<b>V31196-00</b> 027 198 025 	<b>N92850-00</b> 027 109 675 (16x) <b>P76532-00</b> 027 109 675 16x	<b>X07866-01</b> 037 129 717 F 	<b>X07855-01</b> 027 129 589 A 	4x <b>X04116-01</b> 026 103 609 D 	<b>P76087-01</b> K ← 068 103 085 E 32x47x10 A SL WD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI													
2,1 GV WJ WR WS	125-147 kW (170-200 PS)	QUATTRO Turbo 200	→85 B 900 158 10/79→ →43 A 020 000	<b>S32689-00</b> <sup>12</sup> <sup>13</sup> <b>D32689-00</b> <sup>12</sup> 035198012A <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T07872-00</b> 049 103 385 (12x) 	<b>V31597-00</b> 035 198 025 D 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A <b>X81940-01</b> 437 253 115 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,1 GV KG WJ WR WS	125-147 kW (170-200 PS)	QUATTRO Turbo 200 200 Turbo	85 B 900 159→ 10/79→ 43 B 000 001→	<b>S32872-00</b> <sup>12</sup> <sup>13</sup> <b>D32872-00</b> <sup>12</sup> 035 198 012 K <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> 034 198 025 Kork <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A <b>X81940-01</b> 437 253 115 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,1 JY	134 kW (182 PS)	200 Turbo	09/83-01/88	<b>S32872-00</b> <sup>12</sup> <sup>13</sup> <b>D32872-00</b> <sup>12</sup> 035 198 012 K <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T04125-00</b> 049 103 384 B (10x) 	<b>V30567-00</b> 034 198 025 Kork <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A <b>X51169-01</b> 431 253 115 A <b>X52305-01</b> 447 253 115 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,1 KE KL WB WE	79-96 kW (107-131 PS)	COUPE 100	07/77-10/87	<b>S31200-00</b> <sup>12</sup> <sup>13</sup> <b>D31200-00</b> <sup>12</sup> 035 198 012 L <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> 034 198 025 Kork <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A 	5x <b>X02643-01</b> 054 103 609 	<b>P76087-01</b> K ← 2x 068 103 085 E 32x47x10 A SL WD FPM <b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 2x 068 103 085 E 32x47x10 A SL WD FPM	

AUDI													
2,1 WC	100 kW (136 PS)	100 200	03/77-07/84	<b>S31507-00</b> <sup>12</sup> <sup>13</sup> Mot.→WC 139 411 <b>S31200-00</b> <sup>12</sup> <sup>13</sup> Mot.WC 139 412→ <b>D31507-00</b> <sup>12</sup> 035 198 012 J Mot.→WC 139 411 <b>D31200-00</b> <sup>12</sup> 035 198 012 L Mot.WC 139 412→ <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T07872-00</b> 049 103 385 (12x) Mot.→WC 139 411  <b>T02641-00</b> 049 103 384 B (12x) Mot.WC 139 412→ 	<b>V31597-00</b> 035 198 025 D Mot.→WC 139 411  <b>V30567-00</b> ✕ 034 198 025 Kork Mot.WC 139 412→  <b>V31634-00</b> 034 198 025 D NBR Mot.WC 139 412→ 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 034 129 717 M 10x 	<b>X03747-01</b> 026 129 589 A <b>X51169-01</b> <sup>13</sup> 431 253 115 A Mot.→WC 139 411 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,1 WS	125 kW (170 PS)			<b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 			<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 034 129 717 M 10x 	<b>X03747-01</b> 026 129 589 A <b>X81940-01</b> <sup>13</sup> ✕ 437 253 115 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,2 AAN ABY ADU 3B	162-232 kW (220-315 PS)	A6 S6 COUPE S2 100 S4 200 Turbo 80 RS2 80 S2	03/89-12/97	<b>D36080-00</b> <sup>12</sup> 034 198 012 M <b>B36080-00</b> <sup>13</sup> 034 198 011 B	<b>H50998-00</b> 034 103 383 AD 82 Ø 1,65 mm MLS 	<b>T50127-00</b> 034 103 385 C (12x) 	<b>V36080-00</b> 034 198 025 F 	<b>N92111-00</b> 027 109 675 (20x) <b>P76532-00</b> 027 109 675 20x	<b>X58941-01</b> 034 129 717 K 20x 	<b>X52304-01</b> 034 129 589 A <b>X52305-01</b> <sup>13</sup> ✕ 447 253 115 	<b>X54131-01</b> 074 103 609 F 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,2 HX HY JT KU KV KX KZ PX	85-101 kW (115-137 PS)	COUPE 100 200 90	07/81-09/91	<b>S30567-00</b> <sup>12</sup> <sup>13</sup> <b>D30567-00</b> <sup>12</sup> 035 198 012 N <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H02641-00</b> 034 103 383 AA 82,7 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> ✕ 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 034 129 717 M 10x 	<b>X03747-01</b> 026 129 589 A <b>X51169-01</b> <sup>13</sup> 431 253 115 A 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,2 KF	96 kW (130-131 PS)	100	→43 A 020 000 08/82-07/84	<b>S31507-00</b> <sup>12</sup> <sup>13</sup> <b>D31507-00</b> <sup>12</sup> 035 198 012 J <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T07872-00</b> 049 103 385 (12x) 	<b>V31597-00</b> 035 198 025 D 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x	<b>X02658-01</b> 034 129 717 M 10x 	<b>X03747-01</b> 026 129 589 A <b>X51169-01</b> <sup>13</sup> 431 253 115 A 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI													
2,2 KF	96 kW (130-131 PS)	100	43 B 000 001→	08/82-07/84	<b>S31200-00</b> <sup>12</sup> <sup>13</sup> <b>D31200-00</b> <sup>12</sup> 035 198 012 L <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> ✕ 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A 5x 	<b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
2,2 KK KL WE	85-100 kW (115-136 PS)	80		10/80-07/84	<b>S31200-00</b> <sup>12</sup> <sup>13</sup> <b>D31200-00</b> <sup>12</sup> 035 198 012 L <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H07872-00</b> 035 103 383 K 81,5 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> ✕ 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A 5x 	<b>X02643-01</b> 054 103 609 	<b>P76087-01</b> K ← 2x 068 103 085 E 32x47x10 A SL WD FPM <b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 2x 068 103 085 E 32x47x10 A SL WD FPM
2,2 MB MC 1B 2B	121-147 kW (165-200 PS)	QUATTRO Turbo 100 Turbo 200 Turbo		09/83-12/91	<b>S31506-00</b> <sup>12</sup> <sup>13</sup> <b>D31506-00</b> <sup>12</sup> 035 198 012 P <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H02641-00</b> 034 103 383 AA 82,7 Ø 1,75 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> ✕ 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X02658-01</b> 034 129 717 M 	<b>X03747-01</b> 026 129 589 A 5x  <b>X51169-01</b> ✕ 431 253 115 A  <b>X52305-01</b> ✕ 447 253 115 	<b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
2,3 AAR NG	98-100 kW (133-136 PS)	A6 CABRIOLET COUPE 100 80 90	8A L 200 001→ 8B L 014 001→ 8A L 200 001→ 8A L 200 001→	01/87-12/96	<b>S31508-00</b> <sup>12</sup> <sup>13</sup> <b>D31508-00</b> <sup>12</sup> 034 198 012 L <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H50153-00</b> 054 103 383 G 83,5 Ø 1,82 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> ✕ 034 198 025 Kork  <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X55159-01</b> 034 129 717 F  <b>X55158-01</b> <sup>10</sup> 034 129 717 E 	<b>X03747-01</b> 026 129 589 A 5x  <b>X51169-01</b> ✕ 431 253 115 A 	<b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM
2,3 NF	100 kW (136 PS)	100 200		08/86-09/91	<b>D36393-00</b> <sup>12</sup> 034 198 012 K Ch.→44 J 200 099 <b>D37038-00</b> <sup>12</sup> 034 198 012 E Ch.44 J 200 100→ Ch.→44 L 072 000 <b>D31508-00</b> <sup>12</sup> 034 198 012 L Ch.44 L 072 001→ <b>B30567-00</b> <sup>13</sup> 034 198 011 C	<b>H50153-00</b> 054 103 383 G 83,5 Ø 1,82 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V31634-00</b> 034 198 025 D Ch.→44 L 072 000  <b>V31508-00</b> 034198025C Ch.44 L 072 001→ 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675 10x 	<b>X55159-01</b> 034 129 717 F  <b>X55158-01</b> 034 129 717 E 	<b>X03747-01</b> 026 129 589 A 3x  <b>X81409-01</b> 034 129 589 B 2x  <b>X51169-01</b> <sup>10</sup> 431 253 115 A 	<b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM

AUDI														
2,3 NG	98-100 kW (133-136 PS)	CABRIOLET COUPE 80 90	→8A L 200 000 →8B L 014 000 →8A L 200 000 →8A L 200 000	01/87-12/96	<b>D37038-00</b> 034 198 012 E <b>B30567-00</b> ⑬ 034 198 011 C	<b>H50153-00</b> 054 103 383 G 83,5 Ø 1,82 mm 	<b>T02641-00</b> 049 103 384 B (12x) 	<b>V30567-00</b> ✕ 034 198 025 Kork <b>V31634-00</b> 034 198 025 D NBR 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	10x <b>X55159-01</b> 034 129 717 F <b>X55158-01</b> ⑩ 034 129 717 E 	<b>X03747-01</b> 026 129 589 A <b>X51169-01</b> ⚠ ✕ 431 253 115 A 	5x <b>X02643-01</b> 054 103 609 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,3 7A	123-125 kW (167-170 PS)	COUPE 90		06/88-12/96	<b>D37039-00</b> 054 198 012 A <b>B36080-00</b> ⑬ 034 198 011 B	<b>H50033-00</b> 054 103 383 J 	<b>T50127-00</b> 034 103 385 C (12x) 	<b>V36080-00</b> 034 198 025 F 	<b>N93137-00</b> 027 109 675 (10x) <b>P76532-00</b> 027 109 675	2x 20x <b>X58941-01</b> 034 129 717 K 	<b>X07855-01</b> 027 129 589 A 	5x <b>X54131-01</b> 074 103 609 F 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,4 AAS 3D	60 kW (82 PS)	100 D		08/89-06/94	<b>S31637-00</b> ⑫ ⑬  <b>D31637-00</b> ⑫ 074 198 012  <b>B31637-00</b> ⑬ 074 198 011 A	<b>H02394-00</b> 074 103 383 C 1,53 mm 1 <b>H12394-10</b> 074 103 383 D 1,57 mm 2 <b>H22394-20</b> 074 103 383 E 81 Ø 1,61 mm 3 	<b>T07896-00</b> 068 103 384 A (12x) 	<b>V31637-00</b> 	<b>N90710-01</b> 026 109 675 (10x) <b>P76531-00</b> 026 109 675	10x <b>X56210-01</b> 074 129 717 	<b>X03747-01</b> 026 129 589 A 	5x <b>X54131-01</b> 074 103 609 F 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,4 AGA AJG ALF ALW AML AMM APC APS APZ ARN	100-121 kW (136-165 PS)	A4 A6	→8D W 180 000 →4B W 150 000	02/97-12/05	<b>D32939-00</b> ⑫ 078 198 012 D <b>Z36190-00</b> ⑧ 058 198 217	<b>H50999-00</b> 078 103 383 K 83,5 Ø MLS 	<b>T50999-00</b> 078 103 385 K (16x) 	<b>V53716-00</b> 078 198 025 	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675	2x 30x <b>X58942-01</b> 078 129 717 J 	<b>X52306-01</b> 078 253 039 C 	2x <b>X54463-01</b> 078 103 610 E 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM 70-31414-10 	
2,4 AGA AJG ALF ALW AML AMM APC APS APZ ARN	100-121 kW (136-165 PS)	A4 A6	8D W 180 001→ 4B W 150 001→	02/97-12/05	<b>D37040-00</b> 078 198 012 G +068 103 085 E (2x) <b>Z36190-00</b> ⑧ 058 198 217	<b>H50999-00</b> 078 103 383 K 83,5 Ø MLS 	<b>T50999-00</b> 078 103 385 K (16x) 	<b>V53716-00</b> 078 198 025 	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675	2x 30x <b>X58942-01</b> 078 129 717 J 	<b>X52308-01</b> 078 253 039 G 	2x <b>X54463-01</b> 078 103 610 E 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM 70-31414-10 	
2,4 ARJ ASM BDV	100-125 kW (136-170 PS)	A4 A6		02/97-12/05	<b>D37040-00</b> 078 198 012 G +068 103 085 E (2x) <b>Z36190-00</b> ⑧ 058 198 217	<b>H50999-00</b> 078 103 383 K 83,5 Ø MLS 	<b>T50999-00</b> 078 103 385 K (16x) 	<b>V53716-00</b> 078 198 025 	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675	2x 30x <b>X58942-01</b> 078 129 717 J 	<b>X52308-01</b> 078 253 039 G 	2x <b>X54463-01</b> 078 103 610 E 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	



AUDI													
2,4 BDW	130 kW (177 PS)	A6	05/04-10/08	D37053-00 <sup>12</sup> B37053-00 <sup>13</sup>	H80728-00 06E 103 148 P 82,5 Ø MLS Zyl. 1 - 3 	T80728-00 06E 103 385 (8x) 	2x X83122-01 06E 103 183 G Zyl. 4 - 6 NBR 	N92993-00 036 109 675 (12x) P76662-00 036 109 675 	2x X89276-01 06E 129 717 B 6x 	X81442-01 06E 253 039 C 2x 	70-31414-10 	P77452-01 K ← 06E 103 153 E PTFE P77362-01 K → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM	
2,5 AAT ABP AEL 1T	84-103 kW (114-140 PS)	A6 TDI 100 TDI	01/90-12/97	D31639-00 <sup>12</sup> 046 198 012 A  B31639-00 <sup>13</sup> 046 198 011	H02396-00 074 103 383 AJ 1,53 mm 1 MLS H12396-10 074 103 383 AH 1,57 mm 2 MLS H22396-20 074 103 383 AG 82 Ø 1,61 mm 3 MLS	T07896-00 068 103 384 A (12x) 	X53063-01 046 103 483 A NBR 	N90710-01 026 109 675 (10x) P76531-00 026 109 675 10x 	X56210-01 074 129 717 	X03747-01 026 129 589 A 5x 	X02643-01 054 103 609 	P76096-01 K ← 069 115 147 C 35x48x10 A SL RD FPM P76355-11 K → 068 103 051 P 85x105x9 A SL LD FPM P76087-01 N 068 103 085 E 32x47x10 A SL WD FPM	
2,5 AFB AKE AKN	110-132 kW (150-180 PS)	ALLROAD TDI A4 TDI A6 TDI A8 TDI	01/97-08/05	D32940-00 <sup>12</sup>  B32940-00 <sup>13</sup> 	H03136-00 059 103 383 BQ 1,1 mm 1 MLS H13136-10 059 103 383 BR 1,15 mm 2 MLS H23136-20 059 103 383 BS 79 Ø 1,2 mm 3 MLS	T03136-00 059 103 384 (16x) 	2x V32940-00 059 198 025 	N92830-00 036 109 675 (24x) P76662-00 036 109 675 24x 	X58943-01 059 129 717 G 2x 	X52307-01 059 253 039 B 6x  X52930-01	X54465-01 059 103 609 J  70-31414-10  X54464-01 <sup>11</sup> 059 103 610 B 	P76096-01 K ← 069 115 147 C 35x48x10 A SL RD FPM P77440-01 K → 070 103 051 A 85x105x12 A SL LD PTFE P76087-01 N 068 103 085 E 32x47x10 A SL WD FPM	
2,5 AYM BFC	114-120 kW (155-163 PS)	A4 TDI A6 TDI	08/01-12/05	D32940-00 <sup>12</sup>  B32940-00 <sup>13</sup> 	H03136-00 059 103 383 BQ 1,1 mm 1 MLS H13136-10 059 103 383 BR 1,15 mm 2 MLS H23136-20 059 103 383 BS 79 Ø 1,2 mm 3 MLS	T03136-00 059 103 384 (16x) 	2x V32940-00 059 198 025 	N92830-00 036 109 675 (24x) P76662-00 036 109 675 24x 	X58943-01 059 129 717 G 2x 	X52307-01 059 253 039 B 6x  X52930-01	70-31414-10 	P76096-01 K ← 069 115 147 C 35x48x10 A SL RD FPM P76087-01 N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI												
2,5 BAU BCZ BDG BDH	120-132 kW (163-180 PS)	ALLROAD TDI A4 TDI A6 TDI	02/00-05/06	<b>D32940-00</b> <sup>12</sup>  <b>B32940-00</b> <sup>13</sup> 	<b>H03136-00</b> 059 103 383 BQ 1,1 mm 1 MLS <b>H13136-10</b> 059 103 383 BR 1,15 mm 2 MLS <b>H23136-20</b> 059 103 383 BS 79 Ø 1,2 mm 3 MLS 	<b>T80448-00</b> 057 103 384 A (16x) 	<b>V32940-00</b> 059 198 025 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 	<b>X58943-01</b> 059 129 717 G 	<b>X52307-01</b> 059 253 039 B  <b>X52930-01</b>	<b>70-31414-10</b> 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM
2,5 CEPA CEPB CTSA <b>[NEW]</b>	228-265 kW (310-360 PS)	Q3 RS RS3 TT TFSI	01/11→	<b>D40720-00</b> <sup>12</sup> 	<b>H40720-00</b> 07K 103 383 L 83,3 Ø MLS 	<b>T80754-00</b> 06D 103 385 D (12x) 	<b>X59948-01</b> 07K 103 483 A 	<b>N96005-00</b> 06L 109 675 (10x) +036 109 675 A (10x) <b>P76662-00 ES</b> 036 109 675 <b>P93254-00 AS</b> 06L 109 675 	<b>X59884-01</b> 07K 133 379 A 	<b>X59874-01</b> 07K 253 039 D 	<b>70-31414-10</b> 	<b>P7766-01 K</b> → 059 103 051 K 85x105x8 A SL LD FPM
2,5 CEPA	250 kW (340 PS)	TT TFSI	07/09-06/14	<b>D40720-00</b> <sup>12</sup> 	<b>H40720-00</b> 07K 103 383 L 83,3 Ø MLS 	<b>T80754-00</b> 06D 103 385 D (12x) 	<b>X59948-01</b> 07K 103 483 A 	<b>N96005-00</b> 06L 109 675 (10x) +036 109 675 A (10x) <b>P76662-00 ES</b> 036 109 675 <b>P93254-00 AS</b> 06L 109 675 	<b>X59884-01</b> 07K 133 379 A 	<b>X59874-01</b> 07K 253 039 D 	<b>70-31414-10</b> 	<b>P77440-01 K</b> → 070 103 051 A 85x105x12 A SL LD PTFE →08/10 <b>P77766-01 K</b> → 059 103 051 K 85x105x8 A SL LD FPM 09/10→
2,5 CLXA CLXB CPAA CVBA <b>[NEW]</b>	140-150 kW (190-204 PS)	A8 TFSI	07/12→	<b>D40695-01</b> <sup>12</sup> <b>B38111-00</b> <sup>13</sup> <sup>35</sup> 	<b>H40695-00</b> 06E 103 148 AJ 81 Ø MLS Zyl. 1-3  <b>H40696-00</b> 06E 103 149 AJ 81 Ø MLS Zyl. 4-6 	<b>T40707-00</b> WHT 005 739 (8x) 	<b>X83361-01</b> 06E 103 484 P Zyl. 1-3  <b>X83362-01</b> 06E 103 483 Q Zyl. 4-6 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 	<b>M38701-00</b> 06E 198 717 	<b>X81442-01</b> 06E 253 039 C 	<b>70-31414-10</b> 	<b>P77362-01 K</b> ← 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P77452-01 K</b> → 06E 103 153 E PTFE

AUDI													
2,6 ABC ACZ	102-110 kW (139-150 PS)	A4	01/95-09/01	<b>D32235-00</b> 078 198 012 Ch.→8D T 076 000 <b>D36088-00</b> 078 198 012 A Ch.8D T 076 001→ <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L Ch.→8D T 076 000 <b>X53267-01</b> 078 103 483 J Ch.8D T 076 001→ 	<b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 	<b>X57669-01</b> 078 129 717 A  <b>X57662-01</b> 078 129 717 C 	<b>X51635-01</b> 078 129 589 	<b>X54440-01</b> 078 103 609 F  <b>X57837-01</b> <sup>(11)</sup> 078 103 609 G 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,6 ABC ACZ	102-110 kW (139-150 PS)	A6	08/94-02/97	<b>D32235-00</b> 078 198 012 Ch.→4A T 029 512 <b>D36088-00</b> 078 198 012 A Ch.4A T 029 513→ <b>B32235-00</b> <sup>(13)</sup> 078 198 011 Ch.→4A S 026 714 <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A Ch.4A S 026 715→	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L Ch.→4A T 029 512 <b>X53267-01</b> 078 103 483 J Ch.4A T 029 513→ 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 Ch.→4A S 026 714 <b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 Ch.4A S 026 715→ 	<b>X57669-01</b> 078 129 717 A  <b>X57662-01</b> 078 129 717 C 	<b>X51635-01</b> 078 129 589 	<b>X54441-01</b> 078 103 609 E Ch.→4A S 026 714  <b>X54440-01</b> 078 103 609 F Ch.4A S 026 715→  <b>X58824-01</b> <sup>(11)</sup> 078 103 610 A Ch.→4A S 026 714  <b>X57837-01</b> <sup>(11)</sup> 078 103 609 G Ch.4A S 026 715→ 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI												
Ltr.												
2,6 ABC ACZ	102-110 kW (139-150 PS) CABRIOLET	08/94-02/97	<b>D32235-00</b> 078 198 012 Ch.→8G T 004 318 <b>D36088-00</b> 078 198 012 A Ch.8G T 004 319→ <b>B32235-00</b> <sup>(13)</sup> 078 198 011 Ch.→8G S 001 302 <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A Ch.8G S 001 303→	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L Ch.→8G T 004 318 <b>X53267-01</b> 078 103 483 J Ch.8G T 004 319→	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 Ch.→8G S 001 302 <b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 Ch.8G S 001 303→	<b>X57669-01</b> 078 129 717 A  <b>X57662-01</b> 078 129 717 C 		<b>X51635-01</b> 078 129 589 	<b>X54441-01</b> 078 103 609 E Ch.→8G S 001 302  <b>X54440-01</b> 078 103 609 F Ch.8G S 001 303→  <b>X58824-01</b> <sup>(11)</sup> 078 103 610 A Ch.→8G S 001 302  <b>X57837-01</b> <sup>(11)</sup> 078 103 609 G Ch.8G S 001 303→ 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
2,6 ABC ACZ	102-110 kW (139-150 PS) COUPE	08/92-02/96	<b>D32235-00</b> 078 198 012 Ch.→8B T 002 000 <b>D36088-00</b> 078 198 012 A Ch.8B T 002 001→ <b>B32235-00</b> <sup>(13)</sup> 078 198 011 Ch.→8B S 000 544 <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A Ch.8B S 000 545→	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L Ch.→8B T 002 000 <b>X53267-01</b> 078 103 483 J Ch.8B T 002 001→	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 Ch.→8B S 000 544 <b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 Ch.8B S 000 545→	<b>X57669-01</b> 078 129 717 A  <b>X57662-01</b> 078 129 717 C 		<b>X51635-01</b> 078 129 589 	<b>X54441-01</b> 078 103 609 E Ch.→8B S 000 544  <b>X54440-01</b> 078 103 609 F Ch.8B S 000 545→  <b>X58824-01</b> <sup>(11)</sup> 078 103 610 A Ch.→8B S 000 544  <b>X57837-01</b> <sup>(11)</sup> 078 103 609 G Ch.8B S 000 545→ 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

AUDI													
2,6 ABC ACZ	102-110 kW (139-150 PS)	100	03/92-06/94	<b>D32235-00</b> 078 198 012 <b>B32235-00</b> <sup>(13)</sup> 078 198 011	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 	<b>X57669-01</b> 078 129 717 A  <b>X57662-01</b> 078 129 717 C 	<b>X51635-01</b> 078 129 589 	<b>X54441-01</b> 078 103 609 E  <b>X58824-01</b> <sup>(11)</sup> 078 103 610 A 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,6 ABC ACZ	102-110 kW (139-150 PS)	80	06/92-01/96	<b>D32235-00</b> 078 198 012 <b>B32235-00</b> <sup>(13)</sup> 078 198 011 Ch.→8C S 025 820 <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A Ch.8C S 025 821→	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 Ch.→8C S 025 820 <b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 Ch.8C S 025 821→	<b>X57669-01</b> 078 129 717 A  <b>X57662-01</b> 078 129 717 C 	<b>X51635-01</b> 078 129 589 	<b>X54441-01</b> 078 103 609 E Ch.→8C S 025 820  <b>X54440-01</b> 078 103 609 F Ch.8C S 025 821→  <b>X58824-01</b> <sup>(11)</sup> 078 103 610 A Ch.→8C S 025 820  <b>X57837-01</b> <sup>(11)</sup> 078 103 609 G Ch.8C S 025 821→ 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,7 AGB AJK APB ARE AZA AZB BEL BES	169-195 kW (230-265 PS)	ALLROAD ALLROAD T A4 S4 A4 TURBO A6 T	09/97-08/05	<b>D32941-00</b> 078 198 012 E +068 103 085 E (2x) <b>Z36190-00</b> <sup>(8)</sup> 058 198 217	<b>H50999-00</b> 078 103 383 K 83,5 Ø 2x <b>MLS</b> 	<b>T50999-00</b> 078 103 385 K (16x) 	<b>V53716-00</b> 078 198 025 	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675 	<b>X58944-01</b> 078 129 717 N 	<b>X52308-01</b> 078 253 039 G  <b>X81688-01</b> <sup>(1)</sup> 8D0 253 115 F 	<b>X54463-01</b> 078 103 610 E  <b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI													
2,7 ASJ AZR	280 kW (380 PS)	A4 RS4	05/00-09/01	<b>Z36190-00</b> ⑧ 058 198 217	2x <b>H80592-00</b> 078 103 383 Q 82 Ø MLS 	2x <b>T50999-00</b> 078 103 385 K (16x) 	<b>V53716-00</b> 078 198 025 	2x <b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675	30x <b>X58944-01</b> 078 129 717 N	2x <b>X52308-01</b> 078 253 039 G  <b>X81688-01</b> ♻️ 8D0 253 115 F	2x <b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77181-01 N</b> 3x 038 103 085 A 32x47x10 A SL RD PTFE ACM <b>P77182-01 N</b> 028 103 086 32x47x10 A SL LD PTFE	
2,7 BPP BSG	120-132 kW (163-180 PS)	A4 TDI A6 TDI	11/04-08/11	<b>D37054-00</b> ⑫ Zyl. 1 - 3  <b>D37055-00</b> ⑫ Zyl. 4 - 6  <b>B37054-00</b> ⑬	<b>H01841-00</b> 059 103 383 CM 1,1 mm 1 ■ MLS Zyl. 1 - 3 <b>H11841-10</b> 059 103 383 CN 1,15 mm 2 ■ MLS Zyl. 1 - 3 <b>H21841-20</b> 059 103 383 CP 1,2 mm 3 ■ MLS Zyl. 1 - 3  <b>H01842-00</b> 059 103 383 CQ 1,1 mm 1 ■ MLS Zyl. 4 - 6 <b>H11842-10</b> 059 103 383 CR 1,15 mm 2 ■ MLS Zyl. 4 - 6 <b>H21842-20</b> 059 103 383 CS 1,2 mm 3 ■ MLS Zyl. 4 - 6 	<b>T80448-00</b> 057 103 384 A (16x) 	<b>X83105-01</b> 059 103 483 N Zyl. 1 - 3 NBR  <b>X83106-01</b> 059 103 483 M Zyl. 4 - 6 NBR 	2x <b>N92993-00</b> 036 109 675 (12x) <b>P76662-00</b> 036 109 675	24x <b>X89125-01</b> 059 129 717 J	2x <b>X81941-01</b> 059 253 039 D 	2x <b>70-31414-10</b> 	<b>P77441-01 K</b> ← 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	

AUDI													
2,7	CAMA CAMB CANA CANB CANC CAND CGKA CGKB	120-140 kW (163-190 PS)	A4 TDI A5 TDI A6 TDI	11/04→	<b>D37055-01</b> <sup>12</sup> Zyl. 4 - 6  <b>D38060-00</b> <sup>12</sup> Zyl. 1-3  <b>B38110-00</b> <sup>13</sup>	<b>H01404-00</b> 059 103 383 EP 84 Ø 1,1 mm MLS Zyl. 4-6 <b>H11404-10</b> 059 103 383 EQ 84 Ø 1,15 mm MLS Zyl. 4-6 <b>H21404-20</b> 059 103 383 ER 84 Ø 1,2 mm MLS Zyl. 4-6  <b>H01406-00</b> 059 103 383 ES 84 Ø 1,1 mm MLS Zyl. 1-3 <b>H11406-10</b> 059 103 383 ET 84 Ø 1,15 mm MLS Zyl. 1-3 <b>H21406-20</b> 059 103 383 FA 84 Ø 1,2 mm MLS Zyl. 1-3 	<b>T80448-00</b> 057 103 384 A (16x) 	<b>X83105-01</b> 059 103 483 N Zyl. 1 - 3 NBR  <b>X83106-01</b> 059 103 483 M Zyl. 4 - 6 NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675 24x 	<b>X89125-01</b> 2x 059 129 717 J 	<b>X81941-01</b> 2x 059 253 039 D 	<b>70-31414-10</b> 	<b>P77441-01 K</b> ← 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
2,8	AAH	102-110 kW (139-150 PS)	A4	01/95-09/01	<b>D32235-00</b> 078 198 012 Ch.→8D T 076 000 <b>D36088-00</b> 078 198 012 A Ch.8D T 076 001→ <b>B32883-00</b> <sup>13</sup> 078 198 011 A	<b>H50471-00</b> 2x 078 103 383 E 84 Ø 	<b>T50471-00</b> 2x 078 103 385 J (8x) 	<b>X53719-01</b> 2x 078 103 483 L Ch.→8D T 076 000  <b>X53267-01</b> 2x 078 103 483 J Ch.8D T 076 001→ 	<b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 12x 	<b>X57669-01</b> 2x 078 129 717 A  <b>X57662-01</b> 078 129 717 C 	<b>X51635-01</b> 2x 078 129 589 	<b>X54440-01</b> 078 103 609 F  <b>X57837-01</b> <sup>11</sup> 078 103 609 G 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM

AUDI													
Ltr.													
2,8 AAH	102-110 kW (139-150 PS)	CABRIOLET	08/94-02/97	<b>D32235-00</b> 078 198 012 Ch.→8G T 004 318 <b>D36088-00</b> 078 198 012 A Ch.8G T 004 319→ <b>B32235-00</b> <sup>(13)</sup> 078 198 011 Ch.→8G S 001 302 <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A Ch.8G S 001 303→	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L Ch.→8G T 004 318 <b>X53267-01</b> 078 103 483 J Ch.8G T 004 319→	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 Ch.→8G S 001 302 <b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 Ch.8G S 001 303→	<b>X57669-01</b> 078 129 717 A 		<b>X51635-01</b> 078 129 589 	<b>X54441-01</b> 078 103 609 E Ch.→8G S 001 302 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM
2,8 AAH	102-110 kW (139-150 PS)	COUPE	08/92-02/96	<b>D32235-00</b> 078 198 012 Ch.→8B T 002 000 <b>D36088-00</b> 078 198 012 A Ch.8B T 002 001→ <b>B32235-00</b> <sup>(13)</sup> 078 198 011 Ch.→8B S 000 544 <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A Ch.8B S 000 545→	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L Ch.→8B T 002 000 <b>X53267-01</b> 078 103 483 J Ch.8B T 002 001→	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 Ch.→8B S 000 544 <b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 Ch.8B S 000 545→	<b>X57669-01</b> 078 129 717 A 		<b>X51635-01</b> 078 129 589 	<b>X54441-01</b> 078 103 609 E Ch.→8B S 000 544 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM



AUDI													
Ltr.													
2,8 AAH	102-110 kW (139-150 PS)	100	03/92-06/94	<b>D32235-00</b> 078 198 012 <b>B32235-00</b> <sup>(13)</sup> 078 198 011	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 	<b>X57669-01</b> 078 129 717 A  <b>X57662-01</b> 078 129 717 C 	<b>X51635-01</b> 078 129 589 	<b>X54441-01</b> 078 103 609 E  <b>X58824-01</b> <sup>(11)</sup> 078 103 610 A 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,8 AAH	102-110 kW (139-150 PS)	80	06/92-01/96	<b>D32235-00</b> 078 198 012 <b>B32235-00</b> <sup>(13)</sup> 078 198 011 Ch.→8C S 025 820 <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A Ch.8C S 025 821→	<b>H50471-00</b> 078 103 383 E 84 Ø 	<b>T50471-00</b> 078 103 385 J (8x) 	<b>X53719-01</b> 078 103 483 L 	<b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 Ch.→8C S 025 820 <b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 Ch.8C S 025 821→	<b>X57669-01</b> 078 129 717 A  <b>X57662-01</b> 078 129 717 C 	<b>X51635-01</b> 078 129 589 	<b>X54441-01</b> 078 103 609 E Ch.→8C S 025 820  <b>X54440-01</b> 078 103 609 F Ch.8C S 025 821→  <b>X58824-01</b> <sup>(11)</sup> 078 103 610 A Ch.→8C S 025 820  <b>X57837-01</b> <sup>(11)</sup> 078 103 609 G Ch.8C S 025 821→ 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI												
Ltr.												
2,8 AAH AEJ	102-110 kW (139-150 PS) A6	08/94-02/97	<b>D32235-00</b> 078 198 012 Ch.→4A T 029 512 <b>D36088-00</b> 078 198 012 A Ch.4A T 029 513→ <b>B32235-00</b> <sup>(13)</sup> 078 198 011 Ch.→4A S 026 714 <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A Ch.4A S 026 715→	<b>H50471-00</b> 078 103 383 E 84 Ø 	2x <b>T50471-00</b> 078 103 385 J (8x) 	2x <b>X53719-01</b> 078 103 483 L Ch.→4A T 029 512 <b>X53267-01</b> 078 103 483 J Ch.4A T 029 513→ 	2x <b>N91210-00</b> 026 109 675 (12x) <b>P76531-00</b> 026 109 675 Ch.→4A S 026 714 <b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675 Ch.4A S 026 715→	<b>X57669-01</b> 078 129 717 A  2x <b>X57662-01</b> 078 129 717 C 		<b>X51635-01</b> 078 129 589  2x <b>X54441-01</b> 078 103 609 E Ch.→4A S 026 714  <b>X54440-01</b> 078 103 609 F Ch.4A S 026 715→  <b>X58824-01</b> <sup>(11)</sup> 078 103 610 A Ch.→4A S 026 714  <b>X57837-01</b> <sup>(11)</sup> 078 103 609 G Ch.4A S 026 715→ 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	
2,8 AAH AEJ	102-110 kW (139-150 PS) A8	08/94-02/97	<b>D32235-00</b> 078 198 012 Ch.→4D T 003 800 <b>D36088-00</b> 078 198 012 A Ch.4D T 003 801→ <b>B32235-00</b> <sup>(13)</sup> 078 198 011 Ch.→4D S 000 496 <b>B32883-00</b> <sup>(13)</sup> 078 198 011 A Ch.4D S 000 497→	<b>H50471-00</b> 078 103 383 E 84 Ø 	2x <b>T50471-00</b> 078 103 385 J (8x) 	2x <b>X53719-01</b> 078 103 483 L Ch.→4D T 003 800 <b>X53267-01</b> 078 103 483 J Ch.4D T 003 801→ 	2x <b>N92450-00</b> 027 109 675 (12x) <b>P76532-00</b> 027 109 675	<b>X57669-01</b> 078 129 717 A  2x <b>X57662-01</b> 078 129 717 C 		<b>X51635-01</b> 078 129 589  2x <b>X54441-01</b> 078 103 609 E Ch.→4D S 000 496  <b>X54440-01</b> 078 103 609 F Ch.4D S 000 497→  <b>X58824-01</b> <sup>(11)</sup> 078 103 610 A Ch.→4D S 000 496  <b>X57837-01</b> <sup>(11)</sup> 078 103 609 G Ch.4D S 000 497→ 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9/11 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM	

AUDI																	
2.8 AGE ALG AMX APR AQD ATX	132-142 kW (180-193 PS)	A4 A6 A8	→8D W 180 000 →4B W 150 000 →4D W 712 000	04/96-01/05	<b>D36714-00</b> 078 198 012 B <b>Z36190-00</b> (8) 058 198 217	2x 2x	<b>H80491-00</b> 078 103 383 L 83,5 Ø MLS 	2x	<b>T50999-00</b> 078 103 385 K (16x) 	<b>V53716-00</b> 078 198 025 	2x	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675 30x	<b>X58942-01</b> 078 129 717 J 2x 	<b>X52306-01</b> 078 253 039 C 2x 	<b>X54463-01</b> 078 103 610 E  70-31414-10 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76087-01</b> N ← 068 103 085 E 32x47x10 A SL WD FPM 4x	
2.8 AGE ALG AMX APR AQD ATX	132-142 kW (180-193 PS)	A4 A6 A8	8D W 180 001→ 4B W 150 001→ 4D W 712 001→	04/96-01/05	<b>D36715-00</b> 078 198 012 F +068 103 085 E (2x) <b>Z36190-00</b> (8) 058 198 217	2x 2x	<b>H80491-00</b> 078 103 383 L 83,5 Ø MLS 	2x	<b>T50999-00</b> 078 103 385 K (16x) 	<b>V53716-00</b> 078 198 025 	2x	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675 30x	<b>X58942-01</b> 078 129 717 J 2x 	<b>X52308-01</b> 078 253 039 G 2x 	<b>X54463-01</b> 078 103 610 E  70-31414-10 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76087-01</b> N ← 068 103 085 E 32x47x10 A SL WD FPM 4x	
2.8 BBG	140 kW (190 PS)	A6		07/99-01/05	<b>D36715-00</b> 078 198 012 F +068 103 085 E (2x) <b>Z36190-00</b> (8) 058 198 217	2x 2x	<b>H80491-00</b> 078 103 383 L 83,5 Ø MLS 	2x	<b>T50999-00</b> 078 103 385 K (16x) 	<b>V53716-00</b> 078 198 025 	2x	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675 30x	<b>X58942-01</b> 078 129 717 J 2x 	<b>X52308-01</b> 078 253 039 G 2x 	<b>70-31414-10</b> 	<b>P76096-11</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P76087-01</b> N ← 068 103 085 E 32x47x10 A SL WD FPM 4x	
2.8 BDX CCDA CCEA CJBA CNYB <b>[NEW]</b>	140-170 kW (190-231 PS)	A6 FSI A8 FSI		11/06→	<b>D80730-00</b> (12) <b>B37053-00</b> (13)		<b>H80730-00</b> 06E 103 148 M 86 Ø MLS Zyl. 1 - 3  <b>H80731-00</b> 06E 103 149 M 86 Ø MLS Zyl. 4 - 6 		<b>T80728-00</b> 06E 103 385 (8x) 	2x	<b>X83361-01</b> 06E 103 484 P Zyl. 1-3  <b>X83362-01</b> 06E 103 483 Q Zyl. 4-6 	2x	<b>N92993-00</b> 036 109 675 (12x) <b>P76662-00</b> 036 109 675 24x 	<b>X89276-01</b> 06E 129 717 B 6x 	<b>X81442-01</b> 06E 253 039 C 2x 	<b>70-31414-10</b> 	<b>P77452-01</b> K ← 06E 103 153 E PTFE <b>P77362-01</b> K → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM

AUDI

Ltr. 




1

2,8 CHVA  
CNYA

150 kW  
(204 PS)


A6 FSI  
A7 FSI

10/10→

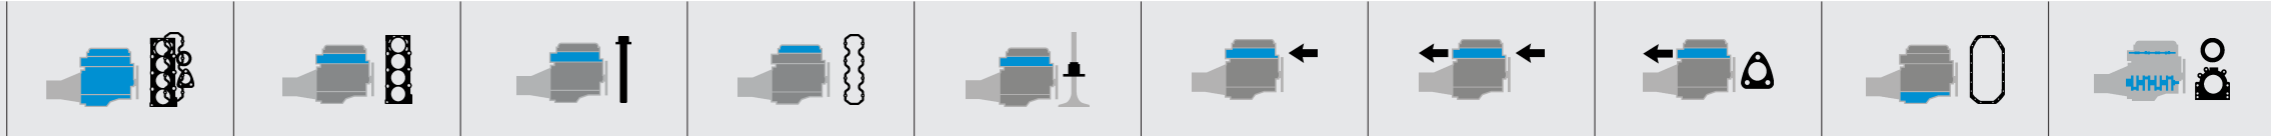

**D80730-00** <sup>12</sup>  
→05/12  
**D40702-00** <sup>12</sup>  
06/12→  
**B37053-00** <sup>13</sup>


**H80730-00**  
06E 103 148 M  
86 Ø  
MLS  
Zyl. 1 - 3  
→05/12




**H80731-00**  
06E 103 149 M  
86 Ø  
MLS  
Zyl. 4 - 6  
→05/12



**H40702-00**  
06E 103 148 AN  
85 Ø  
MLS  
Zyl. 1-3  
06/12→



**H40703-00**  
06E 103 149 AN  
85 Ø  
MLS  
Zyl. 4-6  
06/12→




**T80728-00**  
06E 103 385 (8x)  
→06/11




**T40707-00**  
WHT 005 739 (8x)  
07/11→



2x **X83361-01**  
06E 103 484 P  
Zyl. 1-3

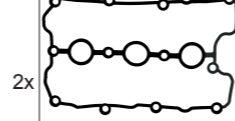

2x **X83362-01**  
06E 103 483 Q  
Zyl. 4-6

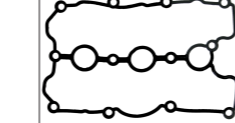

**N92830-00**  
036 109 675 (24x)  
**P76662-00**  
036 109 675


**M38701-00**  
06E 198 717




**X81442-01**  
06E 253 039 C



2x **70-31414-10**



**P77452-01 K** ←   
06E 103 153 E  
PTFE  
**P77362-01 K** →  
079 103 051 F  
85x105x8,8  
A SL LD PTFE ACM

AUDI													
3,0 ASB BKN BMK BNG BUG BUN	150-171 kW (204-233 PS)	A4 TDI A6 TDI A8 TDI Q7 TDI	08/03-08/11	<b>D37054-00</b> <sup>12</sup> Zyl. 1 - 3  <b>D37055-00</b> <sup>12</sup> Zyl. 4 - 6  <b>B37054-00</b> <sup>13</sup>	<b>H01841-00</b> 059 103 383 CM 1,1 mm 1 MLS Zyl. 1 - 3 <b>H11841-10</b> 059 103 383 CN 1,15 mm 2 MLS Zyl. 1 - 3 <b>H21841-20</b> 059 103 383 CP 1,2 mm 3 MLS Zyl. 1 - 3  <b>H01842-00</b> 059 103 383 CQ 1,1 mm 1 MLS Zyl. 4 - 6 <b>H11842-10</b> 059 103 383 CR 1,15 mm 2 MLS Zyl. 4 - 6 <b>H21842-20</b> 059 103 383 CS 1,2 mm 3 MLS Zyl. 4 - 6 	<b>T80448-00</b> 057 103 384 A (16x) 	<b>X83105-01</b> 059 103 483 N Zyl. 1 - 3 NBR  <b>X83106-01</b> 059 103 483 M Zyl. 4 - 6 NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>N92993-00</b> 036 109 675 (12x) <b>P76662-00</b> 036 109 675 	<b>X89125-01</b> 2x 059 129 717 J  	<b>X81941-01</b> 2x 059 253 039 D 	<b>70-31414-10</b> 	<b>P77441-01 K</b> ← 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
3,0 ASN AVK BBJ	160-162 kW (218-220 PS)	A4 A6 A8	11/00-07/06	<b>D36781-00</b> <sup>12</sup>	<b>H80446-00</b> 2x 06C 103 383 H 83 Ø 1,2 mm MLS 	<b>T80446-00</b> 2x 06B 103 385 (8x) 	<b>X83107-01</b> 2x 06C 103 483 J NBR 	<b>N92633-00</b> 036 109 675 (30x) <b>P76662-00</b> 036 109 675 	<b>X58942-01</b> 2x 078 129 717 J  <b>X59571-01</b> 2x 078 129 717 P 	<b>X52308-01</b> 2x 078 253 039 G 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77442-01 N</b> 4x 06C 103 085 42x55x7 RD PTFE	
3,0 CAJA CAKA CCAA CCBA CGWA CGWB CGWC CGWD CGXB CGXC CHMA CJWE CMDA CMUA CTUB CTUC CTUD CTVA CTWA CTWB CTXA	200-260 kW (272-354 PS)	A4 S4 A4 TFSI A5 TFSI A6 TFSI A7 TFSI A8 TFSI Q5 TFSI Q7 TFSI S4 S5	10/08→	<b>D38069-00</b> <sup>12</sup> Zyl. 1-3 <b>D38070-00</b> <sup>12</sup> Zyl. 4-6 <b>B38111-00</b> <sup>13</sup> <sup>35</sup>	<b>H40461-00</b> 06E 103 148 AD 85,2 Ø MLS Zyl. 1-3  <b>H40462-00</b> 06E 103 149 AD 85,2 Ø MLS Zyl. 4-6 	<b>T80728-00</b> 2x 06E 103 385 (8x) 	<b>X83361-01</b> 2x 06E 103 484 P Zyl. 1-3  <b>X83362-01</b> 06E 103 483 Q Zyl. 4-6 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 24x 036 109 675 	<b>X59476-01</b> 6x 079 129 717 D  <b>X89852-01</b> <sup>10</sup> 6x 079 129 717 B 	<b>X81442-01</b> 2x 06E 253 039 C 	<b>70-31414-10</b> 	<b>P77452-01 K</b> ← 06E 103 153 E PTFE <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM	

AUDI													
Ltr.													
3,0 CAPA	176 kW (240 PS)	A4 TDI A5 TDI	06/07→	<b>D37055-01</b> <sup>12</sup> Zyl. 4 - 6  <b>D38060-00</b> <sup>12</sup> Zyl. 1-3  <b>B38110-00</b> <sup>13</sup>	<b>H01841-00</b> 059 103 383 CM 1,1 mm 1 MLS Zyl. 1 - 3 <b>H11841-10</b> 059 103 383 CN 1,15 mm 2 MLS Zyl. 1 - 3 <b>H21841-20</b> 059 103 383 CP 1,2 mm 3 MLS Zyl. 1 - 3  <b>H01842-00</b> 059 103 383 CQ 1,1 mm 1 MLS Zyl. 4 - 6 <b>H11842-10</b> 059 103 383 CR 1,15 mm 2 MLS Zyl. 4 - 6 <b>H21842-20</b> 059 103 383 CS 1,2 mm 3 MLS Zyl. 4 - 6 	<b>T80448-00</b> 057 103 384 A (16x) 	<b>X83105-01</b> 059 103 483 N Zyl. 1 - 3 NBR  <b>X83106-01</b> 059 103 483 M Zyl. 4 - 6 NBR 	<b>N92993-00</b> 036 109 675 (12x) <b>P76662-00</b> 036 109 675 2x 24x	<b>X89125-01</b> 059 129 717 J  2x	<b>X81941-01</b> 059 253 039 D  2x	<b>70-31414-10</b> 	<b>P77441-01 K</b> ← 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	

AUDI												
Ltr.												
3,0 CASA CASB CATA CCLA CCMA CCWA CDYA CDYB CDYC	155-176 kW (211-240 PS) A4 TDI A5 TDI A6 TDI Q5 TDI Q7 TDI	05/04→	<p><b>D37055-01</b> <sup>12</sup> Zyl. 4 - 6</p> <p><b>D38060-00</b> <sup>12</sup> Zyl. 1-3</p> <p><b>B38110-00</b> <sup>13</sup></p>	<p><b>H01404-00</b> 059 103 383 EP 84 Ø 1,1 mm 1 □ MLS Zyl. 4-6</p> <p><b>H11404-10</b> 059 103 383 EQ 84 Ø 1,15 mm 2 □ MLS Zyl. 4-6</p> <p><b>H21404-20</b> 059 103 383 ER 84 Ø 1,2 mm 3 □ MLS Zyl. 4-6</p> <p><b>H01406-00</b> 059 103 383 ES 84 Ø 1,1 mm 1 □ MLS Zyl. 1-3</p> <p><b>H11406-10</b> 059 103 383 ET 84 Ø 1,15 mm 2 □ MLS Zyl. 1-3</p> <p><b>H21406-20</b> 059 103 383 FA 84 Ø 1,2 mm 3 □ MLS Zyl. 1-3</p>	<p><b>T80448-00</b> 057 103 384 A (16x)</p>	<p><b>X83105-01</b> 059 103 483 N Zyl. 1 - 3 NBR</p> <p><b>X83106-01</b> 059 103 483 M Zyl. 4 - 6 NBR</p>	<p><b>N92993-00</b> 036 109 675 (12x) <b>P76662-00</b> 036 109 675</p>	<p>2x <b>X89125-01</b> 2x 059 129 717 J 24x</p>	<p><b>X81941-01</b> 2x 059 253 039 D</p>	<p><b>70-31414-10</b></p>	<p><b>P77441-01 K</b> ← 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>	

[NEW]

AUDI												
Ltr.												
3,0 CDTA CDTB CDTC CDUC CDUD CJGA CJGC CJGD CJMA CKVB CKVC CLAA CLAB CLZB CMHA CNRB CPNA CPNB CRCA CTBA CTBB CTBC CTCB CTCC	150-190 kW (204-258 PS)	A4 TDI A5 TDI A6 TDI A7 TDI A8 TDI Q5 TDI Q7 TDI	11/07→	<b>D38407-00</b> <sup>12</sup>  <b>B38736-00</b> <sup>13</sup>	<b>H40585-00</b> 059 103 383 JL 84 Ø 1,58 mm 1 MLS Zyl. 1-3 <b>H40585-10</b> 059 103 383 JM 84 Ø 1,63 mm 2 MLS Zyl. 1-3 <b>H40585-20</b> 059 103 383 JN 84 Ø 1,68 mm 3 MLS Zyl. 1-3  <b>H40586-00</b> 059 103 383 JP 84 Ø 1,58 mm 1 MLS Zyl. 4-6 <b>H40586-10</b> 059 103 383 JQ 84 Ø 1,63 mm 2 MLS Zyl. 4-6 <b>H40586-20</b> 059 103 383 JR 84 Ø 1,68 mm 3 MLS Zyl. 4-6 	<b>T40585-00</b> WHT 005 262 (8x) 	2x <b>X83407-01</b> 059 103 484 Zyl. 1-3  <b>X83408-01</b> 059 103 483 T Zyl. 4-6 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	24x <b>X59478-01</b> 059 129 717 N  <b>X59481-01</b> 059 129 718 A 	6x  6x	<b>X82514-01</b> 059 253 039 N  2x <b>70-31414-10</b> 	<b>P77441-01 K</b> ← 079 103 051 D 55x70x8 A SL RD PTFE <b>P77766-01 K</b> → 059 103 051 K 85x105x8 A SL LD FPM




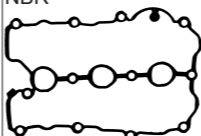
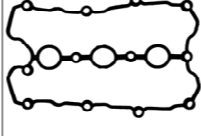









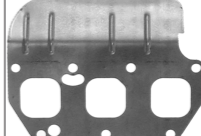






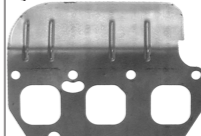







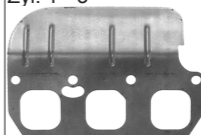


[NEW]



AUDI													
3,0 CGQB	230 kW (313 PS)	A6 TDI A7 TDI SQ5	11/11→	<p><b>D38407-01</b> <sup>12</sup></p> <p><b>B38736-00</b> <sup>13</sup></p>	<p><b>H40697-00</b> 059 103 383 NK 84 Ø 1,58 mm 1 □ MLS Zyl. 4-6</p> <p><b>H40697-10</b> 059 103 383 NL 84 Ø 1,63 mm 2 □ MLS Zyl. 4-6</p> <p><b>H40697-20</b> 059 103 383 NM 84 Ø 1,68 mm 3 □ MLS Zyl. 4-6</p> <p><b>H40698-00</b> 059 103 383 NG 84 Ø 1,58 mm 1 □ MLS Zyl. 1-3</p> <p><b>H40698-10</b> 059 103 383 NH 84 Ø 1,63 mm 2 □ MLS Zyl. 1-3</p> <p><b>H40698-20</b> 059 103 383 NJ 84 Ø 1,68 mm 3 □ MLS Zyl. 1-3</p>	<p><b>T40585-00</b> WHT 005 262 (8x)</p>	<p>2x <b>X83407-01</b> 059 103 484 Zyl. 1-3</p> <p><b>X83408-01</b> 059 103 483 T Zyl. 4-6</p>	<p><b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675</p> <p>24x</p>	<p><b>X59478-01</b> 059 129 717 N</p> <p>6x</p> <p><b>X59481-01</b> 059 129 718 A</p> <p>6x</p>	<p><b>X59928-01</b> 059 253 039 Q</p> <p>2x</p>	<p><b>70-31414-10</b></p>	<p><b>P77441-01 K</b> ← 079 103 051 D 55x70x8 A SL RD PTFE</p> <p><b>P77766-01 K</b> → 059 103 051 K 85x105x8 A SL LD FPM</p>	
3,0 CJTB CJTC CJWB CJWC CNA	200-245 kW (272-333 PS)	Q7 TFSI	05/10-08/15	<p><b>D38069-00</b> <sup>12</sup> Zyl. 1-3</p> <p><b>D38070-00</b> <sup>12</sup> Zyl. 4-6</p>	<p><b>H40461-00</b> 06E 103 148 AD 85,2 Ø MLS Zyl. 1-3</p> <p><b>H40462-00</b> 06E 103 149 AD 85,2 Ø MLS Zyl. 4-6</p>	<p><b>T80728-00</b> 06E 103 385 (8x)</p>	<p>2x <b>X83361-01</b> 06E 103 484 P Zyl. 1-3</p> <p><b>X83362-01</b> 06E 103 483 Q Zyl. 4-6</p>	<p><b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675</p> <p>24x</p>	<p><b>X59476-01</b> 079 129 717 D</p> <p>6x</p> <p><b>X89852-01</b> <sup>10</sup> 079 129 717 B</p> <p>6x</p>	<p><b>X81442-01</b> 06E 253 039 C</p> <p>2x</p>	<p><b>70-31414-10</b></p>	<p><b>P77452-01 K</b> ← </p> <p>06E 103 153 E PTFE</p> <p><b>P77766-01 K</b> → 059 103 051 K 85x105x8 A SL LD FPM</p>	

AUDI													
Ltr. 3,0 CREA CREC CREG CTDA <b>[NEW]</b>	213-245 kW (290-333 PS)	A8 TFSI	06/10→	<b>D90186-00</b> <sup>12</sup> Zyl. 1-3 <b>D90187-00</b> <sup>12</sup> Zyl. 4-6 <b>B82508-00</b> <sup>13</sup>	<b>H40702-00</b> 06E 103 148 AN 85 Ø MLS Zyl. 1-3  <b>H40703-00</b> 06E 103 149 AN 85 Ø MLS Zyl. 4-6 	<b>T80728-00</b> 06E 103 385 (8x) 	2x <b>X83361-01</b> 06E 103 484 P Zyl. 1-3  <b>X83362-01</b> 06E 103 483 Q Zyl. 4-6 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	2x <b>X59476-01</b> O 079 129 717 D 6x  6x <b>X90117-01</b> U 06E 129 717 F 	<b>X81442-01</b> 06E 253 039 C 2x 	<b>P77452-01</b> K ← 06E 103 153 E PTFE <b>P77766-01</b> K → 059 103 051 K 85x105x8 A SL LD FPM		
3,0 CREC CRED CTDA <b>[NEW]</b>	200-245 kW (272-333 PS)	A4 TFSI A6 TFSI A7 TFSI S5	06/09→	<b>D90188-00</b> <sup>12</sup> Zyl. 1-3 <b>D90189-00</b> <sup>12</sup> Zyl. 4-6 <b>B82508-00</b> <sup>13</sup>	<b>H40461-00</b> 06E 103 148 AD 85,2 Ø MLS Zyl. 1-3  <b>H40462-00</b> 06E 103 149 AD 85,2 Ø MLS Zyl. 4-6 	<b>T80728-00</b> 06E 103 385 (8x) 	2x <b>X83361-01</b> 06E 103 484 P Zyl. 1-3  <b>X83362-01</b> 06E 103 483 Q Zyl. 4-6 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	2x <b>X59476-01</b> O 079 129 717 D 6x  6x <b>X90117-01</b> U 06E 129 717 F 	<b>X81442-01</b> 06E 253 039 C 2x 	<b>P77452-01</b> K ← 06E 103 153 E PTFE <b>P77766-01</b> K → 059 103 051 K 85x105x8 A SL LD FPM		



AUDI												
3,2 AUK BKH BPK BYU	183-191 kW (249-260 PS)	A4 FSI A6 FSI A8 FSI	05/04-07/10	<b>D37056-00</b> <sup>12</sup> <b>B37053-00</b> <sup>13</sup>	<b>H80730-00</b> 06E 103 148 M 86 Ø MLS Zyl. 1 - 3  <b>H80731-00</b> 06E 103 149 M 86 Ø MLS Zyl. 4 - 6 	<b>T80728-00</b> 06E 103 385 (8x) 	2x <b>X83122-01</b> 06E 103 183 G Zyl. 4 - 6 NBR  <b>X83123-01</b> 06E 103 484 G Zyl. 1 - 3 NBR 	<b>N92993-00</b> 036 109 675 (12x) <b>P76662-00</b> 036 109 675	2x <b>X89276-01</b> 06E 129 717 B 6x 	<b>X81442-01</b> 06E 253 039 C 2x 	<b>70-31414-10</b> 	<b>P77452-01 K</b> ←  06E 103 153 E PTFE <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM
3,2 BDB BHE BMJ BPF BUB	184 kW (250 PS)	A3 A3 TT →8P 5A087 000 →8P 5B006 000 →8N 5 012 200	07/03-05/09	<b>D37008-00</b> <sup>12</sup>	<b>H80453-00</b> 022 103 383 M 85 Ø MLS 	<b>T80453-00</b> 022 103 384 L (13x) +022 103 384 M (7x) 	<b>X83108-01</b> 022 103 483 E NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	24x <b>X89128-01</b> 022 133 237 C 	<b>X81441-01</b> 022 253 050 C Zyl. 4 - 6  <b>X81963-01</b> 022 253 039 E Zyl. 1 - 3 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
3,2 BDB BHE BMJ BPF BUB	184 kW (250 PS)	A3 A3 TT 8P 5A087 001→ 8P 5B006 001→ 8N 5 012 201→	07/03-05/09	<b>D37008-00</b> <sup>12</sup>	<b>H80453-00</b> 022 103 383 M 85 Ø MLS 	<b>T80453-00</b> 022 103 384 L (13x) +022 103 384 M (7x) 	<b>X83108-01</b> 022 103 483 E NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	24x <b>X89128-01</b> 022 133 237 C 	<b>X81441-01</b> 022 253 050 C Zyl. 4 - 6  <b>X81963-01</b> 022 253 039 E Zyl. 1 - 3 	<b>70-31414-10</b> 	<b>P77820-01 K</b> ←  022 103 151 D <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM
3,2 BUB	184 kW (250 PS)	TT	08/06-06/10	<b>D37008-00</b> <sup>12</sup>	<b>H80453-00</b> 022 103 383 M 85 Ø MLS 	<b>T80453-00</b> 022 103 384 L (13x) +022 103 384 M (7x) 	<b>X83108-01</b> 022 103 483 E NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	24x <b>X89128-01</b> 022 133 237 C 	<b>X81441-01</b> 022 253 050 C Zyl. 4 - 6  <b>X81963-01</b> 022 253 039 E Zyl. 1 - 3 	<b>70-31414-10</b> 	<b>P76096-11 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>P77820-01 K</b> ←  022 103 151 D <b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM

AUDI													
3,2 CALA CALB	195-199 kW (265-270 PS)	A4 FSI A5 FSI A5 TFSI A6 FSI Q5 FSI	06/07→	<b>D38064-00</b> <sup>12</sup> Zyl. 4-6 <b>D38065-00</b> <sup>12</sup> Zyl. 1-3 <b>B38111-00</b> <sup>13 35</sup>	<b>H40459-00</b> 06E 103 149 AC 86,2 Ø MLS Zyl. 4-6  <b>H40460-00</b> 06E 103 148 AC 86,2 Ø MLS Zyl. 1-3 	<b>T80728-00</b> 06E 103 385 (8x) 	2x <b>X83361-01</b> 06E 103 484 P Zyl. 1-3  <b>X83362-01</b> 06E 103 483 Q Zyl. 4-6 		<b>X89276-01</b> 06E 129 717 B 6x  <b>X89852-01</b> <sup>10</sup> 079 129 717 B 6x 		<b>X81442-01</b> 06E 253 039 C 2x 		<b>P77452-01 K</b> ← 06E 103 153 E PTFE <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM
3,3 AKF	165 kW (224 PS)	A8 TDI	06/00-09/02		<b>H01891-00</b> 057 103 383 J 1,1 mm MLS Zyl. 1 - 4 <b>H11891-10</b> 057 103 383 K 1,15 mm MLS Zyl. 1 - 4 <b>H21891-20</b> 057 103 383 L 80 Ø 1,2 mm MLS Zyl. 1 - 4  <b>H01892-00</b> 057 103 383 M 1,1 mm MLS Zyl. 1 - 8 <b>H11892-10</b> 057 103 383 N 1,15 mm MLS Zyl. 5 - 8 <b>H21892-20</b> 057 103 383 P 80 Ø 1,2 mm MLS Zyl. 5 - 8 	<b>T80610-00</b> 057 103 384 A (10x) 	2x <b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 32x	<b>X87467-01</b> 057 129 717 B 	2x <b>X52307-01</b> 059 253 039 B 	8x <b>70-31414-10</b> 	<b>P76443-01 K</b> ← 55x68x8 A SL RD FPM <b>P76087-01 N</b> 4x 068 103 085 E 32x47x10 A SL WD FPM		

AUDI													
Ltr.													
3,6 BHK	206 kW (280 PS) Q7 FSI	08/06-05/10	<b>D37064-00</b> <sup>(12)</sup>  <b>B82500-00</b> <sup>(13)</sup>	<b>H80734-00</b> 03H 103 383 H 85 Ø MLS 	<b>T80734-00</b> WHT 000 497 A (13x) +WHT 000 789 A (7x) 	<b>X83128-01</b> 03H 103 483 C NBR 	<b>N92830-00</b> 036 109 675 (24x) <b>P76662-00</b> 036 109 675	<b>X89300-01</b> 03H 133 237 B 24x 		<b>X81832-01</b> 03H 253 039 E Zyl. 1 - 3 	<b>70-31414-10</b> 	<b>P77354-01 K</b> → 021 103 051 C 85x105x11 A SL LD PTFE ACM	
3,6 PT	180-184 kW (245-250 PS) V8	10/88-02/94	<b>D37009-00</b> 077 198 012 A	<b>H80546-00</b> 077 103 383 S 82 Ø 1,75 mm 	<b>T80546-00</b> 077 103 385 (10x) 		<b>N92850-00</b> 027 109 675 (16x) <b>P76532-00</b> 027 109 675						
3,7 AEW AKJ	169 kW (230 PS) A8 →4D T 008 226	07/95-12/98	<b>D37010-00</b> Zyl. 1 - 4 <b>D37011-00</b> Zyl. 5 - 8	<b>H80003-00</b> 077 103 383 AD 85,3 Ø 1,75 mm Zyl. 5 - 8  <b>H80004-00</b> 077 103 383 AC 85,3 Ø 1,75 mm Zyl. 1 - 4 	<b>T80546-00</b> 077 103 385 (10x) 	<b>V37010-00</b> 077 198 025 	<b>N92850-00</b> 027 109 675 (16x) <b>P76532-00</b> 027 109 675	<b>X58948-01</b> 077 129 717 N 32x 		<b>X81762-01</b> 077 253 039 B 	<b>X54467-01</b> 077 103 609 E  <b>X54466-01</b> <sup>(11)</sup> 077 103 610 C 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	
3,7 AEW AKJ	169 kW (230 PS) A8 4D T 008 227→	07/95-12/98	<b>D37010-00</b> Zyl. 1 - 4 <b>D37011-00</b> Zyl. 5 - 8	<b>H80003-00</b> 077 103 383 AD 85,3 Ø 1,75 mm Zyl. 5 - 8  <b>H80004-00</b> 077 103 383 AC 85,3 Ø 1,75 mm Zyl. 1 - 4 	<b>T80546-00</b> 077 103 385 (10x) 	<b>V37010-00</b> 077 198 025 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	<b>X58948-01</b> 077 129 717 N 32x 		<b>X81762-01</b> 077 253 039 B 	<b>X54467-01</b> 077 103 609 E  <b>X54466-01</b> <sup>(11)</sup> 077 103 610 C 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11 K</b> → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01 N</b> 068 103 085 E 32x47x10 A SL WD FPM	

AUDI																
3,7 Ltr.	AKC AQG BFL	191-206 kW (260-280 PS)	A6 A8	11/98-05/06	<b>D32944-00</b> <sup>12</sup> 077198012E		<b>H80001-00</b> 077 103 383 BS 86 Ø MLS Zyl. 5 - 8 	<b>H80002-00</b> 077 103 383 BT 86 Ø MLS Zyl. 1 - 4 	<b>T80002-00</b> 077 103 385 D (10x) 	2x <b>V32944-00</b> 077 198 025 A 	2x <b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 40x	2x <b>X58947-01</b> 077 129 717 Q 		2x <b>X52312-01</b> 077 253 039 C 	<b>70-31414-10</b> 	<b>P76443-01 K</b> ← 55x68x8 A SL RD FPM <b>P76087-01 N</b> 4x 068 103 085 E 32x47x10 A SL WD FPM
4,0 ASE		202 kW (275 PS)	A8 TDI	05/03-07/05			<b>H01893-00</b> 057 103 383 BQ 1,1 mm MLS Zyl. 1 - 4 <b>H11893-10</b> 057 103 383 BR 1,15 mm MLS Zyl. 1 - 4 <b>H21893-20</b> 057 103 383 BS 82,5 Ø 1,2 mm MLS Zyl. 1 - 4 	<b>H01894-00</b> 057 103 383 CC 1,1 mm MLS Zyl. 5 - 8 <b>H11894-10</b> 057 103 383 CD 1,15 mm MLS Zyl. 5 - 8 <b>H21894-20</b> 057 103 383 CE 82,5 Ø 1,2 mm MLS Zyl. 5 - 8 	<b>T80610-00</b> 057 103 384 A (10x) 	2x <b>X83124-01</b> 057 103 483 H Zyl. 1 - 4 NBR  <b>X83125-01</b> 057 103 483 G Zyl. 5 - 8 NBR 		8x <b>X89278-01</b> 057 129 717 F 	8x <b>X52307-01</b> 059 253 039 B 	<b>70-31414-10</b> 	<b>P76443-01 K</b> ← 55x68x8 A SL RD FPM <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM	

AUDI													
4,0 CEUA CEUC CTGA CTGE <b>[NEW]</b>	309-331 kW (420-450 PS)	A8 TFSI S6 S7	02/12→	<b>D90184-00</b> ⑫ Zyl. 1-4 <b>D90185-00</b> ⑫ Zyl. 5-8 <b>B82507-00</b> ⑬	<b>H40710-00</b> 079 103 383 DP 85 Ø MLS Zyl. 1-4  <b>H40711-00</b> 079 103 383 DQ 85 Ø MLS Zyl. 5-8 	<b>T84831-00</b> WHT 005 534 (10x) 	2x <b>70-31414-10</b> 	2x <b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	2x <b>X59915-01</b> 079 129 717 H 32x	4x <b>X59916-01</b> 079 129 717 G 4x	2x <b>X59877-01</b> 079 253 039 M 	2x <b>70-31414-10</b> 	<b>P77444-01 K</b> ← 079 103 051 G 55x72x8 A SL RD FPM <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM
4,0 CGTA CTFA <b>[NEW]</b>	382 kW (520 PS)	S8	04/12→	<b>D90184-00</b> ⑫ Zyl. 1-4 <b>D90185-00</b> ⑫ Zyl. 5-8	<b>H40710-00</b> 079 103 383 DP 85 Ø MLS Zyl. 1-4  <b>H40711-00</b> 079 103 383 DQ 85 Ø MLS Zyl. 5-8 	<b>T84831-00</b> WHT 005 534 (10x) 	2x <b>70-31414-10</b> 	2x <b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	2x <b>X59915-01</b> 079 129 717 H 32x	4x <b>X59916-01</b> 079 129 717 G 4x	2x <b>X59877-01</b> 079 253 039 M 	2x <b>70-31414-10</b> 	<b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM
4,0 CRDB CWUB <b>[NEW]</b>	412 kW (560 PS)	RS6 RS7	01/13→	<b>D90184-00</b> ⑫ Zyl. 1-4 <b>D90185-00</b> ⑫ Zyl. 5-8 <b>B82507-00</b> ⑬	<b>H40710-00</b> 079 103 383 DP 85 Ø MLS Zyl. 1-4  <b>H40711-00</b> 079 103 383 DQ 85 Ø MLS Zyl. 5-8 	<b>T84831-00</b> WHT 005 534 (10x) 	2x <b>70-31414-10</b> 	2x <b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675	2x <b>X59915-01</b> 079 129 717 H 32x	4x <b>X59916-01</b> 079 129 717 G 4x	2x <b>X59877-01</b> 079 253 039 M 	2x <b>70-31414-10</b> 	<b>P77441-01 K</b> ← 079 103 051 D 55x70x8 A SL RD PTFE <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM
4,2 ABH AEC	206-213 kW (280-290 PS)	A6 S6 V8 100 S4	→4A T 075 000 10/91-12/97	<b>D32946-00</b> ⑫ 077 198 012 B	<b>H80003-00</b> 077 103 383 AD 85,3 Ø 1,75 mm Zyl. 5 - 8  <b>H80004-00</b> 077 103 383 AC 85,3 Ø 1,75 mm Zyl. 1 - 4 	<b>T80546-00</b> 077 103 385 (10x) 	2x <b>V37010-00</b> 077 198 025 	2x <b>N92850-00</b> 027 109 675 (16x) <b>P76532-00</b> 027 109 675	2x <b>X58948-01</b> 077 129 717 N 32x	2x <b>X70699-01</b> 077 129 589 E 	8x <b>X54467-01</b> 077 103 609 E  <b>X54466-01</b> ⑪ 077 103 610 C 	<b>P76096-01 K</b> ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76087-01 N</b> 2x 068 103 085 E 32x47x10 A SL WD FPM	



AUDI															
4,2 Ltr.	180-250 kW (245-340 PS)	A8 A8 S8	→4D T 008 226 03/94-12/99 →4D T 008 226	<b>D37010-00</b> Zyl. 1 - 4 <b>D37011-00</b> Zyl. 5 - 8	<b>H80003-00</b> 077 103 383 AD 85,3 Ø 1,75 mm Zyl. 5 - 8 	<b>T80546-00</b> 077 103 385 (10x) 	2x <b>V37010-00</b> 077 198 025 	2x <b>N92850-00</b> 027 109 675 (16x) <b>P76532-00</b> 027 109 675 32x 	<b>X58948-01</b> 077 129 717 N 2x 	<b>X81762-01</b> 077 253 039 B 2x 	<b>X54467-01</b> 077 103 609 E 2x 	<b>X54466-01</b> (T) 077 103 610 C 2x 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM		
4,2 ABZ AEM AGH AHC AKG AKH	180-250 kW (245-340 PS)	A8 A8 S8	4D T 008 227→ 03/94-12/99 4D T 008 227→	<b>D37010-00</b> Zyl. 1 - 4 <b>D37011-00</b> Zyl. 5 - 8	<b>H80003-00</b> 077 103 383 AD 85,3 Ø 1,75 mm Zyl. 5 - 8 	<b>T80546-00</b> 077 103 385 (10x) 	2x <b>V37010-00</b> 077 198 025 	2x <b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 32x 	<b>X58948-01</b> 077 129 717 N 2x 	<b>X81762-01</b> 077 253 039 B 2x 	<b>X54467-01</b> 077 103 609 E 2x 	<b>X54466-01</b> (T) 077 103 610 C 2x 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76355-11</b> K → 068 103 051 P 85x105x9 A SL LD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM		
4,2 AEC	213 kW (290 PS)	A6 S6	4A T 075 001→ 06/94-12/97	<b>D37010-00</b> Zyl. 1 - 4 <b>D37011-00</b> Zyl. 5 - 8	<b>H80003-00</b> 077 103 383 AD 85,3 Ø 1,75 mm Zyl. 5 - 8 	<b>T80546-00</b> 077 103 385 (10x) 	2x <b>V37010-00</b> 077 198 025 	2x <b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 32x 	<b>X58948-01</b> 077 129 717 N 2x 	<b>X07855-01</b> 027 129 589 A 8x 	<b>X54467-01</b> 077 103 609 E 2x 	<b>X54466-01</b> (T) 077 103 610 C 2x 	<b>P76096-01</b> K ← 069 115 147 C 35x48x10 A SL RD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM		
4,2 ANK AQJ ARS ASG AUX AWN AYS BCS BFM	220-268 kW (299-364 PS)	A6 A6 S6 A8	11/98→	<b>D32944-00</b> (12) 077198012E	<b>H80001-00</b> 077 103 383 BS 86 Ø MLS Zyl. 5 - 8 	<b>T80002-00</b> 077 103 385 D (10x) 	2x <b>V32944-00</b> 077 198 025 A 	2x <b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 40x 	<b>X58947-01</b> 077 129 717 Q 2x 	<b>X52312-01</b> 077 253 039 C 2x 	<b>70-31414-10</b> 	<b>P76443-01</b> K ← 55x68x8 A SL RD FPM <b>P76087-01</b> N 068 103 085 E 32x47x10 A SL WD FPM			

AUDI																	
4,2 Ltr.	AQF AQH ARU AUW AVP	175-265 kW (238-360 PS)	A8 A8 S8	→4D X 013 000 →4D X 013 000	11/98-09/02	<b>D32945-00</b> <sup>12</sup> 077 198 012 D	<b>H80001-00</b> 077 103 383 BS 86 Ø MLS Zyl. 5 - 8 	<b>H80002-00</b> 077 103 383 BT 86 Ø MLS Zyl. 1 - 4 	<b>T80002-00</b> 077 103 385 D (10x) 	2x <b>V37010-00</b> 077 198 025 	2x <b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 40x	2x <b>X58947-01</b> 077 129 717 Q 	<b>X52312-01</b> 077 253 039 C 2x 	<b>70-31414-10</b> 	<b>P76443-01 K</b> ← 55x68x8 A SL RD FPM <b>P76087-01 N</b> 4x 068 103 085 E 32x47x10 A SL WD FPM		
4,2 Ltr.	AQF AQH ARU AUW AVP	175-265 kW (238-360 PS)	A8 A8 S8	4D X 013 001→ 4D X 013 001→	11/98-09/02	<b>D32944-00</b> <sup>12</sup> 077198012E	<b>H80001-00</b> 077 103 383 BS 86 Ø MLS Zyl. 5 - 8 	<b>H80002-00</b> 077 103 383 BT 86 Ø MLS Zyl. 1 - 4 	<b>T80002-00</b> 077 103 385 D (10x) 	2x <b>V32944-00</b> 077 198 025 A 	2x <b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 40x	2x <b>X58947-01</b> 077 129 717 Q 	<b>X52312-01</b> 077 253 039 C 2x 	<b>70-31414-10</b> 	<b>P76443-01 K</b> ← 55x68x8 A SL RD FPM <b>P76087-01 N</b> 4x 068 103 085 E 32x47x10 A SL WD FPM		
4,2 BAR		257 kW (350 PS)	Q7 FSI	4L 8 022 001→	03/06-05/10		<b>H80764-00</b> 079 103 383 AQ MLS Zyl. 1 - 4 	<b>H80765-00</b> 079 103 383 AR MLS Zyl. 5 - 8 		<b>X59872-01 R</b> 079 103 484 C 	<b>X59873-01 L</b> 079 103 483 T 	2x <b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 32x	2x <b>X90076-01</b> 079 133 074 B 	8x <b>X89852-01</b> <sup>10</sup> 079 129 717 B 	<b>X90075-01</b> 079 253 039 F 2x 	<b>70-31414-10</b> 	<b>P77444-01 K</b> ← 079 103 051 G 55x72x8 A SL RD FPM <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM

AUDI												
Ltr.    1 4,2 BAS BAT BBK BHF	220-253 kW (299-344 PS)	ALLROAD V8 A4 S4 A6	07/02-03/09	 <b>H80717-00</b> 079103383S 86 Ø MLS Zyl. 1 - 4  <b>H80718-00</b> 079103383T 86 Ø MLS Zyl. 5 - 8 	 <b>T80002-00</b> 077 103 385 D (10x) 	2x <b>V38061-00</b> 077 198 025 B Zyl. 1-4  <b>V38062-00</b> 077 198 025 C Zyl. 5-8  <b>X83109-01</b> 079 103 483 K Zyl. 1 - 4 NBR  <b>X83110-01</b> 079 103 483 L Zyl. 5 - 8 NBR 	 <b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 40x	2x <b>X58947-01</b> 077 129 717 Q 2x 	 <b>X52312-01</b> 077 253 039 C 2x 	 <b>70-31414-10</b> 	 <b>P77444-01 K</b> ← 079 103 051 G 55x72x8 A SL RD FPM <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM	
4,2 BCY BRV	331-353 kW (450-480 PS)	A6 RS6	07/02-01/05	 <b>H80719-00</b> 077 103 383 BQ 86 Ø MLS Zyl. 1 - 4  <b>H80720-00</b> 077 103 383 BR 86 Ø MLS Zyl. 5 - 8 	 <b>T80002-00</b> 077 103 385 D (10x) 	2x <b>V32944-00</b> 077 198 025 A 2x 	 <b>N90298-00</b> 036 109 675 (20x) <b>P76662-00</b> 036 109 675 40x	2x <b>X89177-01</b> 077 129 717 R 2x 	 <b>X52312-01</b> 077 253 039 C 2x 	 <b>70-31414-10</b> 	 <b>P76443-01 K</b> ← 55x68x8 A SL RD FPM <b>P76087-01 N</b> 4x 068 103 085 E 32x47x10 A SL WD FPM	

AUDI													
4,2 Ltr.	BMC BTR BVN	235-240 kW (320-326 PS)	A8 TDI Q7 TDI	01/05-07/10		<p><b>H40576-00</b> 057 103 383 EM 83,5 Ø 1 </p> <p>MLS Zyl. 1-4</p> <p><b>H40576-10</b> 057 103 383 EN 83,5 Ø 2 </p> <p>MLS Zyl. 1-4</p> <p><b>H40576-20</b> 057 103 383 EP 83,5 Ø 3 </p> <p>MLS Zyl. 1-4</p> <p><b>H40577-00</b> 057 103 383 EQ 83,5 Ø 1 </p> <p>MLS Zyl. 5-8</p> <p><b>H40577-10</b> 057 103 383 ER 83,5 Ø 2 </p> <p>MLS Zyl. 5-8</p> <p><b>H40577-20</b> 057 103 383 ES 83,5 Ø 3 </p> <p>MLS Zyl. 5-8</p>	<p><b>T80610-00</b> 057 103 384 A (10x)</p>	<p>2x <b>X59505-01</b> 057 103 484 Zyl. 1-4</p> <p><b>X59506-01</b> 057 103 483 J Zyl. 5-8</p>	<p><b>N92990-00</b> 036 109 675 (16x)</p> <p><b>P76662-00</b> 036 109 675</p>	<p>2x <b>X59471-01 O</b> 057 129 717 H</p> <p>32x </p> <p>2x <b>X59472-01 U</b> 057 129 717 G</p>	<p><b>X82515-01</b> 057 253 039 D</p> <p>2x </p> <p><b>X82516-01</b> 059 253 039 E</p> <p>2x </p>	<p><b>70-31414-10</b></p>	<p><b>P77441-01 K</b> ← 079 103 051 D 55x70x8 A SL RD PTFE</p> <p><b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM</p>
4,2 BNS BVJ	257-309 kW (350-420 PS)	A4 RS4 A6 FSI A8 FSI	8E 8 901 901→ 4F 8 045 001→ 4E 7 026 901→	09/05-08/11		<p><b>H80764-00</b> 079 103 383 AQ MLS Zyl. 1 - 4</p> <p><b>H80765-00</b> 079 103 383 AR MLS Zyl. 5 - 8</p>	<p><b>X59872-01 R</b> 079 103 484 C</p> <p><b>X59873-01 L</b> 079 103 483 T</p>	<p><b>N92990-00</b> 036 109 675 (16x)</p> <p><b>P76662-00</b> 036 109 675</p>	<p>2x <b>X90076-01</b> 079 133 074 B</p> <p>32x </p>	<p><b>X90075-01</b> 079 253 039 F</p> <p>2x </p>	<p><b>70-31414-10</b></p>	<p><b>P77444-01 K</b> ← 079 103 051 G 55x72x8 A SL RD FPM</p> <p><b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM</p>	

AUDI															
Ltr.															
4,2 BYH	309 kW (420 PS)	R8 FSI	04/07-09/10	<b>H80764-00</b> 079 103 383 AQ MLS Zyl. 1 - 4 	<b>H80765-00</b> 079 103 383 AR MLS Zyl. 5 - 8 		<b>X59873-01 L</b> 079 103 483 T 10/07→ 	<b>X59872-01 R</b> 079 103 484 C 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 2x 32x	<b>X90076-01</b> 079 133 074 B 2x 		<b>X90075-01</b> 079 253 039 F 2x 	<b>70-31414-10</b> 	<b>P77444-01 K</b> ← 079 103 051 G 55x72x8 A SL RD FPM <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM	
4,2 CAUA	260 kW (354 PS)	S5	06/07→	<b>H80764-00</b> 079 103 383 AQ MLS Zyl. 1 - 4 	<b>H80765-00</b> 079 103 383 AR MLS Zyl. 5 - 8 		<b>X59873-01 L</b> 079 103 483 T 10/07→ 	<b>X59872-01 R</b> 079 103 484 C 	<b>N92990-00</b> 036 109 675 (16x) <b>P76662-00</b> 036 109 675 2x 32x	<b>X90076-01</b> 079 133 074 B 2x 	<b>X89852-01</b> (10) 079 129 717 B 8x 		<b>X90075-01</b> 079 253 039 F 2x 	<b>70-31414-10</b> 	<b>P77444-01 K</b> ← 079 103 051 G 55x72x8 A SL RD FPM <b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM





AUDI																
Ltr.																
4,2 CNDA	316 kW (430 PS)	R8 FSI	07/10-07/15		<p><b>H80764-00</b> 079 103 383 AQ MLS Zyl. 1 - 4</p> <p><b>H80765-00</b> 079 103 383 AR MLS Zyl. 5 - 8</p>	<p><b>X59872-01 R</b> 079 103 484 C</p> <p><b>X59873-01 L</b> 079 103 483 T</p>	<p><b>N92990-00</b> 036 109 675 (16x)</p> <p><b>P76662-00</b> 036 109 675</p>	2x	<p><b>X90076-01</b> 079 133 074 B</p>	2x	<p><b>X90075-01</b> 079 253 039 F</p>	2x	<p><b>70-31414-10</b></p>	<p><b>P77362-01 K</b> → 079 103 051 F 85x105x8,8 A SL LD PTFE ACM</p>		
4,2 CTEC <b>[NEW]</b>	283 kW (385 PS)	A8 TDI	10/13→	<p><b>D90182-00</b> <sup>12</sup> Zyl. 1-4</p> <p><b>D90183-00</b> <sup>12</sup> Zyl. 5-8</p> <p><b>B82506-00</b> <sup>13</sup></p>	<p><b>H84827-00</b> 057 103 383 JB 84 Ø 1,1 mm 1 <input type="checkbox"/> MLS Zyl. 1-4</p> <p><b>H84827-10</b> 057 103 383 JC 84 Ø 1,15 mm 2 <input type="checkbox"/> MLS Zyl. 1-4</p> <p><b>H84827-20</b> 057 103 383 JD 84 Ø 1,2 mm 3 <input type="checkbox"/> MLS Zyl. 1-4</p> <p><b>H84828-00</b> 057 103 383 JE 84 Ø 1,1 mm 1 <input type="checkbox"/> MLS Zyl. 5-8</p> <p><b>H84828-10</b> 057 103 383 JF 84 Ø 1,15 mm 2 <input type="checkbox"/> MLS Zyl. 5-8</p> <p><b>H84828-20</b> 057 103 383 JG 84 Ø 1,2 mm 3 <input type="checkbox"/> MLS Zyl. 5-8</p>	<p><b>T80610-00</b> 057 103 384 A (10x)</p>	2x	<p><b>X59505-01</b> 057 103 484 Zyl. 1-4</p> <p><b>X59506-01</b> 057 103 483 J Zyl. 5-8</p>	<p><b>N92990-00</b> 036 109 675 (16x)</p> <p><b>P76662-00</b> 036 109 675</p>	32x	<p><b>X59471-01 O</b> 057 129 717 H</p> <p><b>X59472-01 U</b> 057 129 717 G</p>	2x	<p><b>X82515-01</b> 057 253 039 D</p> <p><b>X82516-01</b> 059 253 039 E</p>	2x	<p><b>70-31414-10</b></p>	<p><b>P77765-01 K</b> ← 057 103 051 55x70x8 A SL RD FPM</p> <p><b>P77766-01 K</b> → 059 103 051 K 85x105x8 A SL LD FPM</p> <p><b>P93221-01 N</b> 028 103 086 C 32x47x10 A SL LD FPM</p>



AUDI												
Ltr.												
5,2 BSM BXA	320-331 kW (435-450 PS) A6 S6 A8 S8	03/06-08/11										
			<p><b>H80750-00</b> 07L 103 383 N MLS Zyl. 6 - 10</p> <p><b>H80751-00</b> 07L 103 383 P MLS Zyl. 1 - 5</p>			<p><b>N90298-00</b> 036 109 675 (20x) 2x</p> <p><b>P76662-00</b> 036 109 675 40x</p>				<p><b>70-31414-10</b></p>	<p><b>P77444-01 K ←</b> 079 103 051 G 55x72x8 A SL RD FPM <b>P77362-01 K →</b> 079 103 051 F 85x105x8,8 A SL LD PTFE ACM</p>	
6,0 BHT BSB BTE	331 kW (450 PS) A8 W12	12/03-07/10	<p><b>H80732-00</b> 07C 103 148 T MLS Zyl. 1 - 6</p> <p><b>H80733-00</b> 07C 103 149 Q MLS Zyl. 7 - 12</p>	<p><b>T80732-00</b> 07D 103 384 A (14x) +07D 103 385 A (7x)</p>	<p>2x <b>X83346-01</b> 07C 103 484 C Zyl. 7-12</p> <p><b>X83347-01</b> 07C 103 483 C Zyl. 1-6</p>	<p><b>N92830-00</b> 036 109 675 (24x) 2x</p> <p><b>P76662-00</b> 036 109 675 48x</p>	<p>2x <b>X89279-01</b> 07C 133 238 H</p>	<p><b>X81983-01</b> 07C 253 039 D 4x</p>	<p><b>70-31414-10</b></p>	<p><b>P77442-01 K ←</b> 06C 103 085 42x55x7 AB SL RD PTFE ACM <b>P77354-01 K →</b> 021 103 051 C 85x105x11 A SL LD PTFE ACM</p>		

AUDI												
Ltr.												
6,0 CCGA	368 kW (500 PS)	Q7 TDI	09/08-05/14	<p><b>H01423-00</b> 05A 103 383 BF 84 Ø 1,1 mm 1 </p> <p>MLS Zyl. 7-12</p> <p><b>H11423-10</b> 05A 103 383 BG 84 Ø 1,15 mm 2 </p> <p>MLS Zyl. 7-12</p> <p><b>H21423-20</b> 05A 103 383 BH 84 Ø 1,2 mm 3 </p> <p>MLS Zyl. 7-12</p> <p><b>H01424-00</b> 05A 103 383 BJ 84 Ø 1,1 mm 1 </p> <p>MLS Zyl. 1-6</p> <p><b>H11424-10</b> 05A 103 383 BK 84 Ø 1,15 mm 2 </p> <p>MLS Zyl. 1-6</p> <p><b>H21424-20</b> 05A 103 383 BL 84 Ø 1,2 mm 3 </p> <p>MLS Zyl. 1-6</p>	<p><b>X83351-01</b> 05A 103 483 A Zyl. 7-12</p> <p><b>X83352-01</b> 05A 103 484 A Zyl. 1-6</p>	<p><b>N92830-00</b> 036 109 675 (24x)</p> <p><b>P76662-00</b> 24x 036 109 675</p>			<p><b>X82342-01</b> 2x 06A 253 039 D</p>	<p><b>70-31414-10</b></p>	<p><b>P77441-01 K</b> ← 079 103 051 D 55x70x8 ASL RD PTFE</p>	