

CITROEN																					
0,4 A79/0 (AYA)	13 kW (18 PS)	DYANE 4	08/67-03/68	A30034-00 ¹² ¹⁴ ZC900026U S30034-00 ¹² ¹³ ZC9000266U						X01457-01 A123-3 NBR	2x	N91020-00 AYA124-63 P76531-00 0249.48 P76539-00 0956.01	2x				X00774-01 AM141-2A	4x	X01458-01 Kork		P76057-01 K ← 30x42x8 WD MVQ P76178-11 K → 48x65x10 A NBR
0,4 A79/1 (AYA2)	17 kW (23 PS)	DYANE 4 2 CV 4	04/68-12/75	A30746-00 ¹² ¹⁴ 5463048G S30746-00 ¹² ¹³ 0197.51 D30746-00 ¹²						X01142-01 75 516 398 NBR	2x	N91020-00 AYA124-63 P76531-00 0249.48 P76539-00 0956.01	2x	X00765-01 AM141-2D	2x		X00766-01 75505394	2x			P76057-01 K ← 30x42x8 WD MVQ P76223-01 K → 56x69x10 LD ACM
0,6 A06/635 M28 (AM2) M28/1 (AK2) M4 (AM)	18-24 kW (24-33 PS)	ACADIANE 6 AMI 6 AMI 8 DYANE 6 MEHARI 2 CV 6	01/63-10/88	A30746-00 ¹² ¹⁴ 5463048G S30746-00 ¹² ¹³ 0197.51 D30746-00 ¹²						X01142-01 75 516 398 NBR	2x	N91020-00 AYA124-63 P76531-00 0249.48 P76539-00 0956.01	2x	X00765-01 AM141-2D	2x		X00766-01 75505394	2x			P76057-01 K ← 30x42x8 WD MVQ P76223-01 K → 56x69x10 LD ACM
0,6 V06 630	25-26 kW (34-35 PS)	LNA VISA	09/78-06/88	S30998-00 ¹² ¹³ 95539522 D30998-00 ¹²						X01142-01 75 516 398 NBR	2x	N91020-00 AYA124-63 P76531-00 0249.48 P76539-00 0956.01	2x	X00765-01 AM141-2D	2x		X00766-01 75505394	2x			P76057-01 K ← 30x42x8 WD MVQ P76211-01 K → 26126779 57,5x70x10 LD FPM P76002-01 N 75420105 12x18x4 NBR
0,6 V06 644 V06/665	24-26 kW (33-35 PS)	LNA VISA	09/78-03/91	S30307-00 ¹² ¹³ 95552708						X01142-01 75 516 398 NBR	2x	N91020-00 AYA124-63 P76531-00 0249.48 P76539-00 0956.01	2x	X00765-01 AM141-2D	2x		X00766-01 75505394	2x			P76099-11 K ← 0236.14 35x50x8 A SL WD FPM P76211-01 N 26126779 57,5x70x10 LD FPM
0,7 V06 644	25 kW (34 PS)	AXEL	10/81-03/91	S30307-00 ¹² ¹³ 95552708						X01142-01 75 516 398 NBR	2x	N91020-00 AYA124-63 P76531-00 0249.48 P76539-00 0956.01	2x	X00765-01 AM141-2D	2x		X00766-01 75505394	2x			P76099-11 K ← 0236.14 35x50x8 A SL WD FPM P76211-01 N 26126779 57,5x70x10 LD FPM























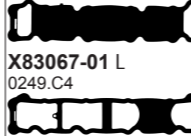



















CITROEN														
Ltr.														
1,0 CDY (TU9M) CDZ (TU9M) C1A C3A TU9	30-37 kW (41-50 PS)	AX 10 C15 SAXO	10/84-06/03	S31113-00 ⑫ ⑬ 95619476 D31113-00 ⑫ 0197.H8 +0209.89 B31062-00 ⑬ ⑮ R30712-00 ③ 7701348178 (x4)	H07953-00 0209.89 74,3 Ø 1,3 mm H17953-10 74,3 Ø 1,5 mm 	T01004-00 0204.83 (10x) 	X06304-01 0249.54 	N91190-00 0956.19 (8x) P76532-00 0956.19 8x 	X56780-01 2x 	X06306-01 0349.A6 2x X06310-01 ⚠ 1709.10 	X54035-01 ⑮ 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM		
1,0 G10 G10/612	40 kW (54 PS)	AMI 10 GS	09/70-12/77	S30460-00 ⑫ ⑬ 75518008 D30460-00 ⑫ 75518008 			X01270-01 5491244 2x X01271-01 2x GX0127401A NBR 	N91500-00 0249.48 (4x) +0956.19 (4x) P76531-00 0249.48 4x P76539-00 0956.01 4x	X01274-01 75491223 4x 	X01273-01 75491350 4x 		P76057-01 K ← 30x42x8 WD MVQ P76250-01 K → 7903087093 57,5x120x10 LD		
1,0 XV8	33 kW (45 PS)	C15 VISA	09/84-12/97	S31053-00 ⑫ ⑬ 95586978+91503885 S31586-00 ⑫ ⑬ 95586978+97531974 D31053-00 ⑫ 0197.75 D31586-00 ⑫ 95586979+97531974 B31053-00 ⑬ 0197.76 R30712-00 ③ 7701348178 (x4)	H00687-00 0209.G8 76 Ø 1,2 mm 16 mm H10687-10 0203.23 76,3 Ø 1,4 mm 16 mm H02370-00 0209.A6 76 Ø 1,2 mm 14 mm H12370-10 0209.53 76,3 Ø 1,4 mm 14 mm 		X07128-01 0249.39 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x 	X07565-01 0348.54 8x 	X07126-01 0349.16 X81933-01 ⚠ 1710.41 	X07129-01 0304.46 	P76099-11 K ← 0236.14 35x50x8 A SL WD FPM P76353-01 K → 0514.74 85x105x8 A SL LD FPM		
1,0 1KR-FE	50-51 kW (68-69 PS)	C1	06/05→	S36775-00 ⑫ ⑬ 0197.AF D36775-00 ⑫ 0197.AG	H80621-00 0209.EC 72 Ø 0,5 mm MLS H80621-10 72 Ø 0,8 mm MLS 	T80621-00 6822.JC (8x) 	X83080-01 0349.C9 NBR 	N92658-00 0956.54 (12x)	X89098-01 0348.S4 	X81894-01 0349.L1 	70-31414-10 	P77413-01 K ← 6822.RC 38x50x6 A SL RD NBR P77436-01 K → 6822.X0 74x89x8,5 A SL LD MVQ		

CITROEN												
Ltr.												
1,0 108C	33 kW (45 PS) LNA VISA	07/84-06/88	S30652-00 (12) (13) 95551299 →11/85 S31579-00 (12) (13) 12/85→ D30652-00 (12) →11/85 D31579-00 (12) 0197.74 12/85→ B31053-00 (13) 0197.76 12/85→ R30652-00 (3) 7910003960 R30712-00 (3) 7701348178 (x4)	H07125-00 74,3 Ø 1,2 mm 16 mm →11/85 H17125-10 020322 74,3 Ø 1,4 mm 16 mm →11/85 H02371-00 0209.46 74,3 Ø 1,2 mm 14 mm 12/85→ H12371-10 0209.52 74,3 Ø 1,4 mm 14 mm 12/85→ 	X07128-01 0249.39 	N90300-00 0249.48 (8x) P76531-00 0249.48	X07565-01 0348.54 8x 	X07126-01 0349.16 	X07129-01 0304.46 	P76099-11 K ← 0236.14 35x50x8 A SL WD FPM P76321-01 K → 0514.14 78x100x10 A SL LD MVQ P76003-01 N 0526.06 14x19x4,5 NBR		
1,1 E1A	35 kW (48 PS) C15	10/84-12/96	S30872-00 (12) (13) 16837800 D30872-00 (12) 0017476000	H05910-00 0013166700 76,7 Ø H15910-10 0209.28 76,7 Ø 1,8 mm 	X05764-01 0249.53 Kork 	N90300-00 0249.48 (8x) P76531-00 0249.48	X07198-01 0348.80 8x 	X05769-01 0349.E2 	X05920-01 0304.32 Kork X05923-01 0012853400 	P76119-01 K ← 00167744200 40x58x8 RD P76310-01 K → 0013195100 71x88x8 LD		
1,1 G11/631	40-42 kW (54-57 PS) AXEL 11 GS	09/77-03/91	S30460-00 (12) (13) 75518008 D30460-00 (12) 75518008 	X01270-01 5491244 X01271-01 GX0127401A NBR 	2x N91500-00 0249.48 (4x) +0956.19 (4x) P76531-00 0249.48 4x P76539-00 0956.01 4x	X01274-01 75491223 4x 	X01273-01 75491350 4x 	P76057-01 K ← 30x42x8 WD MVQ P76250-01 K → 7903087093 57,5x120x10 LD				
1,1 HAZ (TU1CP) HDZ (TU1M+) (54-60 PS) H1A H1B	40-44 kW (54-60 PS) AX 11 BERLINGO BX 11 C15 SAXO ZX	09/86→	S31062-00 (12) (13) (51) 95619476+97520616 D31062-00 (12) (51) 0197.A7 B31062-00 (13) (51) R30712-00 (3) 7701348178 (x4)	H01004-10 (51) 0209.CJ 76,3 Ø 1,3 mm H11004-20 (51) 0209.CK 76,3 Ø 1,5 mm 	T01004-00 0204.83 (10x) 	X06304-01 0249.54 	N91190-00 0956.19 (8x) P76532-00 0956.19	X56780-01 8x 	X06306-01 0349.A6 X06310-01 (A) 1709.10 	X54035-01 (51) 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 ARD FPM	

CITROEN													
Ltr.													
1,1 HDZ (TU1M+) 40 kW (54 PS)	SAXO	05/96-09/03	S31113-00 ¹² ¹³ 95619476 D31113-00 ¹² 0197.H8 +0209.89 B31062-00 ¹³ ⁵¹ R30712-00 ³ 7701348178 (x4)	H07953-00 0209.89 74,3 Ø 1,3 mm H17953-10 74,3 Ø 1,5 mm 	T01004-00 0204.83 (10x) 	X06304-01 0249.54 	N91190-00 0956.19 (8x) P76532-00 0956.19 8x 	X56780-01 2x 	X06306-01 0349.A6 2x X06310-01 ¹ 1709.10 	X54035-01 ⁵¹ 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM		
1,1 HFX (TU1JP) 44 kW (60 PS)	BERLINGO C2 C3 SAXO	05/96→	D36677-00 ¹² B37002-00 ¹³	H80370-00 0209.Y0 73,5 Ø 1,25 mm 	T01004-00 0204.83 (10x) 	X06304-01 0249.54 	N91190-00 0956.19 (8x) P76532-00 0956.19 8x 	X87172-01 0342.E0 4x 	X82381-01 ^X 0349.J6 X82382-01 0349.K1 X81500-01 ¹ 1709.25 	X54035-01 ⁵¹ 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM		
1,1 109K 109/5 109/5F	35-42 kW (48-57 PS) C15 VISA 11	09/78-12/96	S31588-00 ¹² ¹³ 95551299 →12/85 S31589-00 ¹² ¹³ 0198.59 01/86→ D31588-00 ¹² 0197.74 →12/85 D31589-00 ¹² 0197.75 +0209.A6 01/86→ B31588-00 0197.76 R30712-00 ³ 7701348178 (x4)	H00687-00 0209.G8 76 Ø 1,2 mm 16 mm →12/85 H10687-10 0203.23 76,3 Ø 1,4 mm 16 mm →12/85 H02370-00 0209.A6 76 Ø 1,2 mm 14 mm 01/86→ H12370-10 0209.53 76,3 Ø 1,4 mm 14 mm 01/86→ 	X07128-01 0249.39 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x 	X07565-01 0348.54 8x 	X07126-01 0349.16 	X07129-01 0304.46 	P76099-11 K ← 0236.14 35x50x8 A SL WD FPM P76321-01 K → 0514.14 78x100x10 A SL LD MVQ P76003-01 N 0526.06 14x19x4,5 NBR			
1,1 109/5E	37 kW (50 PS) LNA	07/82-04/85	S31588-00 ¹² ¹³ 95551299 D31588-00 ¹² 0197.74 B31588-00 0197.76 R30712-00 ³ 7701348178 (x4)	H00687-00 0209.G8 76 Ø 1,2 mm 16 mm H10687-10 0203.23 76,3 Ø 1,4 mm 16 mm 	X07128-01 0249.39 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x 	X07565-01 0348.54 8x 	X07126-01 0349.16 	X07129-01 0304.46 	P76099-11 K ← 0236.14 35x50x8 A SL WD FPM P76321-01 K → 0514.14 78x100x10 A SL LD MVQ P76003-01 N 0526.06 14x19x4,5 NBR			

CITROEN												
Ltr.												
1,2 G12/611 G12/612 G12/619	43-46 kW (58-63 PS) GS GS X 2	04/73-07/79	S30460-00 ⁽¹²⁾ ⁽¹³⁾ 75518008 D30460-00 ⁽¹²⁾ 75518008 			X01270-01 5491244 X01271-01 GX0127401A NBR 	2x N91500-00 0249.48 (4x) +0956.19 (4x) P76531-00 0249.48 4x P76539-00 0956.01 4x	X01274-01 75491223 4x	X01273-01 75491350 4x		P76057-01 K ← 30x42x8 WD MVQ P76250-01 K → 7903087093 57,5x120x10 LD	
1,2 129/5	47 kW (64 PS) VISA Super X	07/80-06/82	S31588-00 ⁽¹²⁾ ⁽¹³⁾ 95551299 D31588-00 ⁽¹²⁾ 0197.74 B31588-00 0197.76 R30712-00 ⁽³⁾ 7701348178 (x4)	H00687-00 0209.G8 76 Ø 1,2 mm 16 mm H10687-10 0203.23 76,3 Ø 1,4 mm 16 mm H02370-00 0209.A6 76 Ø 1,2 mm 14 mm H12370-10 0209.53 76,3 Ø 1,4 mm 14 mm 	X07128-01 0249.39 	N90300-00 0249.48 (8x) P76531-00 0249.48	X07565-01 0348.54 8x	X07126-01 0349.16 	X07129-01 0304.46 	P76099-11 K ← 0236.14 35x50x8 A SL WD FPM P76321-01 K → 0514.14 78x100x10 A SL LD MVQ P76003-01 N 0526.06 14x19x4,5 NBR		
1,3 G1A	47 kW (64 PS) C15	07/87-05/88	S30741-00 ⁽¹²⁾ ⁽¹³⁾ 0017477200 D30741-00 ⁽¹²⁾ 0016806800	H06900-00 0209.J0 78,5 Ø 1,2 mm 	X05764-01 0249.53 Kork 	N90300-00 0249.48 (8x) P76531-00 0249.48	X05917-01 0055204500 8x X07198-01 0348.80 	X05769-01 0349.E2 X07077-01 ^(A) 0016175200 	X05920-01 0304.32 Kork X05923-01 0012853400 	P76119-01 K ← 00167744200 40x58x8 RD P76310-01 K → 0013195100 71x88x8 LD		
1,3 G13/625 G13/646	48 kW (65 PS) GS	09/79-07/86	S30460-00 ⁽¹²⁾ ⁽¹³⁾ 75518008 D30460-00 ⁽¹²⁾ 75518008 		X01270-01 5491244 X01271-01 GX0127401A NBR 	2x N91500-00 0249.48 (4x) +0956.19 (4x) P76531-00 0249.48 4x P76539-00 0956.01 4x	X01274-01 75491223 4x	X01273-01 75491350 4x		P76057-01 K ← 30x42x8 WD MVQ P76250-01 K → 7903087093 57,5x120x10 LD		

CITROEN															
Ltr.															
1,3 M4A	70 kW (95 PS)	AX 13 Sport	04/87-12/88	S31437-00 ⁽¹²⁾ ⁽¹³⁾ D31437-00 ⁽¹²⁾ B31062-00 ⁽¹³⁾ ⁽⁵¹⁾ R30712-00 ⁽³⁾ 7701348178 (x4)	H01004-10 ⁽⁵¹⁾ 0209.CJ 76,3 Ø 1,3 mm H11004-20 ⁽⁵¹⁾ 0209.CK 76,3 Ø 1,5 mm	T01004-00 0204.83 (10x)	X06304-01 0249.54	N90300-00 0249.48 (8x) P76531-00 0249.48	8x	X06306-01 0349.A6 X06310-01 ^(A) 1709.10	2x	X54035-01 ⁽⁵¹⁾	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM		
1,4 DV4D 8HX (DV4TD)	40-50 kW (54-68 PS)	C2 HDI C3 HDI XSARA HDi XSARA HDI	02/02→	S36724-00 ⁽¹²⁾ ⁽¹³⁾ D36724-00 ⁽¹²⁾ B36724-00 ⁽¹³⁾	H08129-00 0209.AC 1,2 mm 2 MLS H08129-10 0209.AE 1,3 mm 3 MLS H08129-20 0209.AF 1,35 mm 1 MLS H18129-30 0209.AG 1,4 mm 4 MLS H18129-40 0209.AH 74,7 Ø 1,45 mm 5 MLS	T08130-00 0204.A2 (10x)	V38516-00 0249.F8 +0348.T8 (4x) +0348.S8 (2x) X83035-01 0249.F8 NBR	N92983-00 0956.50 (8x) P76779-00 0956.50	8x	W88317-01 0348.R2	4x	X81696-01 0349.J8	70-31414-10	P77361-01 K ← 0127.42 40x55x6,4 A SL RD PTFE ACM P77362-01 K → 0127.43 85x105x8,8 A SL LD PTFE ACM P77668-01 N 0807.30 27x47x7 A SL RD PTFE ACM	
1,4 KAY (TU3CP) KAZ KDX (TU3M/Z) KDY (TU3FM) KDY (TU3M) K1B K1F K1G K1H (TU3A) K2A K2B K2D K3A	40-62 kW (54-85 PS)	AX AX 14 BX 14 C15 ZX	04/83→	S31062-00 ⁽¹²⁾ ⁽¹³⁾ ⁽⁵¹⁾ 95619476+97520616 S31600-00 ⁽¹²⁾ ⁽¹³⁾ ⁽⁵³⁾ 0197.J1+0209.A9 D31062-00 ⁽¹²⁾ ⁽⁵¹⁾ 0197.A7 D31600-00 ⁽¹²⁾ ⁽⁵³⁾ 0197.J0 +0209.A9 B31062-00 ⁽¹³⁾ ⁽⁵¹⁾ B31600-00 ⁽¹³⁾ R30712-00 ⁽³⁾ 7701348178 (x4)	H01004-10 ⁽⁵¹⁾ 0209.CJ 76,3 Ø 1,3 mm H11004-20 ⁽⁵¹⁾ 0209.CK 76,3 Ø 1,5 mm	T01004-00 0204.83 (10x)	X06304-01 0249.54	N91190-00 0956.19 (8x) P76532-00 0956.19	8x	X56780-01	2x	X06306-01 0349.A6 X06310-01 ^(A) 1709.10	2x	X54035-01 ⁽⁵¹⁾	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM

CITROEN												
Ltr. 												
1,4 KDZ (TU3M/Z) 55-59 kW (75-80 PS)	AX GT AX 14 BX 14 ZX	04/87-06/97	S31062-00 ⁽¹²⁾ ⁽¹³⁾ ⁽⁵¹⁾ 95619476+97520616 D31062-00 ⁽¹²⁾ ⁽⁵¹⁾ 0197.A7 B31062-00 ⁽¹³⁾ ⁽⁵¹⁾ R30712-00 ⁽³⁾ 7701348178 (x4)	H01004-10 ⁽⁵¹⁾ 0209.CJ 76,3 Ø 1,3 mm H11004-20 ⁽⁵¹⁾ 0209.CK 76,3 Ø 1,5 mm 	T01004-00 0204.83 (10x) 	X06304-01 0249.54 	N91190-00 0956.19 (8x) P76532-00 0956.19 8x 	X56780-01 2x 	X06306-01 0349.A6 2x X06310-01 ^(A) 1709.10 	X54035-01 ⁽⁵¹⁾ 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
1,4 KFV (ET3J4) 65 kW (88-90 PS)	C2 C3 16V C4 16V	12/03→	D37222-00 ⁽¹²⁾ B37222-00 ⁽¹³⁾	H80612-00 0209.FL 76 Ø 1,4 mm 	T80612-00 0204.A5 (10x) 	X83066-01 R 0249.C5 X83067-01 L 0249.C4 	N93130-00 0956.52 (16x) P76841-00 0956.52 16x 	M36836-00 0348.S1 	X81664-01 0349.L3 X82404-01 ^(A) 1709.29 	70-31414-10 	P77669-01 K ← 0514.A3 42x66x7 A SL RD P76353-01 K → 0514.74 85x105x8 A SL LD FPM P77492-01 N 0807.32 36x50x8 A SL RD PTFE ACM P77593-01 N 0807.33 24x50x8 A SL RD	
1,4 KFV (TU3JP) 48-60 kW (65-82 PS) KFW (TU3JP) KFX (TU3JP)	BERLINGO C2 C3 C3 Pluriel SAXO VTS XSARA ZX	03/91→	S32984-00 ⁽¹²⁾ ⁽¹³⁾ D32984-00 ⁽¹²⁾ 0197.H8+0209.CJ B31600-00 ⁽¹³⁾  R30712-00 ⁽³⁾ 7701348178 (x4)	H01004-10 ⁽⁵¹⁾ 0209.CJ 76,3 Ø 1,3 mm H11004-20 ⁽⁵¹⁾ 0209.CK 76,3 Ø 1,5 mm 	T01004-00 0204.83 (10x) 	X06304-01 0249.54 	N91190-00 0956.19 (8x) P76532-00 0956.19 8x 	X87172-01 0342.E0 4x 	X06306-01 0349.A6 2x X82381-01 ^(X) 0349.J6 X82382-01 ^(X) 0349.K1 X06310-01 ^(A) 1709.10 	X54035-01 ⁽⁵¹⁾ 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
1,4 KFY (TU3FJ2) 66-74 kW (90-100 PS)	AX 14 GTI	06/91-12/96	D37003-00 ⁽¹²⁾ 0197.J0 +0209.D6 R30712-00 ⁽³⁾ 7701348178 (x4)	H80549-00 0209.D6 77 Ø 1,2 mm H80549-10 0209.C1 77 Ø 1,4 mm 	T01004-00 0204.83 (10x) 	X06304-01 0249.54 	N91190-00 0956.19 (8x) P76532-00 0956.19 8x 	X56780-01 2x 	X06306-01 0349.A6 2x X06310-01 ^(A) 1709.10 	70-31414-10 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	

CITROEN												
Ltr.												
1,4 K9A (TUD3) K9Y (TUD3Y)	37-38 kW (50-52 PS)	AX 14 D ZX D	09/88-12/97	S31055-00 ¹² ¹³ 0197.K2 D31055-00 ¹² 0197.K3 B31055-00 ¹³ R30712-00 ³ 7701348178 (x4)	H03751-00 0209.E9 76,3 Ø H80573-00 0209.N4 MLS 	T03751-00 0204.84 (10x) 	X05398-01 0249.76 	N90300-00 0249.48 (8x) P76532-00 0956.19 8x		X05443-01 0349.E4 X05444-01 ¹ 1710.58 	X54035-01 ⁵¹ 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM
1,4 150A 150B (XY8) 150C 150D 150D (XY7) 150F	44-58 kW (60-79 PS)	BX BX 14 C15 VISA 14 VISA 14 GT	03/82→	S31053-00 ¹² ¹³ 95586978+91503885 S31586-00 ¹² ¹³ 95586978+97531974 D31053-00 ¹² 0197.75 D31586-00 ¹² 95586979+97531974 B31053-00 ¹³ 0197.76 R30712-00 ³ 7701348178 (x4)	H00687-00 0209.G8 76 Ø 1,2 mm 16 mm H10687-10 0203.23 76,3 Ø 1,4 mm 16 mm H02370-00 0209.A6 76 Ø 1,2 mm 14 mm H12370-10 0209.53 76,3 Ø 1,4 mm 14 mm 		X07128-01 0249.39 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x 	X07565-01 0348.54 	X07126-01 0349.16 X81933-01 ¹ 1710.41 	X07129-01 0304.46 	P76099-11 K ← 0236.14 35x50x8 A SL WD FPM P76321-01 K → 0514.14 78x100x10 A SL LD MVQ P76003-01 N 0526.06 14x19x4,5 NBR
1,4 8FS (EP3)	70 kW (95 PS)	C3	02/09→	D40616-00 ¹² ¹⁹ D40616-01 ¹² 	H40616-00 0209.EW 78 Ø 0,9 mm MLS H40616-10 ^X 78 Ø 1,2 mm MLS 	T40616-00 0204.C1 	V38326-00 0249.F4 	N93158-00 0956.60 P93158-00 16x 	M59582-00 0348.T4 (4x) 	X59642-01 1723.CH 	70-31414-10 	P77789-01 K ← 0514.C8 61x75x8 A SL RD P77670-01 K → 0514.A2 85x105x8 A SL LD

CITROEN												
Ltr.												
1,4 8HR (DV4C) 50 kW (68 PS) C3 HDI DS3 HDI		11/09→		<p>H40604-00 0209.HH 74,7 Ø 1,25 mm 4 </p> <p>H40604-10 0209.HJ 74,7 Ø 1,3 mm 5 </p> <p>H40604-20 0209.HK 74,7 Ø 1,35 mm 3 </p> <p>H40604-30 0209.HL 74,7 Ø 1,4 mm 6 </p> <p>H40604-40 0209.HN 74,7 Ø 1,45 mm 7 </p>	<p>T40595-00 0205.57 (10x)</p>	<p>X83409-01 0249.G2</p>	<p>N92983-00 0956.50 (8x)</p> <p>P76779-00 0956.50</p> <p>8x</p>		<p>X59534-01 0349.N9</p>	<p>70-31414-10</p>	<p>P77361-01 K ← 0127.42 40x55x6,4 A SL RD PTFE ACM</p> <p>P77362-01 K → 0127.43 85x105x8,8 A SL LD PTFE ACM</p> <p>P77668-01 N 0807.30 27x47x7 A SL RD PTFE ACM</p>	
1,4 8HS (DV4TED)40-50 kW (54-68 PS) 8HT (DV4TD)	C1 HDI NEMO HDI	06/05→	<p>S36724-01 ¹² ¹³ 0197.AV +0956.50 (8x)</p> <p>D36724-00 ¹²</p>	<p>H08129-00 0209.AC 1,2 mm 2 </p> <p>H08129-10 0209.AE 1,3 mm 3 </p> <p>H08129-20 0209.AF 1,35 mm 1 </p> <p>H18129-30 0209.AG 1,4 mm 4 </p> <p>H18129-40 0209.AH 74,7 Ø 1,45 mm 5 </p>	<p>T08130-00 0204.A2 (10x)</p>	<p>V38516-00 0249.F8 +0348.T8 (4x) +0348.S8 (2x)</p> <p>X83035-01 0249.F8 NBR</p>	<p>N92983-00 0956.50 (8x)</p> <p>P76779-00 0956.50</p> <p>8x</p>		<p>X81696-01 0349.J8</p>	<p>70-31414-10</p>	<p>P77361-01 K ← 0127.42 40x55x6,4 A SL RD PTFE ACM</p> <p>P77362-01 K → 0127.43 85x105x8,8 A SL LD PTFE ACM</p> <p>P77668-01 N 0807.30 27x47x7 A SL RD PTFE ACM</p>	

CITROEN												
Ltr.												
1,4 8HY (DV4TED4) 66 kW (90 PS)	C3 HDI 16V	02/02→	S36730-00 ¹² ¹³ D36730-00 ¹² B36724-00 ¹³	H40137-00 0209.AJ 74,7 Ø 1,25 mm MLS H40137-10 0209.AK 74,7 Ø 1,3 mm MLS H40137-20 0209.AL 74,7 Ø 1,35 mm MLS H40137-30 0209.AN 74,7 Ø 1,4 mm MLS H40137-40 0209.AP 74,7 Ø 1,45 mm MLS 	T08130-00 0204.A2 (10x) 	X83038-01 0249.C2 NBR 	N93118-00 0956.51 (16x) P76780-00 0956.51 16x 	W88321-01 0348.R4 4x W88322-01 0348.R5 4x 	X81696-01 0349.J8 	70-31414-10 	P77361-01 K ← 0127.42 40x55x6,4 A SL RD PTFE ACM P77362-01 K → 0127.43 85x105x8,8 A SL LD PTFE ACM P77668-01 N 0807.30 27x47x7 A SL RD PTFE ACM	
1,5 VJY (TUD5) 40-43 kW (54-58 PS)	AX 15 D SAXO D XSARA D	08/94-09/03	S31599-00 ¹² ¹³ D31599-00 ¹² 0197.V1 +0209.T8 B31599-00 ¹³ 0197.V0 R30712-00 ³ 7701348178 (x4)	H80263-00 0209.T8 78 Ø MLS 	T50321-00 0204.85 (10x) 	X53099-01 0249.93 	N91190-00 0956.19 (8x) P76532-00 0956.19 8x 	X05443-01 0349.E4 X05444-01 ¹³ 1710.58 	70-31414-10 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM		
1,6 BAY (XU5CP) 53-70 kW (72-95 PS)	BX BX 16 ZX	01/87-10/97	S30559-00 ¹² ¹³ 0197.89 D30559-00 ¹² 0197.H6 +0209.E1 B30559-00 ¹³ R31124-00 ³	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm 	T01025-00 0204.57 (10x) 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x 	X07803-01 X07804-01 	X01022-01 0349.70 X03013-01 ¹³ 1721.01 	X04848-01 2x 0127.05 NBR X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
1,6 BFZ (XU5JP) 65-66 kW (88-90 PS)	XANTIA ZX	03/91-03/01	S31580-00 ¹² ¹³ D31580-00 ¹² 0197.G4 B31580-00 ¹³ R31124-00 ³	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm 	T01025-00 0204.57 (10x) Mot.→07448 T11025-00 0204.89 (10x) Mot.07449→ 	X53101-01 0249.71 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x 	X56171-01 2x 0348.F6 X56170-01 ¹⁰ 2x 0348.E6 	X52670-01 ¹³ 1723.63 	X04848-01 2x 0127.05 NBR X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	

CITROEN												
Ltr.			1									
1,6 B6D B6E XU52C 171A 171B 171C 171D 180Z	64-85 kW (87-116 PS) BX BX 16 VISA 16 GTI	10/82-12/94	S30559-00 ¹² ¹³ 0197.89 D30559-00 ¹² 0197.H6 +0209.E1 B30559-00 ¹³ R31124-00 ³	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm 	T11025-00 0204.89 (10x) →03/87 T01025-00 0204.57 (10x) 04/87→ 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x	X07803-01 X07804-01 	X01022-01 0349.70 X03013-01 ¹ 1721.01 	4x X04848-01 0127.05 NBR X07793-01 0304.34 	2x P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
1,6 DV6B 9HT (DV6BTED4) 9HT (DV6BUTED4) 9HX (DV6ATED4) 9HY (DV6TED4) 9HZ (DV6TED4)	55-80 kW (75-109 PS) BERLINGO HDI BERLINGO HDI 75 BERLINGO HDI 90 C2 HDI C3 HDI C3 HDI 16V C4 C4 HDI C4 HDI 110 FAP C4 HDI 90 C5 HDI XSARA PICASSO HDI	05/04→	S36730-00 ¹² ¹³ D36730-00 ¹² B36724-00 ¹³	H08130-00 0209.CA 76 Ø 1,25 mm 4 MLS H08130-10 0209.CC 76 Ø 1,3 mm 5 MLS H08130-20 0209.CE 76 Ø 1,35 mm 3 MLS H18130-30 0209.CF 76 Ø 1,4 mm 6 MLS H18130-40 0209.CG 76 Ø 1,45 mm 7 MLS 	T08130-00 0204.A2 (10x) 	X83038-01 0249.C2 NBR 	N93118-00 0956.51 (16x) P76780-00 0956.51 16x	W88321-01 0348.R4 W88322-01 0348.R5 	4x X81696-01 0349.J8 	70-31414-10 	P77361-01 K ← 0127.42 40x55x6,4 A SL RD PTFE ACM P77362-01 K → 0127.43 85x105x8,8 A SL LD PTFE ACM P77668-01 N 0807.30 27x47x7 A SL RD PTFE ACM	
1,6 NFR (TU5JP4B)	66 kW (90 PS) BERLINGO	04/08→	D36693-00 ¹² B36693-00 ¹³	H80497-10 98 045 482 80 79,8 Ø 0,6 mm MLS 	T04220-00 0204.81 (10x) 	X83028-01 0249.A9 NBR 	2x N92004-00 0956.40 (16x) P76809-00 0956.40 16x	M74443-00 0348.Q5 	X81664-01 0349.L3 X81500-01 ¹ 1709.25 	X54807-01 0304.55 NBR 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P77141-01 N 0807.24 38x50x6 A SL RD FPM 2x	
1,6 NFS (TU5JP4S)	90 kW (122 PS) C2 VTS	01/05→	D38024-00 ¹² B38100-00 ¹³	H80497-10 98 045 482 80 79,8 Ø 0,6 mm MLS 	T04220-00 0204.81 (10x) 	X83028-01 0249.A9 NBR Mot.→2336722 X59782-01 ¹ Mot.2336723→ 	2x N92004-00 0956.40 (16x) P76809-00 0956.40 16x	X89345-01 0342.J6 X89880-01 I 0342.J5 	X81664-01 0349.L3 	70-31414-10 	P77669-01 K ← 0514.A3 42x66x7 A SL RD P77670-01 K → 0514.A2 85x105x8 A SL LD P77623-01 N 0807.34 38x50x7 A SL RD 2x	

CITROEN												
1,6 NFT NFV (TU5JP) NFZ (TU5JP)	65-74 kW (88-101 PS)	SAXO SAXO VTL, VTR XSARA XSARA PICASSO	02/96→ 	S31601-00 ¹² ¹³ 0197.J1 D31601-00 ¹² 0197.J0 B31600-00 ¹³ 	H08194-00 0209.F6 79 Ø Mot.→07874 H09196-00 0209.W8 1,38 mm MLS Mot.07875→ H19196-10 0209.W9 79,7 Ø 1,57 mm MLS Mot.07875→ 	T01004-00 0204.83 (10x) 	X06304-01 0249.54 	N91190-00 0956.19 (8x) P76532-00 0956.19	M38099-00 0348.P3 (4x) 8x X86028-01 0348.E5 Mot.→07874 4x X82384-01 0348.P3 Mot.07875→ 4x	X06306-01 2x 0349.A6 X82382-01 0349.K1 X81500-01 1709.25 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P76355-11 K → 85x105x9 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
1,6 NFU (TU5JP4)	80-83 kW (109-113 PS)	BERLINGO BERLINGO 16V C2 C3 C3 Pluriel C3 16V C4 C4 16V XSARA PICASSO XSARA PICASSO 16V XSARA 16V	09/00→	D36693-00 ¹² B36693-00 ¹³	H80497-10 98 045 482 80 79,8 Ø 0,6 mm MLS 	T04220-00 0204.81 (10x) 	X83028-01 2x 0249.A9 NBR Mot.→2336722 X59782-01 Mot.2336723→ 2x	N92004-00 0956.40 (16x) P76809-00 0956.40 16x	M74443-00 0348.Q5 16x	X81664-01 0349.L3 X81500-01 1709.25 	X54807-01 0304.55 NBR 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P77141-01 N 2x 0807.24 38x50x6 A SL RD FPM
1,6 NFX (TU5J4)	80-88 kW (109-120 PS)	SAXO SAXO VTS	02/96-04/04	S32979-00 ¹² ¹³ 0197.F1 D32979-00 ¹² B32979-00 ¹³	H04220-00 0209.Z0 1,4 mm 6 MLS H14220-10 0209.W3 1,57 mm 7 MLS H24220-20 0209.Z1 79,7 Ø 1,77 mm 8 MLS 	T04220-00 0204.81 (10x) 	70-31414-10 	N92004-00 0956.40 (16x) P76809-00 0956.40 16x	X58964-01 4x 0348.L0 16x X59969-01 ¹⁰ 0348.L1 2x	X52322-01 0349.F9 X52323-01 1709.12 	70-31414-10 	P76154-01 K ← 0514.72 42x66x6 A SL RD MVQ P76353-01 K → 0514.74 85x105x8 A SL LD FPM P77141-01 N 2x 0807.24 38x50x6 A SL RD FPM
1,6 1580 SPI 220 A2.000	58 kW (79 PS)	JUMPY	10/95→	S32919-00 ¹² ¹³ D32919-00 ¹² B32919-00 ¹³	H00593-10 0209.P9 87 Ø 	T05082-00 	X01619-01 U X53175-01 0 X53734-01 0249.84 Kork 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x	X51425-01 ⁷ 	X00688-01 0304.49 Gummi 	P76117-01 K ← 40x56x7 A SL RD MVQ P76273-01 K → 64x80x8 A SL LD MVQ P76060-01 N 30x52x7 AB SL RD FPM	


CITROEN													
1.6 180A (XU5J) 76 kW (103 PS)	VISA 16 GTI	01/85-06/86		<p>S30559-00 ¹² ¹³ 0197.89</p> <p>D30559-00 ¹² 0197.H6 +0209.E1</p> <p>B30559-00 ¹³</p> <p>R31124-00 ³</p>	<p>H01025-00 0209.E1 84,3 Ø 1,2 mm</p> <p>H11025-10 0209.L3 84,3 Ø 1,5 mm</p>	<p>T11025-00 0204.89 (10x)</p>	<p>X01021-01 0249.48</p>	<p>N90300-00 0249.48 (8x)</p> <p>P76531-00 0249.48</p>	<p>X07803-01 8x</p> <p>X07804-01</p>	<p>X01022-01 0349.70</p> <p>X03013-01 </p> <p>1721.01</p>	<p>4x X04848-01 0127.05 NBR</p> <p>X07793-01 0304.34</p>	<p>2x P76151-01 K ← 0326.12 42x62x7 A RD FPM</p> <p>P76386-01 K → 0127.28 90x110x7 A SL LD FPM</p> <p>P76133-01 N 0236.21 36x50x7 A RD FPM</p>	
1.6 5FD (EP6DTS) 103-152 kW 5FN (EP6CDT)(140-207 PS)	C4 C4 Grand PICASSO C4 GRAND PICASSO C4 PICASSO C5 DS3 DS3 HDI DS4 DS5	07/08→	<p>D40634-00 ¹² ¹⁹</p> <p>D40634-01 ¹²</p>	<p>H40634-00 0209.ER 78 Ø 0,9 mm MLS</p> <p>H40634-10 </p> <p>0209.HP 78 Ø 1,3 mm MLS</p>	<p>T40616-00 0204.C1</p>	<p>V38327-00 0249.E6 +0249.E7</p>	<p>N93158-00 0956.60</p> <p>P93158-00 16x</p>	<p>M59583-00 0348.S9</p>	<p>X59643-01 1723.AZ</p>	<p>70-31414-10</p>	<p>P77789-01 K ← 0514.C8 61x75x8 A SL RD</p> <p>P77670-01 K → 0514.A2 85x105x8 A SL LD</p>		
1.6 5FS (EP6C) 88 kW 5FW (EP6) (120 PS)	BERLINGO C3 C4 C4 GRAND PICASSO C4 PICASSO C4 VTI C5 DS3 DS4	07/08→	<p>D40616-00 ¹² ¹⁹</p> <p>D40616-01 ¹²</p>	<p>H40616-00 0209.EW 78 Ø 0,9 mm MLS</p> <p>H40616-10 </p> <p>78 Ø 1,2 mm MLS</p>	<p>T40616-00 0204.C1</p>	<p>V38326-00 0249.F4</p>	<p>N93158-00 0956.60</p> <p>P93158-00 16x</p>	<p>M59582-00 0348.T4 (4x)</p>	<p>X59642-01 1723.CH</p>	<p>70-31414-10</p>	<p>P77789-01 K ← 0514.C8 61x75x8 A SL RD</p> <p>P77670-01 K → 0514.A2 85x105x8 A SL LD</p>		
1.6 5FU (EP6CDTX) 147 kW 5FU (EP6DTX) (200 PS) 5FY (EP6CDTX)	DS3 DS4 DS5	02/11→	<p>D40634-02 ¹² ¹⁹</p> <p>D90193-00 ¹²</p> <p>B82514-00 ¹³</p>	<p>H40634-00 0209.ER 78 Ø 0,9 mm MLS</p> <p>H40634-10 </p> <p>0209.HP 78 Ø 1,3 mm MLS</p>	<p>T40616-00 0204.C1</p>	<p>V90180-00 0249.G9</p>	<p>N93158-00 0956.60</p> <p>P93158-00 16x</p>	<p>M59583-00 0348.S9</p>	<p>X59643-01 1723.AZ</p> <p>X90212-01 </p> <p>1709.45</p>	<p>70-31414-10</p>	<p>P77789-01 K ← 0514.C8 61x75x8 A SL RD</p> <p>P77670-01 K → 0514.A2 85x105x8 A SL LD</p>		

CITROEN												
Ltr.												
1,6 9HH (DV6DUM) 9HM (DV6UC) 9HN (DV6ETED4) 9HP (DV6DTED) [NEW]	55-69 kW (75-92 PS) BERLINGO HDI C-ELYSEE HDI C3 C3 Picasso C4 CACTUS HDI C4 GRAND PICASSO HDI C4 HDI C4 PICASSO HDI DS3 DS3 HDI DS4 HDI JUMPY HDI	01/07→	D83409-00 ¹² B38558-00 ¹³	H84837-00 0209.JN 76 Ø 1,25 mm 3 MLS H84837-10 0209.JP 76 Ø 1,3 mm 4 MLS H84837-20 0209.JQ 76 Ø 1,35 mm 2 MLS H84837-30 0209.JR 76 Ø 1,4 mm 5 MLS H84837-40 0209.JS 76 Ø 1,45 mm 6 MLS 	T40595-00 0205.57 (10x) 	X83409-01 0249.G2 	N92983-00 0956.50 (8x) P76779-00 0956.50 8x		X59534-01 0349.N9 	70-31414-10 	P77361-01 K ← 0127.42 40x55x6,4 A SL RD PTFE ACM P77362-01 K → 0127.43 85x105x8,8 A SL LD PTFE ACM P77668-01 N 0807.30 27x47x7 A SL RD PTFE ACM	

CITROEN

Ltr.

1,6 9HL (DV6C) **[NEW]** 82-84 kW (112-114 PS) BERLINGO HDI C4 AIRCROSS HDI C4 Grand PICASSO HDI C5 HDI DS3 HDI DS4 HDI 07/10→

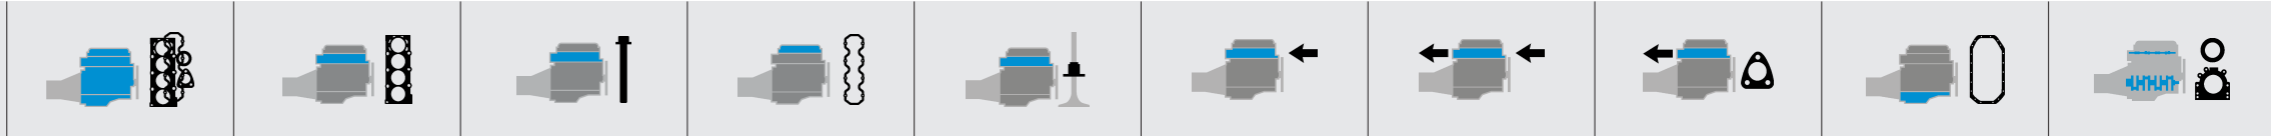

D83409-00 ¹²

B38558-00 ¹³

H84837-00
 0209.JN
 76 Ø
 1,25 mm 3
 MLS
H84837-10
 0209.JP
 76 Ø
 1,3 mm 4
 MLS
H84837-20
 0209.JQ
 76 Ø
 1,35 mm 2
 MLS
H84837-30
 0209.JR
 76 Ø
 1,4 mm 5
 MLS
H84837-40
 0209.JS
 76 Ø
 1,45 mm 6
 MLS

T40595-00
 0205.57 (10x)

X83409-01
 0249.G2

N92983-00
 0956.50 (8x)
P76779-00
 0956.50 8x

X59534-01
 0349.N9

70-31414-10

P77361-01 K ←
 0127.42
 40x55x6,4
 A SL RD PTFE ACM
P77362-01 K →
 0127.43
 85x105x8,8
 A SL LD PTFE ACM
P77668-01 N
 0807.30
 27x47x7
 A SL RD PTFE ACM



CITROEN												
Ltr. 1,6 9HS 66 kW (DV6TED4BU) (90 PS) [NEW]	 BERLINGO HDI	 04/08→	D36730-00 ¹² B36724-00 ¹³	H08130-00 0209.CA 76 Ø 1,25 mm 4 MLS H08130-10 0209.CC 76 Ø 1,3 mm 5 MLS H08130-20 0209.CE 76 Ø 1,35 mm 3 MLS H18130-30 0209.CF 76 Ø 1,4 mm 6 MLS H18130-40 0209.CG 76 Ø 1,45 mm 7 MLS H28130-50 0209.HG 76 Ø 1,5 mm 5 MLS H28130-60 0209.HF 76 Ø 1,55 mm 6 MLS H38130-70 0209.HE 76 Ø 1,6 mm 4 MLS H38130-75 0209.HC 76 Ø 1,65 mm 5 MLS 	T40595-00 0205.57 (10x) 	X83038-01 0249.C2 NBR 	N93118-00 0956.51 (16x) P76780-00 0956.51	16x W88321-01 0348.R4 4x W88322-01 0348.R5 4x		X81696-01 0349.J8 	70-31414-10 	P77361-01 K ← 0127.42 40x55x6,4 A SL RD PTFE ACM P77362-01 K → 0127.43 85x105x8,8 A SL LD PTFE ACM P77668-01 N 0807.30 27x47x7 A SL RD PTFE ACM
1,8 AJZ (XUD7TE) 66 kW A8A (XUD7TE) (90 PS)	BX TRD BX 18 TRD	03/88-12/94	S31587-00 ¹² ¹³ 0197.H5 D31587-00 ¹² B30527-00 ¹³	H02299-00 0209.Q0 1,6 mm 2 H12299-10 0209.G0 82 Ø 1,75 mm 3 	T08280-00 0204.65 (10x) 	X07796-01 0249.91 	N90300-00 0249.48 (8x) P76531-00 0249.48	8x 	X51229-01 ⁷ 0348.89 →12/90 X51239-01 ⁷ 0348.J0 01/91→ 	X04848-01 0127.05 NBR X07793-01 0304.34 	2x P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76099-11 N 0236.14 35x50x8 A SL WD FPM 2x	

CITROEN												
Ltr.												
1,8 A9A (XUD7) 161 (XUD7) 161A (XUD7)	43-44 kW (58-60 PS)	BERLINGO D BX 18 D C15 D VISA 17 D XSARA D ZX D	04/84→	S30527-00 ⑫ ⑬ 0197.H5 D30527-00 ⑫ 0197.H4 +0956.22 (8x) B30527-00 ⑬	H05875-00 0209.S0 1,36 mm 1 H05875-10 0209.S1 1,4 mm 2 H05875-20 0209.S2 1,44 mm 3 H08280-00 0209.F9 1,57 mm 2 H15875-30 0209.S3 1,48 mm 4 H15875-40 0209.S4 82 Ø 1,53 mm 5 H18280-10 1,7 mm 3	T08280-00 0204.65 (10x) 	X07796-01 0249.91 	N90300-00 0249.48 (8x) P76531-00 0249.48	X55498-01 0348.99 2x X55499-01 0348.98 	X07782-01 0349.78 2x X03013-01 1721.01 	X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76099-11 N 0236.14 35x50x8 A SL WD FPM
1,8 LFX (XU7JB)	66 kW (90 PS)	BERLINGO XANTIA XSARA	04/97→	S36241-00 ⑫ D36241-00 ⑫ B31580-00 ⑬ R31124-00 ③	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm 		X53101-01 0249.71 	N90300-00 0249.48 (8x) P76531-00 0249.48	X85532-01 0348.L7 8x 	X52670-01 1723.63 	X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM
1,8 LFY (XU7JP4)	81-82 kW (110-111 PS)	XANTIA 16V XSARA XSARA 16V ZX ZX 16V	06/95-04/03	S37004-00 ⑫ ⑬ 0197.V5 +0209.Q3 +0249.A2 +0249.A3 Mot.→07965 S32980-00 ⑫ ⑬ 0197.X7 +0209.Q3 +0249.A2 +0249.A3 Mot.07966→ D37004-00 ⑫ Mot.→07965 D32980-00 ⑫ Mot.07966→ B32980-00 ⑬	H80030-00 0209.Q3 84 Ø 	T80030-00 0204.80 (10x) 	X53731-01 L 0249.A2 X53732-01 R 0249.A3 	N93063-00 0956.34 (16x) Mot.→07363 N93062-00 0956.42 (16x) Mot.07364→ Mot.→07965 N92657-00 0956.45 (16x) Mot.07966→ P76817-00 0956.34 Mot.→07363 P76750-00 0956.42 Mot.07364→ Mot.→07965 P76657-00 0956.45 Mot.07966→	X56177-01 0348.C8 Mot.→07037 X58966-01 0348.K6 Mot.07038→ 4x 	X52325-01 0349.F4 Mot.→07664 X52324-01 0349.H0 Mot.07665→ 	70-31414-10 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 2x 0236.21 36x50x7 A RD FPM
1,8 LFZ (XU7JP)	73 kW (99 PS)	EVASION	05/97-07/02	D31580-02 ⑫ B31580-00 ⑬ R31124-00 ③	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm 	T01025-00 0204.57 (10x) 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48	X56171-01 0348.F6 8x 	X01022-01 0349.70 4x 	X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM

CITROEN													
Ltr.													
1,8 LFZ (XU7JP) 74 kW (101 PS)	XANTIA XSARA ZX	07/92-09/00	S31580-00 ¹² ¹³ D31580-00 ¹² 0197.G4 B31580-00 ¹³ R31124-00 ³	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm 	T11025-00 0204.89 (10x) Mot.→PR3975 T01025-00 0204.57 (10x) Mot.PR3975→ 	X53101-01 0249.71 	N90300-00 0249.48 (8x) P76531-00 0249.48	X56171-01 0348.F6 8x X56170-01 ¹⁰ 0348.E6 2x 	X52670-01 ^X 1723.63 	X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM		
1,8 169 (XM7T) 169B	49-51 kW (68-69 PS)	C25	11/81→	S30778-00 ¹² ¹³ D30778-00 ¹²	H02666-00 86,7 Ø 	T02666-00 →06/85 T02760-00 0204.51 (10x) 07/85-04/89 T01025-00 0204.57 (10x) 05/89→ 	X04835-01 0249.14 NBR 	N90300-00 0249.48 (8x) P76531-00 0249.48	X07480-01 8x 	X04833-01 0349.03 	X04848-01 0127.05 NBR X54253-01 Kork 	2x P76151-01 K ← 0326.12 42x62x7 A RD FPM P76005-01 N 16x21x4,5 NBR	
1,8 169 (XM7T)	51 kW (69 PS)	C25 Bus	07/87-02/94	S30778-00 ¹² ¹³ D30778-00 ¹²	H02666-00 86,7 Ø 	T02760-00 0204.51 (10x) →04/89 T01025-00 0204.57 (10x) 05/89→ 	X04835-01 0249.14 NBR 	N90300-00 0249.48 (8x) P76531-00 0249.48	X07480-01 8x 	X04833-01 0349.03 	X04848-01 0127.05 NBR X54253-01 Kork 	2x P76151-01 K ← 0326.12 42x62x7 A RD FPM P76005-01 N 16x21x4,5 NBR	
1,8 6FY (EW7A)	92 kW (125 PS)	C4 C4 PICASSO C5 C5 16V	09/05→		H80768-00 0209.FR MLS 	T80768-00 0204.A3 (10x) 		N92657-00 0956.45 (16x) P76657-00 0956.45	X89881-01 0348.S2 16x 		X82335-01 0349.L4 	70-31414-10 	P77304-02 K ← 16 08 940 680 40x55x6 A SL RD PTFE P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM P77626-01 N 0236.74 39x50x7 A SL RD
1,8 6FZ (EW7J4)	85 kW (115-116 PS)	C5 16V XSARA XSARA PICASSO 16V	02/00→	S36503-00 ¹² ¹³ 0197.Y1 +0209.QG +0249.A4 +0249.A5 D36503-00 ¹² B36503-00 ¹³	H80288-00 0209.QG 83 Ø MLS 	T07586-00 0204.A7 (10x) 	X53933-01 L 0249.A4 X53934-01 R 0249.A5 	N92657-00 0956.45 (16x) P76657-00 0956.45	X86822-01 0348.P1 16x 		X81109-01 0349.H8 	70-31414-10 	P77304-02 K ← 16 08 940 680 40x55x6 A SL RD PTFE P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM

CITROEN													
Ltr. 1,9 DDZ (XU9M) 70-88 kW BX 19 →PR3975 DFZ (XU9J1) (95-120 PS) BX 19 GTI →PR3975 DKZ (XU9JA) ZX →PR3975 D2A (XU92C) D2C (XU92C) 159A	07/86-06/97	S30559-00 ⑫ ⑬ 0197.89 D30559-00 ⑫ 0197.H6 +0209.E1 B30559-00 ⑬ R31124-00 ③	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm	T11025-00 0204.89 (10x)	X01021-01 0249.48	N90300-00 0249.48 (8x) P76531-00 0249.48	8x X07803-01 X07804-01		X01022-01 0349.70 X03013-01 ⚠ 1721.01 X07798-01 ⚠ 1710.39	4x X07793-01 0304.34	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM		
1,9 DDZ (XU9M) 70-88 kW BX 19 PR3976→ DFZ (XU9J1) (95-120 PS) BX 19 GTI PR3976→ DKZ (XU9JA) ZX PR3976→ D2A (XU92C) D2C (XU92C) 159A	07/86-06/97	S30559-00 ⑫ ⑬ 0197.89 D30559-00 ⑫ 0197.H6 +0209.E1 B30559-00 ⑬ R31124-00 ③	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm	T01025-00 0204.57 (10x)	X01021-01 0249.48	N90300-00 0249.48 (8x) P76531-00 0249.48	8x X07803-01 X07804-01		X01022-01 0349.70 X03013-01 ⚠ 1721.01 X07798-01 ⚠ 1710.39	4x X07793-01 0304.34	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM		
1,9 DFW (XU9J4) 108-116 kW BX 19 GTI 16V D6C (XU9J4) (147-158 PS)	09/87-02/93	S31051-00 ⑫ ⑬ 95625018+0209.L3 D31051-00 ⑫ 0197.J2 +0209.L3 B31051-00 ⑬ R31124-00 ③	H07312-00 0209.L7 84,3 Ø	T01025-00 0204.57 (10x)	X07519-01 0249.74 NBR	N91190-00 0956.19 (8x) P76532-00 0956.19	2x X07309-01 0348.G4 16x		X05751-01 0349.E8	2x X04848-01 0127.05 NBR X07793-01 0304.34	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76128-11 N 2x 0236.24 32x45x8 A LD FPM P76133-01 N 2x 0236.21 36x50x7 A RD FPM		
1,9 DHV (XUD9BSD) 55 kW (75 PS) XSARA D XSARA SD	01/98-09/00	B30527-00 ⑬	H05877-00 0209.Q8 1,36 mm 1 ■ MLS H05877-10 0209.Q9 1,4 mm 2 ■ MLS H05877-20 0209.R0 1,44 mm 3 ■ MLS H15877-30 0209.R1 1,48 mm 4 ■ MLS H15877-40 0209.R2 84 Ø 1,53 mm 5 ■ MLS	T02360-00 0204.73 (10x)	X07796-01 0249.91	N90300-00 0249.48 (8x) P76531-00 0249.48	8x		X51239-01 ⑦ 0348.J0	X03013-01 ⚠ 1721.01	X07793-01 0304.34	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76099-11 N 0236.14 35x50x8 A SL WD FPM	

CITROEN													
Ltr.				 S31582-00 ¹² ¹³ 0197.H5 D31582-00 0197.H4 B31582-00 ¹³	H02360-00 0209.Q5 1,65 mm H12360-10 0209.Q6 1,75 mm H05877-00 0209.Q8 1,36 mm 1 MLS H05877-10 0209.Q9 1,4 mm 2 MLS H05877-20 0209.R0 1,44 mm 3 MLS H15877-30 0209.R1 1,48 mm 4 MLS H15877-40 0209.R2 84 Ø 1,53 mm 5 MLS H15877-50 0209.T7 84 Ø 1,59 mm MLS H15877-60 84 Ø 1,7 mm MLS 	T02360-00 0204.73 (10x) 	X07796-01 0249.91 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x		X51239-01 ⁷ 0348.J0 	X03013-01 ⁸ 1721.01 	X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76099-11 N 2x 0236.14 35x50x8 A SL WD FPM
1,9 DJY (XUD9A) DJZ (XUD9Y) D9B (XUD9A/ L) D9B (XUD9A/ U)	47-51 kW (64-70 PS) BERLINGO D BX 19 D C25 Bus D C25 D JUMPER Bus D JUMPER D JUMPY D XANTIA D XSARA D ZX D	09/83→	 S31582-00 ¹² ¹³ 0197.H5 D31582-00 0197.H4 B31582-00 ¹³	H02359-00 0209.K0 84 Ø 1,6 mm 2 H12359-10 84 Ø 1,7 mm 3 H05876-00 0209.S5 1,36 mm 1 H05876-10 0209.S6 1,4 mm 2 H05876-20 0209.S7 1,44 mm 3 H15876-30 0209.S8 1,48 mm 4 H15876-40 0209.S9 84 Ø 1,53 mm 5 	T08280-00 0204.65 (10x) 	X07796-01 0249.91 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x		X51229-01 ⁷ 0348.89 	X03013-01 ⁸ 1721.01 	X04848-01 0127.05 NBR X07793-01 0304.34 	2x P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76099-11 N 2x 0236.14 35x50x8 A SL WD FPM	

CITROEN														
Ltr. 1,9 D2F D6A (XU9J2)	80-92 kW (109-125 PS)	BX BX 19 BX 19 GTI	PR3976→ PR3976→	07/86-12/94 1	S30559-00 ⑫ ⑬ 0197.89 D30559-00 ⑫ 0197.H6 +0209.E1 B30559-00 ⑬ R31124-00 ③	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm 	T01025-00 0204.57 (10x) 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48	8x X07803-01 X07804-01 	X01022-01 0349.70 X03013-01 ⚠ 1721.01 X07798-01 ⚠ 1710.39 	4x X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
1,9 D6A (XU9J2)	90-92 kW (122-125 PS)	BX BX 19 GTI	→PR3975 →PR3975	07/86-12/94	S30559-00 ⑫ ⑬ 0197.89 D30559-00 ⑫ 0197.H6 +0209.E1 B30559-00 ⑬ R31124-00 ③	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm 	T11025-00 0204.89 (10x) 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48	8x X07803-01 X07804-01 	X01022-01 0349.70 X03013-01 ⚠ 1721.01 X07798-01 ⚠ 1710.39 	4x X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
1,9 D6E (XU9JA)	93-96 kW (126-131 PS)	ZX		03/91-06/97	S31411-00 ⑫ ⑬ 95659565 D31411-00 ⑫ 95659566 R31124-00 ③	H01025-00 0209.E1 84,3 Ø 1,2 mm H11025-10 0209.L3 84,3 Ø 1,5 mm 	T01025-00 0204.57 (10x) 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48	8x X06152-01 0349.91 	X06151-01 0349.70 X07798-01 ⚠ 1710.39 	4x X04848-01 0127.05 NBR X07793-01 0304.34 	2x P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
1,9 D9A (XUD9) 162 (XUD9)	47 kW (64 PS)	BX 19 D		09/83-11/94	S30527-00 ⑫ ⑬ 0197.H5 D30527-00 ⑫ 0197.H4 +0956.22 (8x) B30527-00 ⑬	H05876-00 0209.S5 1,36 mm 1 H05876-10 0209.S6 1,4 mm 2 H05876-20 0209.S7 1,44 mm 3 H15876-30 0209.S8 1,48 mm 4 H15876-40 0209.S9 84 Ø 1,53 mm 5 H07781-00 0209.K0 1,58 mm H17781-10 0209.K1 1,7 mm 	T08280-00 0204.65 (10x) 	X07796-01 0249.91 	N90300-00 0249.48 (8x) P76531-00 0249.48	8x X55498-01 0348.99 →03/87 X55499-01 0348.98 →03/87 	2x X51229-01 ⑦ 0348.89 04/87→ 	X07782-01 0349.78 →03/87 X03013-01 ⚠ 1721.01 	2x X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76099-11 N 0236.14 35x50x8 A SL WD FPM

CITROEN												
1.9 WJY (DW8B) 51 kW (69-70 PS)	BERLINGO D JUMPY D XSARA D	04/98→	<p>S32985-00 ⑫ ⑬ 0197.X6 +0127.28 +0326.22 +0807.14</p> <p></p> <p>D32985-00 ⑫ 0197.X5 +0807.14</p> <p></p> <p>B32989-00 ⑬</p>	<p>H05616-00 0209.X0 84 Ø 1,26 mm 3 </p> <p>MLS</p> <p>H05616-10 0209.X1 1,3 mm 4 </p> <p>MLS</p> <p>H05616-20 0209.X2 1,34 mm 5 </p> <p>MLS</p> <p>H15616-30 0209.X3 1,38 mm 6 </p> <p>MLS</p> <p>H15616-40 0209.X4 1,42 mm 7 </p> <p>MLS</p> <p>H15616-50 0209.1C 84 Ø 1,47 mm 4 </p> <p>MLS</p> <p></p>	<p>T08280-00 0204.65 (10x) Mot.→08469</p> <p></p> <p>T05616-00 0204.97 (10x) Mot.08470→</p> <p></p>	<p>X53733-01 U 0249.97</p> <p></p> <p>X53780-01 O 0249.95</p> <p></p>	<p>N90300-00 0249.48 (8x)</p> <p>P76531-00 0249.48</p>	<p>X58969-01 0348.N2</p> <p>8x </p> <p>X58970-01 0348.N1</p> <p></p>	<p>X52327-01 0349.H7</p> <p>2x </p>	<p>X07793-01 0304.34</p> <p></p>	<p>P76151-01 K ← 0326.12 42x62x7 A RD FPM</p> <p>P76386-01 K → 0127.28 90x110x7 A SL LD FPM</p> <p>P76099-11 N 0236.14 35x50x8 A SL WD FPM</p>	
2.0 AHZ (DW10CD) RHC (DW10CTED4) RHD (DW10CB) RHD (DW10CTED4) RHE (DW10CTED4) RHH (DW10CTED4) [NEW]	94-120 kW (128-163 PS) C4 HDI C5 C5 HDI C8 HDI DS4 HDI DS5 DS5 HDI JUMPY HDI	03/06→	<p>S38513-00 ⑫ ⑬ 0197.AW +0249.G8 +0348.V7</p> <p></p> <p>D38513-00 ⑫ 0197.AX +0348.V7</p> <p></p>	<p>H40649-00 0209.GL 1,25 mm 1 </p> <p>MLS</p> <p>H40649-10 0209.GN 1,3 mm 2 </p> <p>MLS</p> <p>H40649-20 0209.GP 1,35 mm 3 </p> <p>MLS</p> <p>H40649-30 0209.GQ 1,4 mm 2 </p> <p>MLS</p> <p></p>	<p>T05133-00 0204.A6 (10x)</p> <p></p>	<p>X59687-01 0348.V7</p> <p></p>	<p>N93131-00 0956.63 (16x)</p> <p>P76842-00 0956.63</p> <p>16x</p>	<p>X59682-01 0349.N2</p> <p></p>	<p>70-31414-10</p> <p></p>	<p>P77464-01 K ← 0127.47 42x62x7 A SL RD PTFE</p> <p>P77465-01 K → 0127.45 90x110x7 A SL LD PTFE</p> <p>P77142-01 N 0807.28 27x47x7 A SL RD FPM</p>		
2.0 B20/614	65 kW (88 PS) C35 C35 Bus	11/73-01/94	<p>S30006-00 ⑬ 5451440H</p> <p>D30006-00 5451439X</p> <p>R30713-00 ③</p>	<p>H00677-00 5478690 92,7 Ø</p> <p></p>		<p>X07492-01 5412579F</p> <p></p>	<p>N91010-00 P76531-00 0249.48 P76543-00 0956.05</p>	<p>X00828-01 5414063</p> <p>4x </p> <p>X00830-01 5414064</p> <p>4x </p> <p>2x</p>	<p>X00680-01 5412149G</p> <p></p>	<p>4x X00709-01 5448221U</p> <p></p> <p>X00716-01 Kork</p> <p></p>	<p>P76001-01 K ← 10x18x5 NBR</p> <p>P76051-01 K → 95550398 29x46x10 LD MVQ</p>	
2.0 M20-616	75 kW (102 PS) CX 2000	09/74-05/79	<p>S30966-00 ⑫ ⑬ 5477993C</p> <p>D30966-00 ⑫ 5477992S</p> <p>B30966-00 ⑬</p> <p>R30713-00 ③</p>	<p>H00677-00 5478690 92,7 Ø</p> <p></p>		<p>X07492-01 5412579F</p> <p></p>	<p>N91010-00 P76531-00 0249.48 P76543-00 0956.05</p>	<p>X07495-01 ⑩ 562033Z</p> <p>4x </p> <p>4x</p> <p>2x</p>	<p>X00701-01 5440398L</p> <p></p> <p>X07494-01 5490878</p> <p></p> <p>X07493-01 5 434 181</p> <p></p>	<p>4x X07498-01 7543388080B</p> <p></p> <p>2x</p>	<p>P76368-11 K → 26126699J 95x112x12,5 LD FPM</p> <p>P76051-01 N 95550398 29x46x10 LD MVQ</p>	

CITROEN													
2,0 RDZ (XU10MZ) RFZ (XU10J2) XU102C	79-89 kW (107-121 PS)	XM	05/89-06/94	S31115-00 ⑫ ⑬ 95650948 D31115-00 ⑫ 0197.C8 +0209.N1 B31115-00 ⑬	H07967-00 0209.N1 87.3 Ø 	T08280-00 0204.65 (10x) 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48	X56528-01 0348.E0 8x 		X06151-01 0349.70 4x 	X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM
2,0 RFJ (EW10A)	103-105 kW (140-143 PS)	C4 C4 GRAND PICASSO C4 VTR C4 16V C5 C5 16V C8 C8 16V	09/04→	S80781-00 ⑫ ⑬ ⑰ D80781-00 ⑫ ⑰ B38333-00 ⑬	H80781-00 0209.FS MLS 	T80768-00 0204.A3 (10x) 		N92657-00 0956.45 (16x) P76657-00 0956.45	X89881-01 0348.S2 16x 		X82335-01 0349.L4 	70-31414-10 	P77304-02 K ← 16 08 940 680 40x55x6 A SL RD PTFE P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM P77626-01 N 0236.74 39x50x7 A SL RD
2,0 RFK (EW10J4S)	130 kW (177 PS)	C4 C4 16V	11/04-12/10	S36504-03 ⑫ ⑬ ⑰ D36504-03 ⑫ ⑰ B36503-03 ⑬	H80351-00 0209.Z3 85,5 Ø MLS 	T80768-00 0204.A3 (10x) 	X53933-01 L 0249.A4 X53934-01 R 0249.A5 	N92657-00 0956.45 (16x) P76657-00 0956.45	X89343-01 0348.R8 16x 		X81109-01 0349.H8 	70-31414-10 	P77304-02 K ← 16 08 940 680 40x55x6 A SL RD PTFE P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 2x 0236.21 36x50x7 A RD FPM
2,0 RFN (EW10J4)	100 kW (136 PS)	C4 16V C5 16V C8 EVASION 16V JUMPY XSARA PICASSO 16V XSARA 16V	04/00→	S36504-00 ⑫ ⑬ 0197.Y1 +0209.Z3 +0249.A4 +0249.A5 D36504-00 ⑫ B36503-00 ⑬	H80351-00 0209.Z3 85,5 Ø MLS 	T07586-00 0204.A7 (10x) 	X53933-01 L 0249.A4 X53934-01 R 0249.A5 	N92657-00 0956.45 (16x) P76657-00 0956.45	X86822-01 0348.P1 16x 		X81109-01 0349.H8 	70-31414-10 	P77304-02 K ← 16 08 940 680 40x55x6 A SL RD PTFE P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 2x 0236.21 36x50x7 A RD FPM
2,0 RFS (XU10J4RS)	120-122 kW (163-166 PS)	XSARA 16V ZX ZX 16V	05/96-03/05	S36087-00 ⑫ ⑬ 0197.W2 +0209.Z2 D36087-00 ⑫ B32981-00 ⑬	H80033-00 0209.Z2 87 Ø MLS 	T50162-00 0204.72 (10x) 	70-31414-10 	N92990-00 0956.38 (16x) P76662-00 0956.38	X58967-01 0348.C8 16x 		X52325-01 0349.F4 	70-31414-10 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 2x 0236.21 36x50x7 A RD FPM

CITROEN												
2,0 RFX (XU10J4/Z)	112 kW (152 PS)	XANTIA 16V ZX 16V	07/92-01/98	S31583-00 ¹² ¹³ 95668993 06/93→ D31583-00 ¹² 0197.G7 +0209.N0 06/93→ D38545-00 ¹² 0197.G7 B31583-00 ¹³	H07967-00 0209.N1 87,3 Ø →05/93 H50162-00 0209.N0 87 Ø 06/93→ 	T08280-00 0204.65 (10x) →05/93 T50162-00 0204.72 (10x) 06/93→ 	X07519-01 0249.74 NBR 	N91190-00 0956.19 (8x) P76532-00 0956.19 2x 16x 	X56177-01 0348.C8 	X51249-01 0349.98 	70-31414-10 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM
2,0 RGX (XU10J2TE/ RGY)	104-108 kW (141-147 PS)	EVASION Turbo XANTIA Turbo XM Turbo	09/92-04/03	D36906-00 ¹² 0197.H3 	H50161-00 0209.J8 87 Ø 1,2 mm 	T08280-00 0204.65 (10x) 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48 8x X56528-01 0348.E0 Mot.→07664 X58564-01 0348.N0 Mot.07665→ 2x 	X06151-01 0349.70 	4x X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76128-11 N 0236.24 32x45x8 A LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
2,0 RHF (DW10BTD4)	100-103 kW (136-140 PS)	C4 HDI C5 HDI	02/08→	S37090-00 ¹² ¹³ 0197.AE +0348.S3 D37090-00 ¹² 0197.AC +0348.S3 	H01900-00 0209.AV 86 Ø 1,25 mm 2 ■ MLS H11900-10 0209.AW 86 Ø 1,3 mm 3 ■ MLS H21900-20 0209.AX 86 Ø 1,35 mm 4 ■ MLS H31900-30 0209.AY 86 Ø 1,4 mm 5 ■ MLS 	T05133-00 0204.A6 (10x) 	V37090-00 0348.S3 	N92635-01 0956.48 (16x) P76698-00 0956.48 16x 	X81070-01 0349.J2 	70-31414-10 	P77464-01 K ← 0127.47 42x62x7 A SL RD PTFE P77465-01 K → 0127.45 90x110x7 A SL LD PTFE P77142-01 N 0807.28 27x47x7 A SL RD FPM	

CITROEN												
Ltr. 1 2,0 RHJ 100 kW (DW10BTED4) (136 PS) RHR (DW10BTED4)	C4 HDI C4 HDI 135 FAP C4 HDI 135 FFAP C5 HDI JUMPY HDI 140	09/04→	S37090-00 ¹² ¹³ 0197.AE +0348.S3 D37090-00 ¹² 0197.AC +0348.S3 	H01900-00 0209.AV 86 Ø 1,25 mm 2 MLS H11900-10 0209.AW 86 Ø 1,3 mm 3 MLS H21900-20 0209.AX 86 Ø 1,35 mm 4 MLS H31900-30 0209.AY 86 Ø 1,4 mm 5 MLS 	T05133-00 0204.A6 (10x) 	V37090-00 0348.S3 	N92635-00 0956.48 (8x) 2x P76698-00 0956.48 16x		X81070-01 0349.J2 	70-31414-10 	P77464-01 K ← 0127.47 42x62x7 A SL RD PTFE P77465-01 K → 0127.45 90x110x7 A SL LD PTFE P77142-01 N 0807.28 27x47x7 A SL RD FPM	
2,0 RHK 88 kW (DW10UTED4) (120 PS)	C8 JUMPY HDI JUMPY HDI 120	01/07→	D37090-01 ¹² 0197.AN +0348.S3 	H01900-00 0209.AV 86 Ø 1,25 mm 2 MLS H11900-10 0209.AW 86 Ø 1,3 mm 3 MLS H21900-20 0209.AX 86 Ø 1,35 mm 4 MLS H31900-30 0209.AY 86 Ø 1,4 mm 5 MLS 	T05133-00 0204.A6 (10x) 	V37090-00 0348.S3 	N92635-00 0956.48 (8x) 2x P76698-00 0956.48 16x		X82339-01 0349.L9 	70-31414-10 	P77464-01 K ← 0127.47 42x62x7 A SL RD PTFE P77465-01 K → 0127.45 90x110x7 A SL LD PTFE P77142-01 N 0807.28 27x47x7 A SL RD FPM	
2,0 RHM 79-80 kW (DW10ATED4) (107-109 PS) RHT (DW10ATED4) RHW (DW10ATED4)	C8 HDI EVASION HDI	09/99→	S36517-00 ¹² ¹³ 0197.Y6 D36517-00 ¹² 0197.Y7 +0249.A6 B36517-00 ¹³	H01900-00 0209.AV 86 Ø 1,25 mm 2 MLS H11900-10 0209.AW 86 Ø 1,3 mm 3 MLS H21900-20 0209.AX 86 Ø 1,35 mm 4 MLS H31900-30 0209.AY 86 Ø 1,4 mm 5 MLS 	T17586-00 0204.96 (10x) 	X53953-01 0249.A6 	N92635-00 0956.48 (8x) 2x P76698-00 0956.48 16x		X81070-01 0349.J2 	70-31414-10 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P77142-01 N 0807.28 27x47x7 A SL RD FPM	

CITROEN												
Ltr.												
2,0 RHR (DW10BTED4) (136 PS)	100 kW C8 HDI	03/06→	<p>S37090-00 ⑫ ⑬ 0197.AE +0348.S3</p> <p></p> <p>D37090-00 ⑫ 0197.AC +0348.S3</p> <p></p>	<p>H01900-00 0209.AV 86 Ø 1,25 mm 2 ■ MLS</p> <p>H11900-10 0209.AW 86 Ø 1,3 mm 3 ■ MLS</p> <p>H21900-20 0209.AX 86 Ø 1,35 mm 4 ■ MLS</p> <p>H31900-30 0209.AY 86 Ø 1,4 mm 5 ■ MLS</p>	<p>T05133-00 0204.A6 (10x)</p>	<p>V37090-00 0348.S3</p>	<p>N92635-00 0956.48 (8x)</p> <p>P76698-00 0956.48</p> <p>16x</p>		<p>X81070-01 0349.J2</p>	<p>70-31414-10</p>	<p>P77464-01 K ← 0127.47 42x62x7 A SL RD PTFE</p> <p>P77465-01 K → 0127.45 90x110x7 A SL LD PTFE</p> <p>P77142-01 N 0807.28 27x47x7 A SL RD FPM</p>	
2,0 RHS (DW10ATED) (90-109 PS) RHX (DW10BTED) RHY (DW10TD) RHZ (DW10ATED)	66-80 kW BERLINGO HDI BERLINGO HDI 90 C5 HDI EVASION HDI JUMPY HDI XANTIA HDI 109 XANTIA HDI 90 XSARA HDI XSARA HDI 109 XSARA HDI 90 XSARA PICASSO HDI	02/99→	<p>S36550-00 ⑫ ⑬ 0197.X4 +0249.99</p> <p></p> <p></p> <p>D36550-00 ⑫ 0197.X3 +0249.99</p> <p></p> <p>B32989-00 ⑬</p>	<p>H05133-00 0209.X5 1,3 mm 1 ■ MLS</p> <p>H05133-10 0209.X6 1,35 mm 2 ■ MLS</p> <p>H05133-20 0209.X7 1,4 mm 3 ■ MLS</p> <p>H15133-30 0209.X8 1,45 mm 4 ■ MLS</p> <p>H15133-40 0209.X9 86 Ø 1,5 mm 5 ■ MLS</p>	<p>T05133-00 0204.A6 (10x)</p>	<p>X53885-01 0249.99</p>	<p>N92991-00 0956.38 (8x) Mot.→08331</p> <p>N92635-00 0956.48 (8x) Mot.08332→</p> <p>P76662-00 0956.38 Mot.→08331</p> <p>P76698-00 0956.48 Mot.08332→</p> <p>8x</p> <p>8x</p>	<p>X58968-01 0348.N4</p>	<p>X52326-01 0349.H4</p>	<p>70-31414-10</p>	<p>P76151-01 K ← 0326.12 42x62x7 A RD FPM</p> <p>P76386-01 K → 0127.28 90x110x7 A SL LD FPM</p> <p>P77142-01 N 0807.28 27x47x7 A SL RD FPM</p>	

CITROEN												
Ltr.												
2,0 RHV (DW10UTD) 62 kW (84 PS)	JUMPER BusHDI JUMPER HDI	11/01→	S36550-00 ⑫ ⑬ 0197.X4 +0249.99 D36550-00 ⑫ 0197.X3 +0249.99 B32989-00 ⑬	H05133-00 0209.X5 1,3 mm 1 MLS H05133-10 0209.X6 1,35 mm 2 MLS H05133-20 0209.X7 1,4 mm 3 MLS H15133-30 0209.X8 1,45 mm 4 MLS H15133-40 0209.X9 86 Ø 1,5 mm 5 MLS 	T05133-00 0204.A6 (10x) 	X53885-01 0249.99 	N92635-00 0956.48 (8x) P76698-00 0956.48	X58968-01 0348.N4 8x 	X52326-01 0349.H4 	70-31414-10 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P77142-01 N 0807.28 27x47x7 A SL RD FPM	
2,0 RLZ (EW10D) 103 kW (140 PS)	C5 16V C5 16V HPI	03/01-08/04	S36504-01 ⑫ ⑬ 0197.Y1 +0209.Z3 +0249.A8 +0249.A7 (4x) D36504-01 ⑫ B36503-00 ⑬	H80351-00 0209.Z3 85,5 Ø MLS 	T07586-00 0204.A7 (10x) 	X53954-01 0249.A8 	N92657-00 0956.45 (16x) P76657-00 0956.45	X81109-01 0349.H8 16x 	70-31414-10 	P77304-02 K ← 16 08 940 680 40x55x6 A SL RD PTFE P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM P77437-01 N 0236.65 39x50x7 A SL RD FPM		
2,0 R6A 94 kW (128 PS)	XM	05/89-06/94	D31581-00 ⑫ 0197.G6 +0209.J8 →03/94 B31581-00 ⑬	H50161-00 0209.J8 87 Ø 1,2 mm 	T08280-00 0204.65 (10x) 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48	X07803-01 8x X07804-01 	X06151-01 0349.70 4x 	X07793-01 0304.34 →09/93 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	
2,0 XU10J2 81 kW (110 PS)	JUMPER JUMPER Bus	04/02→	D32987-00 ⑫ 0197.T4 +0209.J8 B31581-00 ⑬	H50161-00 0209.J8 87 Ø 1,2 mm 	T08280-00 0204.65 (10x) 	X01021-01 0249.48 	N90300-00 0249.48 (8x) P76531-00 0249.48	X56171-01 0348.F6 2x X56170-01 ⑩ 0348.E6 2x 	X06151-01 0349.70 4x 	X07793-01 0304.34 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM	

CITROEN												
Ltr.												
2,0 170A (XN1T) 58 kW 170B (XN1T) (79 PS)	C25 C25 Bus	09/81-03/94	S30777-00 ⑫ ⑬ 9400197139 D30777-00 ⑫ B30777-00 R30547-00 ③	H02760-00 90,2 Ø 1,2 mm H12760-10 0209.49 90,2 Ø 1,6 mm 	T02666-00 →06/85 T02760-00 0204.51 (10x) 07/85-04/89 T01025-00 0204.57 (10x) 05/89→ 	X04835-01 0249.14 NBR 	N90300-00 0249.48 (8x) P76531-00 0249.48	X07480-01 8x 	X04833-01 0349.03 	X04848-01 0127.05 NBR X54253-01 Kork 	2x P76151-01 K ← 0326.12 42x62x7 A RD FPM P76005-01 N 16x21x4,5 NBR	
2,0 170C (XN1T) 62 kW (84 PS)	C25	01/87-03/94	S30777-00 ⑫ ⑬ 9400197139 D30777-00 ⑫ B30777-00 R30547-00 ③	H02760-00 90,2 Ø 1,2 mm H12760-10 0209.49 90,2 Ø 1,6 mm 	T02760-00 0204.51 (10x) →04/89 T01025-00 0204.57 (10x) 05/89→ 	X04835-01 0249.14 NBR 	N90300-00 0249.48 (8x) P76531-00 0249.48	X07480-01 8x 	X04833-01 0349.03 	X04848-01 0127.05 NBR X54253-01 Kork 	2x P76151-01 K ← 0326.12 42x62x7 A RD FPM P76005-01 N 16x21x4,5 NBR	
2,0 170C (XN1T) 62 kW (84 PS)	C25 C25 Bus	02/91-03/94	S30777-00 ⑫ ⑬ 9400197139 D30777-00 ⑫ B30777-00 R30547-00 ③	H02760-00 90,2 Ø 1,2 mm H12760-10 0209.49 90,2 Ø 1,6 mm 	T01025-00 0204.57 (10x) 	X04835-01 0249.14 NBR 	N90300-00 0249.48 (8x) P76531-00 0249.48	X07480-01 8x 	X04833-01 0349.03 	X04848-01 0127.05 NBR X54253-01 Kork 	2x P76151-01 K ← 0326.12 42x62x7 A RD FPM P76005-01 N 16x21x4,5 NBR	
2,0 829 A5	78 kW (106 PS) CX 20 CX 20 RE CX 2000	06/79-12/92	S31063-00 ⑫ ⑬ 95568475 D31063-00 ⑫ 95568474 R30961-00 ③	H00749-00 95605041 89,3 Ø 		X04583-01 7700 614 729 	N90300-00 0249.48 (8x) P76531-00 0249.48	X00690-01 7700 616 523 8x 	X06303-01 	X00696-01 9549265880 Kork 	P76186-01 K ← 50x68x10 A RD FPM P76094-01 K → 0236.09 35x47x7 A RD MVQ P76363-01 K → 90x110x13 LD P76054-11 N 30x40x7 A SL RD FPM	

CITROEN												
2,1 PHZ (XUD11ATE) PJZ (XUD11ATE) P8A (XUD11ATE) P8C (XUD11BTE)	80 kW (109 PS)	EVASION TD XANTIA TD12V XM TD 12V	05/89-07/02	<p>S31584-00 ¹² ¹³</p> <p>D31584-00 ¹²</p> <p>0197.H1</p> <p>B31584-00 ¹³</p>	<p>H07761-00 0209.T6 1,35 mm MLS</p> <p>H07761-10 0209.R4 1,52 mm MLS</p> <p>H07761-20 0209.R5 1,57 mm MLS</p> <p>H17761-30 0209.R6 1,62 mm MLS</p> <p>H17761-40 0209.R7 1,67 mm MLS</p> <p>H17761-50 0209.R8 1,73 mm MLS</p> <p>H27761-60 0209.T4 86 Ø 1,77 mm MLS</p>	<p>T02356-00 0204.68 (10x)</p>	<p>X53584-01 0249.70</p>	<p>N91210-00 0956.22 (12x)</p> <p>P76531-00 0249.48</p>	<p>X56183-01 0348.96</p> <p>12x</p>	<p>X51245-01 0349.76</p>	<p>X07793-01 0304.34</p>	<p>P76151-01 K ← 0326.12 42x62x7 A RD FPM</p> <p>P76386-01 K → 0127.28 90x110x7 A SL LD FPM</p> <p>P76099-11 N 0236.14 35x50x8 A SL WD FPM</p>
2,1 P9A (XUD11A) 60 kW (82 PS)	XM XM D 12V	05/89-08/96	<p>S31584-00 ¹² ¹³</p> <p>D31584-00 ¹²</p> <p>0197.H1</p> <p>B31584-00 ¹³</p>	<p>H02354-00 0209.H1 1,58 mm 2 </p> <p>H12354-10 0209.A0 87 Ø 1,7 mm 3 </p>	<p>T02354-00 0204.67 (10x)</p>	<p>X53584-01 0249.70</p>	<p>N91210-00 0956.22 (12x)</p> <p>P76531-00 0249.48</p>	<p>X56183-01 0348.96</p> <p>12x</p>	<p>X51245-01 0349.76</p>	<p>X07793-01 0304.34</p>	<p>P76151-01 K ← 0326.12 42x62x7 A RD FPM</p> <p>P76386-01 K → 0127.28 90x110x7 A SL LD FPM</p> <p>P76099-11 N 2x 0236.14 35x50x8 A SL WD FPM</p>	
2,2 B22615 CRD90	45-46 kW (61-62 PS)	C35 Bus D C35 D	11/73→	<p>S30005-00 ¹² ¹³</p> <p>5451033J</p> <p>D30005-00 ¹²</p> <p>95534760</p>	<p>H00755-00 75491733 93,3 Ø</p>	<p>T06345-00 0204.41 (8x) +0204.42 (9x)</p>	<p>X00742-01 5 450 155 NBR</p>	<p>N91300-00 5469955</p> <p>P76531-00 0249.48</p> <p>P76543-00 0956.05</p>	<p>X00837-01</p> <p>4x</p>	<p>X00881-01 0349.F0</p> <p>4x</p>	<p>X00709-01 5448221U</p> <p>X00716-01 Kork</p>	<p>P76178-11 K ← 48x65x10 A NBR</p>
2,2 J6T A500	83-85 kW (113-115 PS)	CX 22 TRS CX 22TRS CX 2200	06/81-12/92	<p>S31063-00 ¹² ¹³</p> <p>95568475</p> <p>D31063-00 ¹²</p> <p>95568474</p> <p>R30961-00 ³</p>	<p>H00749-00 95605041 89,3 Ø</p>		<p>X04583-01 7700 614 729</p>	<p>N90300-00 0249.48 (8x)</p> <p>P76531-00 0249.48</p>	<p>X00690-01 7700 616 523</p> <p>8x</p>	<p>X06303-01</p>	<p>X00696-01 9549265880 Kork</p>	<p>P76186-01 K ← 50x68x10 A RD FPM</p> <p>P76094-01 K → 0236.09 35x47x7 A RD MVQ</p> <p>P76363-01 K → 90x110x13 LD</p> <p>P76054-11 N 30x40x7 A SL RD FPM</p>

CITROEN															
2,2 M22-617	82 kW (112 PS)	CX 2200	09/74-07/76	S30992-00 ¹² ¹³ 5470968U D30992-00 ¹² 5477994N B30966-00 ¹³ R30713-00 ³	H07579-00 5433873 93,3 Ø 					X07492-01 5412579F 	N91010-00 P76531-00 0249.48 P76543-00 0956.05 4x 	X07495-01 ¹⁰ 562033Z 2x 	X07494-01 5490878 4x 	X07498-01 7543388080B 4x 	P76368-11 K → 26126699J 95x112x12,5 LD FPM P76051-01 N 95550398 29x46x10 LD MVQ
2,2 M22-621	49 kW (67 PS)	CX 2200 D	10/75-02/79	S30991-00 ¹² ¹³ 5478737P D30991-00 ¹² 5478736D	H00750-00 75491734 93,3 Ø 					X00742-01 5 450 155 NBR 	N91010-00 P76531-00 0249.48 P76543-00 0956.05 4x 	X00837-01 4x 	X00881-01 0349.F0 4x 	X07498-01 7543388080B 4x 	P76178-11 K ← 48x65x10 A NBR P76368-11 K → 26126699J 95x112x12,5 LD FPM P76051-01 N 95550398 29x46x10 LD MVQ
2,2 3FZ (EW12J4)	116 kW (158 PS)	C8	07/02→	S37005-00 ¹² ¹³ 0197.Y8 +0209.0H +0249.A4 +0249.A5 D37005-00 ¹²	H80475-00 0209.0H 87 Ø MLS 					X53933-01 L 0249.A4 	N92657-00 0956.45 (16x) P76657-00 0956.45 16x 	X81726-01 0348.P6 16x 	X81109-01 0349.H8 	70-31414-10 	P77304-02 K ← 16 08 940 680 40x55x6 A SL RD PTFE P76386-01 K → 0127.28 90x110x7 A SL LD FPM P76133-01 N 0236.21 36x50x7 A RD FPM P77437-01 N 0236.65 39x50x7 A SL RD FPM
2,2 4HL (DW12C)	115-150 kW (156-204 PS)	C-CROSSER HDI C5 C5 HDI C6 HDI C8 C8 HDI	04/06→	D38112-00 ¹² 	H01901-00 0209.FT 1,25 mm MLS H11901-10 0209.FV 1,3 mm MLS H21901-20 0209.FW 1,35 mm MLS H31901-30 0209.FX 85,9 Ø 1,37 mm MLS 				V38102-00 0249.E4 +0249.E5 (2x) +0249.E3 	N93131-00 0956.63 (16x) P76842-00 0956.63 16x 	M38101-00 0348.T2 16x 	X81999-01 0349.P1 	70-31414-10 	P77464-01 K ← 0127.47 42x62x7 A SL RD PTFE P77465-01 K → 0127.45 90x110x7 A SL LD PTFE P77142-01 N 0807.28 27x47x7 A SL RD FPM	

CITROEN													
Ltr.			1										
2,2 4HU (P22DTE) 74-88 kW 4HV (P22DTE) (101-120 PS)	JUMPER HDI 100 JUMPER HDI 120		04/06→	D38555-00 B36738-00 ¹³ ³⁵	H40597-00 0209.EH 87,5 Ø 1,1 mm 1 MLS H40597-10 0209.ES 87,5 Ø 1,15 mm 2 MLS H40597-20 0209.ET 87,5 Ø 1,2 mm 3 MLS 	T59572-00 0204.C0 (10x) +0204.A9 (8x) 	X83135-01 0249.E9 NBR 	N92986-00 0956.59 (16x) P76777-00 0956.59	X88198-01 0348.T1 16x 	8x	X81992-01 0349.L5 X82543-01 	E36738-00 0304.58 70-31414-10 	P77367-01 K ← 0514.C6 PTFE P77338-01 K → 0514.C4 PTFE
2,2 4HW (DW12TED4) 4HX (DW12TED4)	94-98 kW (128-133 PS) C5 HDI C8 HDI		03/01→	S36517-00 ¹² ¹³ 0197.Y6 D36517-00 ¹² 0197.Y7 +0249.A6 B36517-00 ¹³	H01900-00 0209.AV 86 Ø 1,25 mm 2 MLS H11900-10 0209.AW 86 Ø 1,3 mm 3 MLS H21900-20 0209.AX 86 Ø 1,35 mm 4 MLS H31900-30 0209.AY 86 Ø 1,4 mm 5 MLS 	T17586-00 0204.96 (10x) 	X53953-01 0249.A6 	N92635-00 0956.48 (8x) P76698-00 0956.48	2x 16x	X81070-01 0349.J2 	70-31414-10 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P77142-01 N 0807.28 27x47x7 A SL RD FPM	
2,2 4HY (DW12UTED)	74 kW (101 PS) JUMPER Bus HDI JUMPER HDI		02/02→	S36550-00 ¹² ¹³ 0197.X4 +0249.99 D36550-00 ¹² 0197.X3 +0249.99 	H06254-00 0209.AQ 1,25 mm 1 MLS H06254-10 0209.AR 1,3 mm 2 MLS H06254-20 0209.AS 1,35 mm 3 MLS H16254-30 0209.AT 86 Ø 1,4 mm 4 MLS 	T17586-00 0204.96 (10x) 	X53885-01 0249.99 	N92635-00 0956.48 (8x) P76698-00 0956.48	8x	X58968-01 0348.N4 	X52326-01 0349.H4 	70-31414-10 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76386-01 K → 0127.28 90x110x7 A SL LD FPM P77142-01 N 0807.28 27x47x7 A SL RD FPM

CITROEN													
2,3 M23-622 M23-623 M23-639	85-96 kW (116-131 PS)	CX 2400 CX 2400 GTI	08/76-06/83	S30713-00 ⑫ ⑬ 584768U D30713-00 ⑫ 5484766X R30967-00 ③	H07491-00 9558649980 96,5 Ø 		X07492-01 5412579F 	N91010-00 P76531-00 0249.48 P76543-00 0956.05	X00702-01 5469837 4x X07495-01 ⑩ 562033Z 4x	2x 2x	X07494-01 5490878 4x X07493-01 ⚠ 5 434 181 	X07498-01 7543388080B 	P76368-11 K → 26126699J 95x112x12,5 LD FPM P76051-01 N 95550398 29x46x10 LD MVQ
2,5 B25/637	51 kW (69 PS)	C35 Bus D C35 D	02/80-01/94	S30459-00 ⑫ ⑬ 95569124 D30459-00 ⑫ 95568472+95393121	H01014-00 95542219 96,3 Ø 	T06345-00 0204.41 (8x) +0204.42 (9x) 	X00742-01 5 450 155 NBR →07/81 X01015-01 0249.78 07/81→ 	N91300-00 5469955 P76531-00 0249.48 P76543-00 0956.05	X00837-01 4x 4x	4x	X00881-01 0349.F0 4x X07493-01 ⚠ 5 434 181 	X00709-01 5448221U 	P76178-11 K ← 48x65x10 A NBR P76369-01 K → 95533957 95x112x12,5 RD FPM
2,5 CRD93L (U25-661) M25-660	54-55 kW (73-75 PS)	CX 25 D C25 Bus D C25 D	11/81-02/94	S31078-00 ⑫ ⑬ 95605463 D30253-00 ⑫	H00666-00 0209.L5 96,3 Ø 	T06345-00 0204.41 (8x) +0204.42 (9x) 	X00742-01 5 450 155 NBR X01015-01 0249.78 	N91300-00 5469955 P76531-00 0249.48 P76543-00 0956.05	X00837-01 4x 4x	4x	X00881-01 0349.F0 4x X07493-01 ⚠ 5 434 181 	X07498-01 7543388080B X07506-01 Kork 2x	P76314-01 K ← 0514.32 75x90x11,5 A SL RD FPM P76368-11 K → 26126699J 95x112x12,5 LD FPM P76183-01 N 48x72x10 RD FPM
2,5 CRD93LS (U25-673) M25-648 M25-669	70-88 kW (95-120 PS)	CX 25 TD CX 2500 TD C25 Bus TD C25 DT	04/83-02/94	S31052-00 ⑫ ⑬ 95593755 D31052-00 ⑫ B31052-00 ⑬	H06345-00 0209.L6 95,6 Ø 	T06345-00 0204.41 (8x) +0204.42 (9x) 	X01015-01 0249.78 	N91300-00 5469955 P76531-00 0249.48 P76543-00 0956.05	X00837-01 4x 4x	4x	X00881-01 0349.F0 4x X07493-01 ⚠ 5 434 181 	X07498-01 7543388080B X07506-01 Kork 2x	P76314-01 K ← 0514.32 75x90x11,5 A SL RD FPM P76368-11 K → 26126699J 95x112x12,5 LD FPM P76183-01 N 48x72x10 RD FPM
2,5 M25-629	55 kW (75 PS)	CX 2500 D	02/78-08/85	S30253-00 ⑫ ⑬ 75513625 D30253-00 ⑫ B30253-00 ⑬	H00666-00 0209.L5 96,3 Ø 	T06345-00 0204.41 (8x) +0204.42 (9x) 	X00742-01 5 450 155 NBR 	N91300-00 5469955 P76531-00 0249.48 P76543-00 0956.05	X00837-01 4x 4x	4x	X00881-01 0349.F0 4x X07493-01 ⚠ 5 434 181 	X07498-01 7543388080B 	P76178-11 K ← 48x65x10 A NBR P76368-11 K → 26126699J 95x112x12,5 LD FPM P76051-01 N 95550398 29x46x10 LD MVQ
2,5 M25-659	100 kW (136 PS)	CX 25 Tri CX 25 Tri	07/83-12/92	S31065-00 ⑫ ⑬ 95603251+95496000 D31065-00 ⑫ 95603252+95496000 R30713-00 ③	H00864-00 94,5 Ø 		X07492-01 5412579F 	N91010-00 P76531-00 0249.48 P76543-00 0956.05	X06381-01 4x 4x	2x	X07494-01 5490878 4x X07493-01 ⚠ 5 434 181 	X07498-01 7543388080B 	P76368-11 K → 26126699J 95x112x12,5 LD FPM P76051-01 N 95550398 29x46x10 LD MVQ

CITROEN												
Ltr.												
2,8 F28TDCR	94 kW (128 PS)	JUMPER HDI	02/02-06/06		H08023-01 0209.0C 1,3 mm H18023-11 0209.0E 1,4 mm H28023-21 0209.0F 1,5 mm 	T07684-00 	X53812-01 0249.C3 		X07692-01 4x 		X07689-01 4x 	
2,8 8140.43S	93-94 kW (126-128 PS)	JUMPER JUMPER Bus HDI JUMPER HDI	09/00→	S38249-02 12 14 0197.Y2 D38249-02 12 	H08023-01 0209.0C 1,3 mm H18023-11 0209.0E 1,4 mm H28023-21 0209.0F 1,5 mm 		X53812-01 X 0249.C3 X59298-01 0249.A0 	N93138-00 P76804-00 8x	X07692-01 4x 		X51326-11 4x 0349.H5 X54494-01 X NBR X59306-01 Gummi 	
3,0 DT20C	177 kW (241 PS)	C5 HDI C6 HDI	04/09→		H40636-00 2x 0209.GX 85 Ø 1,17 mm 2 MLS H40636-10 2x 0209.GY 85 Ø 1,22 mm 3 MLS H40636-20 2x 0209.GZ 85 Ø 1,27 mm 4 MLS H40636-30 2x 0209.HA 85 Ø 1,32 mm 5 MLS 	T01902-00 2x 	X83359-01 2x 0249.E1 	N93132-00 24x 0956.53 (24x) P76843-00 0956.53		X82334-01 2x 0349.L0 X54926-01 2x 0164.75 X59640-01 0304.57 	P77681-01 K ← 0326.29 35x50x7 A SL RD PTFE ACM P77677-01 K → 0514.C0 P77624-01 N 0807.36 26x45x8 A SL WD FPM	
3,0 F1CE0481D (F30DT)	115-130 kW (156-177 PS)	JUMPER HDI JUMPER HDI 155 JUMPER HDI 160	09/06→	S37073-00 12 0197.AR S37073-03 12 13 D37073-00 12 0197.AQ D37073-03 12 	H80737-00 0209.FJ 1,1 mm MLS H80737-10 X 1,2 mm MLS H80737-20 X 1,3 mm MLS 	T38521-00 0204.C6 (6x) +0204.C7 (4x) +0204.C8 (4x) +0204.C9 (1x) 	X83071-01 0249.F7 	N91011-00 P76818-00 16x	X89001-01 0348.T7 		X81859-01 0349.L8 X54818-01 0304.59 NBR 	P77458-01 K ← 0514.C9 50x70x11 PTFE P77459-01 K → 0514.E4 90x120x13,65 FPM

CITROEN												
Ltr.												
3,0 SFZ (ZPJ/Z) UFZ (ZPJ/Z)	123 kW (167 PS) XM XM V6	05/89-10/00	S31114-00 ¹² ¹³ 95653027 D31114-00 ¹² 0197.E1 +0209.A4 +0209.A5 +0956.30 (12x) B31114-00 ¹³ R31114-00 ³	H08263-00 R 0209.A4 H08264-00 L 0209.A5 95 Ø 	T08263-00 0204.53 (16x) 	70-31414-10 	N91210-00 0956.22 (12x) P76531-00 0249.48 12x		X07897-01 2x X51325-01 6x 96 130 969 	70-31414-10 	P76152-01 K ← 42x62x10 A SL RD FPM P76345-01 K → 80x100x13 A SL LD MVQ P76128-11 N 2x 0236.24 32x45x8 A LD FPM	
3,0 SKZ (ZPJ4/Z) UKZ (ZPJ4/Z)	147 kW (200 PS) XM V6 24V	07/90-10/00	S31585-00 ¹² ¹³ 95659411 D31585-00 ¹² 95656101 B31585-00 ¹³ R31114-00 ³	H08263-00 R 0209.A4 H08264-00 L 0209.A5 95 Ø 	T08263-00 0204.53 (16x) 	70-31414-10 	N92920-00 P76532-00 0956.19 24x		X51247-01 ⁷ 2x 0349.74 	70-31414-10 	P76151-01 K ← 0326.12 42x62x7 A RD FPM P76345-01 K → 80x100x13 A SL LD MVQ P76128-11 N 2x 0236.24 32x45x8 A LD FPM	
3,0 XFU (ES9A) XFV (ES9A)	152-155 kW (207-211 PS) C5 C5 V6 C6 V6	09/04→		H08012-00 V 0209.OX 89 Ø 0,74 mm MLS H08013-00 H 0209.OY 89 Ø 0,74 mm MLS 		70-31414-10 	N92830-00 P76662-00 0956.38 24x	X89882-01 0348.Q0 X89883-01 2x 0348.P9 	X52329-01 2x 0349.G0 	70-31414-10 	P77682-01 K ← 0514.A9 42x56x6,5 A SL RD P77683-01 K → 0119.18 98x120x9 A SL LD P77623-01 N 4x 0807.34 38x50x7 A SL RD	

CITROEN												
Ltr.												
3,0 XFX (ES9J4S) 150-173 kW (204-235 PS)	C5 C5 Carlsson C5 V6 C6 V6 C8 V6	03/01→	D37116-00 ⁽¹²⁾ V D37117-00 ⁽¹²⁾ H D37118-00 ⁽¹²⁾ 2x B37213-00 ⁽¹³⁾ Mot.→10086 B37117-00 ⁽¹³⁾ Mot.10087→	H08012-00 V 0209.OX 89 Ø 0,74 mm MLS H18012-10 V 0209.OZ 89 Ø 0,95 mm MLS H08013-00 H 0209.OY 89 Ø 0,74 mm MLS H18013-10 H 0209.1A 89 Ø 0,95 mm MLS 	70-31414-10 	N92830-00 P76662-00 0956.38	24x X89882-01 0348.Q0 X89883-01 0348.P9 2x	X52329-01 0349.G0 2x	70-31414-10 	P76144-11 K ← 0514.82 42x56x7 A SL RD FPM Mot.→10086 P77682-01 K ← 0514.A9 42x56x6,5 A SL RD Mot.10087→ P76065-01 K → 0119.14 98x120x7 A SL LD FPM Mot.→10086 P77683-01 K → 0119.18 98x120x9 A SL LD Mot.10087→ P77141-01 N 4x 0807.24 38x50x6 A SL RD FPM		
3,0 XFX (ES9J4) 140 kW (190 PS)	XANTIA V6 XANTIA 24V XM V6	01/97-04/03	D37119-00 ⁽¹²⁾ R Mot.0008570→ D37120-00 ⁽¹²⁾ L Mot.0008570→ B37213-00 ⁽¹³⁾	H80044-00 L 0209.ON MLS Mot.0008570→ H80045-00 R 0209.OP 89 Ø MLS Mot.0008570→ 	70-31414-10 	N92830-00 P76662-00 0956.38	24x X58973-01 0348.L5 X58972-01 ⁽¹⁰⁾ 0348.K7 	X52329-01 0349.G0 2x	70-31414-10 	P76144-11 K ← 0514.82 42x56x7 A SL RD FPM P76065-01 K → 0119.14 98x120x7 A SL LD FPM P77141-01 N 4x 0807.24 38x50x6 A SL RD FPM		