

BMW														
Ltr.														
1,5 M 10 B 15	59 kW (80 PS)	1500	10/62-07/66	<b>B31420-00</b> <sup>(13)</sup> 11 11 1 734 114	<b>H01088-00</b> 11 12 9 065 653 86 Ø <b>H01088-10</b> 11129065655 		<b>X51201-01</b> 11 12 1 734 276 	<b>N93067-00</b> 11 34 1 256 556 (8x) <b>P76744-00</b> 11 34 1 256 556	<b>X55900-01</b> 11 61 1 734 435 <b>X55901-01</b> 11 61 1 734 436	8x	3x	<b>X51200-01</b> 11 62 1 723 838 <b>X51202-01</b> <sup>(A)</sup> 18 11 1 728 363	4x <b>X54101-01</b> 11 13 1 727 974 	<b>P76134-01 K</b> ← 11 14 1 709 632 35x55x11,5/12 FPM <b>P76345-01 K</b> → <sup>(50)</sup> 80x100x13 A SL LD MVQ <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
1,6 M 10 B 16	55 kW (75 PS)	1502 (E10)	01/75-07/77	<b>B31420-00</b> <sup>(13)</sup> 11 11 1 734 114	<b>H01088-00</b> 11 12 9 065 653 86 Ø <b>H01088-10</b> 11129065655 	<b>T01089-00</b> 11 12 0 621 144 (10x) 08/75 → 	<b>X51201-01</b> 11 12 1 734 276 	<b>N93067-00</b> 11 34 1 256 556 (8x) <b>P76744-00</b> 11 34 1 256 556	<b>X55900-01</b> 11 61 1 734 435 <b>X55901-01</b> 11 61 1 734 436	8x	3x	<b>X51200-01</b> 11 62 1 723 838 <b>X51202-01</b> <sup>(A)</sup> 18 11 1 728 363	4x <b>X54101-01</b> 11 13 1 727 974 	<b>P76134-01 K</b> ← 11 14 1 709 632 35x55x11,5/12 FPM <b>P76345-01 K</b> → <sup>(50)</sup> 80x100x13 A SL LD MVQ <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
1,6 M 10 B 16	55 kW (75 PS)	315 (E30)	09/82-12/91	<b>D31420-00</b> <sup>(12)</sup> 11 12 9 065 702 <b>B31420-00</b> <sup>(13)</sup> 11 11 1 734 114	<b>H01088-00</b> 11 12 9 065 653 86 Ø <b>H01088-10</b> 11129065655 	<b>T01089-00</b> 11 12 0 621 144 (10x) 	<b>X51201-01</b> 11 12 1 734 276 	<b>N90300-00</b> <b>P76531-00</b> 11 34 1 273 501	<b>X55900-01</b> 11 61 1 734 435 <b>X55901-01</b> 11 61 1 734 436	8x	3x	<b>X51200-01</b> 11 62 1 723 838 <b>X51202-01</b> <sup>(A)</sup> 18 11 1 728 363	4x <b>X54101-01</b> 11 13 1 727 974 	<b>P76134-01 K</b> ← 11 14 1 709 632 35x55x11,5/12 FPM <b>P76345-01 K</b> → <sup>(50)</sup> 80x100x13 A SL LD MVQ <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
1,6 M 10 B 16	59-77 kW (80-105 PS)	1500 1600 1600 (E6) 1600 GT 1600 Ti (E10) 1600/2 (E10) 1602 (E10)	09/63-07/75	<b>B31420-00</b> <sup>(13)</sup> 11 11 1 734 114	<b>H01088-00</b> 11 12 9 065 653 86 Ø <b>H01088-10</b> 11129065655 		<b>X51201-01</b> 11 12 1 734 276 	<b>N93067-00</b> 11 34 1 256 556 (8x) <b>P76744-00</b> 11 34 1 256 556	<b>X55900-01</b> 11 61 1 734 435 <b>X55901-01</b> 11 61 1 734 436	8x	3x	<b>X51200-01</b> 11 62 1 723 838 <b>X51202-01</b> <sup>(A)</sup> 18 11 1 728 363	4x <b>X54101-01</b> 11 13 1 727 974 	<b>P76134-01 K</b> ← 11 14 1 709 632 35x55x11,5/12 FPM <b>P76345-01 K</b> → <sup>(50)</sup> 80x100x13 A SL LD MVQ <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
1,6 M 40 B 16 M 40 B 16 C	73-75 kW (99-102 PS)			<b>D31436-00</b> <sup>(12)</sup> 11 12 1 734 267 <b>B31424-00</b> <sup>(13)</sup> 11 11 9 059 257	<b>H50230-00</b> 11 12 7 504 586 85 Ø <b>H50230-10</b> 11 12 7 504 632 85 Ø 	<b>T50230-00</b> 11 12 1 721 939 	<b>X53122-01</b> 11 12 1 727 726 	<b>N91190-00</b> <b>P76532-00</b> 11 34 1 288 544	<b>X56460-01</b> 11 61 1 734 683 <b>X56461-01</b> 11 61 1 721 346	8x	2x	<b>X51365-01</b> 11 62 1 716 703  <b>X51364-01</b> <sup>(A)</sup> 18 30 1 728 208	<b>X54105-01</b> 11 13 1 739 592  <b>X54102-01</b> <sup>(11)</sup> 11 13 1 709 815 	<b>P76232-01 K</b> ← 11 14 1 714 617 42x52x7,5/8 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76080-01 N</b> 11 12 1 285 609 38x50x7 A SL FPM

BMW												
Ltr.												
1,6 M 43 B 16	77 kW (105 PS) 316 Ci (E46) 316 i (E46)	04/00-07/06	<b>D36009-00</b> <sup>(12)</sup> <b>B36009-00</b> <sup>(13)</sup> 11 11 1 712 981	<b>H50230-00</b> 11 12 7 504 586 85 Ø <b>H50230-10</b> 11 12 7 504 632 85 Ø 	<b>T50230-00</b> 11 12 1 721 939 	<b>V38044-00</b> 11 12 1 432 885 +11 12 1 721 879 (10x) <b>X53303-01</b> 11 12 1 432 885 	<b>N91190-00</b> <b>P76532-00</b> 11 34 1 288 544 8x	<b>X58950-01</b> 11 61 1 437 384 4x 	<b>X52314-01</b> 11 62 1 743 719 	<b>X54472-01</b> 11 13 1 432 109 	<b>P76255-01 K</b> ← 11 14 1 435 848 44x60x10 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
1,6 N 13 B 16 A	75-125 kW (102-170 PS) 114 i (F20) 114 i (F21) 116 i (F20) 116 i (F21) 118 i (F20) 118 i (F21) 316 i (F30) 316 i (F31) 320 i (F30)	11/10→	<b>D38785-01</b> 11 12 2 250 713 	<b>H40634-00</b> 11 12 7 595 138 78 Ø 0,9 mm MLS <b>H40634-10</b> ✕ 11 12 7 586 908 78 Ø 1,3 mm MLS 	<b>T40616-00</b> 11 12 7 560 274 	<b>V38785-00</b> 11 12 7 582 400 	<b>N93158-00</b> 11 34 0 033 950 <b>P93158-00</b> 16x 	<b>M59583-00</b> 11 61 7 528 340 (4x) <b>X71053-01</b> <sup>(10)</sup> 11 61 7 528 341 		<b>70-31414-10</b> 	<b>P77789-01 K</b> ← 11 11 7 568 264 61x75x8 A SL RD <b>P77670-01 K</b> → 11 11 7 568 263 85x105x8 A SL LD	
1,6 N 40 B 16 A N 45 B 16 A	85 kW (115 PS) 316 Ci (E46) 316 i (E46) 316 ti (E46)	06/02-07/06	<b>D36846-00</b> <sup>(12)</sup> 11 12 0 143 667 	<b>H80670-00</b> 11 12 7 509 710 84,5 Ø 0,4 mm MLS <b>H80670-01</b> 11 12 7 509 711 84,5 Ø 0,7 mm MLS 	<b>T80670-00</b> 11 12 7 511 534 	<b>V36846-00</b> 11 12 0 031 987 	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417 16x 	<b>M38076-00</b> 11 61 7 530 703 	<b>X82039-01</b> 18 40 7 506 778 	<b>X54785-01</b> 11 13 7 511 224 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
1,6 N 43 B 16 A	89-90 kW (121-122 PS) 116 i (E81) 116 i (E81, E87) 116 i (E87) 316 i (E90) 316 i (E91) 316 i (E92)	03/07-12/13	<b>B36846-00</b> <sup>(13)</sup> 11 11 7 511 529 	<b>H40753-00</b> 11 12 7 563 413 82,8 Ø 0,5 mm MLS <b>H40753-10</b> 11 12 7 578 094 82,8 Ø 0,8 mm MLS 	<b>T40366-00</b> 11 12 7 578 077 	<b>V38780-00</b> 	<b>N93204-00</b> 11 34 0 035 888 	<b>M38779-00</b> 11 61 7 546 983 	<b>X82341-01</b> 18 40 7 530 606 	<b>X54785-01</b> 11 13 7 511 224 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77874-01 K</b> → 11 11 7 511 396 90x110x12 AB SL LD	
1,6 N 45 B 16 N 45 B 16 TU2	85-90 kW (115-122 PS) 316 i (E46) 316 i (E46)		<b>D38077-00</b> <sup>(12)</sup> 11 12 0 391 679 	<b>H80670-00</b> 11 12 7 509 710 84,5 Ø 0,4 mm MLS <b>H80670-01</b> 11 12 7 509 711 84,5 Ø 0,7 mm MLS 	<b>T80670-00</b> 11 12 7 511 534 	<b>V36846-00</b> 11 12 0 031 987 	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417 16x 	<b>M38078-00</b> 11 61 7 528 584 	<b>X82343-01</b> 18 30 7 540 797 	<b>X54785-01</b> 11 13 7 511 224 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	

BMW												
Ltr.												
1,6 N 45 B 16 A	85 kW (115 PS)	116 i (E87)	03/07-09/12	<p><b>D36846-00</b> <sup>12</sup> 11 12 0 143 667</p> <p><b>B36846-00</b> <sup>13</sup> 11 11 7 511 529</p>	<p><b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS 02/07→</p> <p><b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS 02/07→</p>	<p><b>T40366-00</b> 11 12 7 578 077 03/07→</p>	<p><b>V36846-00</b> 11 12 0 031 987</p>	<p><b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417</p>	<p><b>M38076-00</b> 11 61 7 530 703</p> <p>16x</p>	<p><b>X82039-01</b> 18 40 7 506 778</p> <p><b>X82040-01</b> <sup>13</sup> 18 30 7 506 779</p>	<p><b>X54785-01</b> 11 13 7 511 224</p>	<p><b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>
1,6 N 45 B 16 A	85 kW (115 PS)	116 i (E87) 316 i (E90)	11/03-09/12	<p><b>D36846-00</b> <sup>12</sup> 11 12 0 143 667</p> <p><b>B36846-00</b> <sup>13</sup> 11 11 7 511 529</p>	<p><b>H80670-00</b> 11 12 7 509 710 84,5 Ø 0,4 mm MLS →01/07</p> <p><b>H80670-01</b> 11 12 7 509 711 84,5 Ø 0,7 mm MLS →01/07</p> <p><b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS 02/07→</p> <p><b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS 02/07→</p>	<p><b>T80670-00</b> 11 12 7 511 534 →01/07</p> <p><b>T40366-00</b> 11 12 7 578 077 02/07→</p>	<p><b>V36846-00</b> 11 12 0 031 987</p>	<p><b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417</p>	<p><b>M38076-00</b> 11 61 7 530 703</p> <p>16x</p>	<p><b>X82039-01</b> 18 40 7 506 778</p> <p><b>X82040-01</b> <sup>13</sup> 18 30 7 506 779</p>	<p><b>X54785-01</b> 11 13 7 511 224</p>	<p><b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>
1,6 N 47 D 16 A	70-85 kW (95-116 PS)	114 d (F20) 114 d (F21) 116 d (F20) 116 d (F21)	12/11→	<p><b>H40755-00</b> 11 12 8 509 149 78,7 Ø 0,95 mm 1 □ MLS</p> <p><b>H40755-10</b> 11 12 8 509 150 78,7 Ø 1,05 mm 2 □ MLS</p> <p><b>H40755-20</b> 11 12 8 509 151 78,7 Ø 1,15 mm 3 □ MLS</p>	<p><b>T38791-00</b> 11 12 8 513 128</p>	<p><b>V38782-00</b> 11 12 8 511 814</p>	<p><b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b></p>	<p><b>X71035-01</b> 11 61 8 506 407</p> <p>16x</p>	<p><b>X82358-01</b> 11 62 8 509 783</p> <p><b>X71045-01</b> <sup>13</sup> 11 65 7 800 596</p>	<p><b>70-31414-10</b></p>	<p><b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM</p> <p><b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM</p>	

BMW													
Ltr.													
1,8 M 10 B 18	66 kW (90 PS)	1800 1802 (E10) 1802 (E6) 2000	07/69-07/75	<b>D36907-00</b> <sup>(12)</sup> <b>B31420-00</b> <sup>(13)</sup> 11 11 1 734 114	<b>H01089-00</b> 11 12 1 734 279 90 Ø <b>H01089-10</b> 11 12 1 734 280 90 Ø 	<b>T01089-00</b> 11 12 0 621 144 (10x) 	<b>X51201-01</b> 11 12 1 734 276 	<b>N93067-00</b> 11 34 1 256 556 (8x) <b>P76744-00</b> 11 34 1 256 556	<b>X55900-01</b> 11 61 1 734 435 <b>X55901-01</b> 11 61 1 734 436	<b>X51200-01</b> 11 62 1 723 838 <b>X51202-01</b> <sup>(10)</sup> 18 11 1 728 363	<b>X54101-01</b> 11 13 1 727 974	<b>P76134-01 K</b> ← 11 14 1 709 632 35x55x11,5/12 FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
1,8 M 40 B 18 C	103 kW (140 PS)	318i (E30)	06/88-02/92	<b>D31436-00</b> <sup>(12)</sup> 11 12 1 734 267 <b>B31424-00</b> <sup>(13)</sup> 11 11 9 059 257 →06/91 <b>B31663-00</b> <sup>(13)</sup> 11 11 1 734 268 07/91→	<b>H50230-00</b> 11 12 7 504 586 85 Ø <b>H50230-10</b> 11 12 7 504 632 85 Ø 	<b>T50230-00</b> 11 12 1 721 939 	<b>X53122-01</b> 11 12 1 727 726 	<b>N91190-00</b> <b>P76532-00</b> 11 34 1 288 544	<b>X56460-01</b> 11 61 1 734 683 <b>X56461-01</b> 11 61 1 721 346	<b>X51365-01</b> 11 62 1 716 703  <b>X51364-01</b> <sup>(10)</sup> 18 30 1 728 208	<b>X54105-01</b> 11 13 1 739 592  <b>X54102-01</b> <sup>(11)</sup> 11 13 1 709 815 →06/91 <b>X54104-01</b> <sup>(11)</sup> 07/91→ 	<b>P76232-01 K</b> ← 11 14 1 714 617 42x52x7,5/8 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76080-01 N</b> 11 12 1 285 609 38x50x7 A SL FPM	
1,8 M 42 B 18	100-103 kW (136-140 PS)			<b>D31664-00</b> <sup>(12)</sup> 11 12 9 063 333 →09/92 <b>D32246-00</b> <sup>(12)</sup> 11 12 9 065 439 10/92→ <b>B31664-00</b> <sup>(13)</sup> 11 11 1 727 595 →09/93 <b>B32247-00</b> <sup>(13)</sup> 11 11 9 066 436 09/93→	<b>H50231-00</b> 11 12 1 721 546 85 Ø 	<b>T50230-00</b> 11 12 1 721 939 	<b>V31664-00</b> 11 12 1 721 876 +11 12 1 721 475 +11 12 1 721 476 (3x) 	<b>N91190-00</b> →09/92 <b>N92990-00</b> 09/92→ <b>P76532-00</b> 11 34 1 288 544 →09/92 <b>P76662-00</b> 11 34 2 245 151 09/92→	<b>X56480-01</b> 11 61 1 734 684 <b>X57909-01</b> <sup>(10)</sup> 11 61 1 739 545 09/93→ <b>X57909-01</b> <sup>(10)</sup> 11 61 1 739 545 <b>X89139-01</b> <sup>(10)</sup> 11 61 1 717 761	<b>X51361-01</b> 11 62 1 728 983 <b>X51366-01</b> <sup>(10)</sup> 18 30 1 711 969	<b>X54105-01</b> 11 13 1 739 592  <b>X54104-01</b> <sup>(11)</sup> 	<b>P76255-01 K</b> ← 11 14 1 435 848 44x60x10 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
1,8 N 46 B 18 A	85 kW (115 PS)	316 i (E46) 316 ti (E46)	06/01-02/05	<b>D37110-00</b> <sup>(12)</sup> 11 12 0 308 857  <b>B36846-00</b> <sup>(13)</sup> 11 11 7 511 529	<b>H80670-00</b> 11 12 7 509 710 84,5 Ø 0,4 mm MLS <b>H80670-01</b> 11 12 7 509 711 84,5 Ø 0,7 mm MLS 	<b>T80670-00</b> 11 12 7 511 534 	<b>V37110-00</b> 11 12 0 032 224  <b>V90283-00</b> 11 12 0 032 224	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417	<b>M38076-00</b> 11 61 7 530 703 	<b>X82039-01</b> 18 40 7 506 778 <b>X82040-01</b> <sup>(10)</sup> 18 30 7 506 779	<b>X54785-01</b> 11 13 7 511 224 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	

BMW													
Ltr.			<b>1</b>										
1,9 M 43 B 19 (194E1)	77-87 kW (105-118 PS)	Z3 1.9 (E36) 316 i (E36) 316 i (E46) 318 Ci (E46) 318 i (E46)	02/98-02/05	<b>D36011-00</b> ⑫ 11 12 1 712 309 <b>B36009-00</b> ⑬ 11 11 1 712 981	<b>H80006-00</b> 11 12 1 708 585 86 Ø 1,74 mm <b>H80006-10</b> ✕ 11 12 1 708 606 86 Ø 2,1 mm 	<b>T50230-00</b> 11 12 1 721 939 	<b>V38044-00</b> 11 12 1 432 885 +11 12 1 721 879 (10x) <b>X53303-01</b> 11 12 1 432 885 	<b>N91190-00</b>	<b>X58950-01</b> 11 61 1 437 384 4x  <b>X58951-01</b> ⑩ 11 61 1 437 383 4x 	<b>X52314-01</b> 11 62 1 743 719 	<b>X54472-01</b> 11 13 1 432 109 	<b>P76255-01 K</b> ← 11 14 1 435 848 44x60x10 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
1,9 M 43 B 194 E1	85-87 kW (116-118 PS)			<b>D36011-00</b> ⑫ 11 12 1 712 309 <b>B36009-00</b> ⑬ 11 11 1 712 981	<b>H80006-00</b> 11 12 1 708 585 86 Ø 1,74 mm <b>H80006-10</b> ✕ 11 12 1 708 606 86 Ø 2,1 mm 	<b>T50230-00</b> 11 12 1 721 939 	<b>V38044-00</b> 11 12 1 432 885 +11 12 1 721 879 (10x) <b>X53303-01</b> 11 12 1 432 885 	<b>N92990-00</b> <b>P76532-00</b> 11 34 1 288 544	<b>X58950-01</b> 11 61 1 437 384 8x  <b>X58951-01</b> ⑩ 11 61 1 437 383 4x 	<b>X52314-01</b> 11 62 1 743 719  <b>X51364-01</b> ⚠ 18 30 1 728 208 	<b>X54472-01</b> 11 13 1 432 109 	<b>P76255-01 K</b> ← 11 14 1 435 848 44x60x10 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
1,9 M 44 B 19 (194S1)	103 kW (140 PS)	Z3 1.9 i (E36) 318 is (E36) 318 ti (E36)	07/95-08/00	<b>D32682-00</b> ⑫ 11 12 1 743 375 →09/96 <b>D36659-00</b> ⑫ 11 12 9 070 615 10/96→ <b>B32682-00</b> ⑬ 11 11 1 743 981	<b>H50752-00</b> 11 12 1 433 950 86 Ø 	<b>T50230-00</b> 11 12 1 721 939 	<b>V31664-00</b> 11 12 1 721 876 +11 12 1 721 475 +11 12 1 721 476 (3x) 	<b>N92990-00</b> <b>P76662-00</b> 11 34 2 245 151	<b>X56480-01</b> 11 61 1 734 684 16x  <b>X58952-01</b> ⑩ 11 61 1 247 478 2x 	<b>X51361-01</b> 11 62 1 728 983  <b>X81907-01</b> 11 62 1 435 366  <b>X51217-01</b> ⚠ →09/96  <b>X51366-01</b> ⚠ 18 30 1 711 969 10/96→ 	2x <b>X54797-01</b> 11 13 1 739 813 	<b>P76255-01 K</b> ← 11 14 1 435 848 44x60x10 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
2,0 M 10 B 20	74-96 kW (100-131 PS)	2000 2000 C/CA (E9) 2000 CS (E9) 2000 Ti 2000 Tii 2002 (E10) 2002 (E6) 2002 Ti (E10) 2002 Tii (E10) 2002 Tii (E6) 320 (E21) 320 i (E21) 518 (E12) 518 i (E12) 520 (E12) 520 i (E12)	10/65-08/82	<b>D36908-00</b> ⑫ 11 12 9 065 721 <b>B31420-00</b> ⑬ 11 11 1 734 114	<b>H01089-00</b> 11 12 1 734 279 90 Ø <b>H01089-10</b> 11 12 1 734 280 90 Ø 	<b>T50230-00</b> 11 12 1 721 939 	<b>X51201-01</b> 11 12 1 734 276 	<b>N93067-00</b> 11 34 1 256 556 (8x) <b>P76744-00</b> 11 34 1 256 556	<b>X55900-01</b> 11 61 1 734 435 8x  <b>X55901-01</b> 11 61 1 734 436 3x 	<b>X51200-01</b> 11 62 1 723 838  <b>X51202-01</b> ⚠ 18 11 1 728 363 	4x <b>E31420-00</b> <b>X54101-01</b> 11 13 1 727 974 	<b>P76134-01 K</b> ← 11 14 1 709 632 35x55x11,5/12 FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
2,0 M 10 B 20 Turbo, Schäfer PLO4 inj.	125 kW (170 PS)	2002 Turbo (E10)	01/74-07/75	<b>D36910-00</b> ⑫ 11 12 9 065 724 01/75→ <b>B31420-00</b> ⑬ 11 11 1 734 114	<b>H01089-00</b> 11 12 1 734 279 90 Ø <b>H01089-10</b> 11 12 1 734 280 90 Ø 	<b>T01089-00</b> 11 12 0 621 144 (10x) 	<b>X51201-01</b> 11 12 1 734 276 	<b>P76744-00</b> 11 34 1 256 556 01/75→	8x <b>X55900-01</b> 11 61 1 734 435  <b>X55901-01</b> 11 61 1 734 436 3x 	<b>X81754-01</b> 11 62 1 723 839  <b>X51202-01</b> ⚠ 18 11 1 728 363 	4x <b>E31420-00</b> <b>X54101-01</b> 11 13 1 727 974 	<b>P76134-01 K</b> ← 11 14 1 709 632 35x55x11,5/12 FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	

BMW													
Ltr.													
2,0 M 20 B 20	93 kW (126 PS)	320 i (E30)	04/86-10/93	<b>D31425-00</b> <sup>(12)</sup> 11 12 9 059 248 <b>B31425-00</b> 11 11 1 730 875	<b>H50052-00</b> 11 12 1 722 725 81,3 Ø <b>H50052-10</b> 11 12 1 722 726 81,3 Ø 	<b>T50052-00</b> 11 12 1 726 478 	<b>X51207-01</b> 11 12 1 730 229 	<b>N92450-00</b> 11 34 9 059 172 <b>P76532-00</b> 11 34 1 288 544	<b>X55915-01</b> 11 61 1 730 787 4x  <b>X55916-01</b> 11 61 1 730 743 	<b>X51206-01</b> 6x  <b>X51208-01</b> <sup>(10)</sup> 11 76 1 711 717 2x 	<b>X54100-01</b> 11 13 1 730 234 2x 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76080-01 N</b> 11 12 1 285 609 38x50x7 A SL FPM	
2,0 M 47 D 20 M 47 204 D1	85-100 kW (116-136 PS)			<b>D36013-00</b> <sup>(12)</sup> 11 12 2 247 501  <b>B36013-00</b> <sup>(13)</sup>	<b>H05132-00</b> 11 12 2 247 498 1,45 mm 1 MLS <b>H15132-10</b> 11 12 2 247 499 1,55 mm 2 MLS <b>H25132-20</b> 11 12 2 247 500 84,5 Ø 1,65 mm 3 MLS 	<b>T05835-00</b> 11 12 9 067 792 	<b>X53723-01</b> 11 12 2 246 996 	<b>N92634-00</b> 11 34 9 070 982 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 11 61 7 790 198 4x  <b>X89855-01</b> <sup>(10)</sup> 11 61 2 246 945 4x 	<b>X52316-01</b> 11 62 7 796 480 2x  <b>X51371-01</b> <sup>(10)</sup> 11 62 2 244 515 	<b>X54470-01</b> 11 13 8 070 005 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
2,0 M 47 D 20 TU M 47 N 204 D4 M 47 N 204 D5	85-130 kW (116-177 PS)			<b>D36847-00</b> <sup>(12)</sup> 11 12 7 788 072  <b>B38117-00</b> <sup>(13)</sup> 11 11 0 394 505	<b>H01312-00</b> 11 12 7 790 052 1,45 mm 1 MLS <b>H11312-10</b> 11 12 7 790 053 1,55 mm 2 MLS <b>H21312-20</b> 11 12 7 790 054 1,65 mm 3 MLS 	<b>T05835-00</b> 11 12 9 067 792 	<b>X83078-01</b> 11 12 7 794 495 	<b>N92634-00</b> 11 34 9 070 982 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 11 61 7 790 198 4x  <b>X89855-01</b> <sup>(10)</sup> 11 61 2 246 945 4x 	<b>X81624-01</b> 2x 	<b>X54929-01</b> 11 13 0 139 259 	<b>P77396-01 K</b> ← 55x68x8 AB RD PTFE <b>P77480-01 K</b> → 11 14 7 787 262	
2,0 M 47 D 20 (204D4)	85-130 kW (115-177 PS)	X3 2.0 d (E83) 118 d (E87) 118 d (E87) 120 d (E87) 318 d (E46) 318 d (E90) 318 d (E91) 318 td (E46) 320 Cd (E46) 320 d (E46) 320 d (E90) 320 d (E91) 320 td (E46) 520 d (E60) 520 d (E61)	09/01-09/12	<b>D36847-00</b> <sup>(12)</sup> 11 12 7 788 072  <b>B38117-00</b> <sup>(13)</sup> 11 11 0 394 505	<b>H01312-00</b> 11 12 7 790 052 1,45 mm 1 MLS <b>H11312-10</b> 11 12 7 790 053 1,55 mm 2 MLS <b>H21312-20</b> 11 12 7 790 054 1,65 mm 3 MLS 	<b>T05835-00</b> 11 12 9 067 792 	<b>X83078-01</b> 11 12 7 794 495 	<b>N92634-00</b> 11 34 9 070 982 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 11 61 7 790 198 4x  <b>X89855-01</b> <sup>(10)</sup> 11 61 2 246 945 4x 	<b>X52316-01</b> 11 62 7 796 480 2x 	<b>X54929-01</b> 11 13 0 139 259 	<b>P77396-01 K</b> ← 55x68x8 AB RD PTFE <b>P77480-01 K</b> → 11 14 7 787 262	

BMW													
2,0 M 47 D 20 (204D4)	110 kW (150 PS)	520 d (E61)	09/05-12/10	<b>D36847-00</b> <sup>12</sup> 11 12 7 788 072  <b>B38117-00</b> <sup>13</sup> 11 11 0 394 505	<b>H01312-00</b> 11 12 7 790 052 1,45 mm 1 MLS <b>H11312-10</b> 11 12 7 790 053 1,55 mm 2 MLS <b>H21312-20</b> 11 12 7 790 054 1,65 mm 3 MLS 	<b>T05835-00</b> 11 12 9 067 792 	<b>X83078-01</b> 11 12 7 794 495 	<b>P76702-00</b> 11342247171	16x <b>X58955-01</b> 11 61 7 790 198  4x <b>X89855-01</b> <sup>10</sup> 11 61 2 246 945  4x	<b>X52316-01</b> 11 62 7 796 480  2x <b>X54929-01</b> 11 13 0 139 259 	<b>P77396-01 K</b> ← 55x68x8 AB RD PTFE <b>P77480-01 K</b> → 11 14 7 787 262		
2,0 M 50 B 20 M 50 B (206 S1) M 50 B (206 S2) Vanos M 50 B20 TU	110 kW (150 PS)		07/89→	<b>D31668-00</b> <sup>12</sup> 11 12 1 730 252 →09/92 <b>D32248-00</b> <sup>12</sup> 11 12 9 064 466 10/92→ <b>B31668-00</b> <sup>13</sup> 11111730251	<b>H50234-00</b> 11 12 1 726 623 81 Ø <b>H50234-30</b> 11 12 1 726 626 81 Ø 	<b>T50234-00</b> 11 12 1 721 938 	<b>V31668-00</b> 11 12 9 070 530 →09/92  <b>V32248-00</b> 11 12 9 070 531 10/92→ 	<b>N91190-00</b> →09/92 <b>N92830-00</b> 11 34 9 064 457 10/92→ <b>P76532-00</b> 11 34 1 288 544 →09/92 <b>P76662-00</b> 11 34 2 245 151 10/92→	3x <b>X56501-01</b> 11 61 1 720 740  6x <b>X51361-01</b> 11 62 1 728 983 <b>X51368-01</b> 18 30 1 716 888  2x <b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM			
2,0 M 52 B 20 M 52 B (206 S3) Vanos	100-110 kW (136-150 PS)			<b>D32249-00</b> <sup>12</sup> 11 12 1 740 982 →09/95 <b>D32250-00</b> <sup>12</sup> 11 12 1 427 825 10/95-09/98 <b>D36012-00</b> <sup>12</sup> 11 12 1 436 821 +11 62 1 732 969 (2x) 10/98→ <b>B32249-00</b> <sup>13</sup> 11 11 1 740 981 →09/98 <b>B36012-00</b> <sup>13</sup> 11 11 1 432 478 10/98→	<b>H50234-00</b> 11 12 1 726 623 81 Ø →09/98 <b>H50234-30</b> 11 12 1 726 626 81 Ø →09/98  <b>H80008-00</b> 11 12 7 506 983 81 Ø MLS 10/98→ 	<b>T80039-00</b> 11 12 1 740 065 	<b>V32248-00</b> 11 12 9 070 531 →09/95  <b>V32250-00</b> 11 12 9 070 532 10/95-09/98  <b>V36012-00</b> 11 12 9 070 990 10/98→ 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151	24x <b>M36012-00</b> 11 61 1 436 631 10/98→  <b>X57680-01</b> 11 61 1 740 069 →09/98  2x	<b>X51644-01</b> 11 62 1 744 252 →09/98  2x <b>X52315-01</b> 11 62 1 732 969 10/98→  2x <b>X51368-01</b> 18 30 1 716 888  2x	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM		
2,0 N 20 B 20 A	115-180 kW (156-245 PS)	X1 2.0 i (E84) X1 2.8 i (E84) X3 2.0 i (F25) X3 2.8 i (F25) Z4 1.8 i (E89) Z4 2.0 i (E89) Z4 2.8 i (E89) 125 i (F20) 125 i (F21) 320 i (F30) 320 i (F34) 328 i (F30) 328 i (F31) 328 i (F34) 428 i (F32) 520 i (F10) 520 i (F11) 528 i (F10) 528 i (F11)	04/11→	<b>H40754-00</b> 11 12 7 620 697 85,1 Ø 0,7 mm MLS <b>H40754-10</b> 11 12 7 620 698 85,1 Ø 1 mm MLS 	<b>T38789-00</b> 11 12 2 212 157 	<b>V38784-00</b> 11 12 7 588 418 	<b>N93202-00 ES</b> 11 34 0 038 719 <b>N93203-00 AS</b> 11 34 0 038 720	<b>M38792-00</b> 11 61 2 297 462  4x	<b>X59998-01</b> 11 65 7 625 293  4x <b>X59999-01</b> 11 13 7 627 511 	<b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 A LD FPM			

BMW												
Ltr.												
2,0 N 20 B 20 B N 26 B 20 A	135-180 kW (184-245 PS)	320 i (F31) 320 i (F34) 328 i (F30) 420 i (F32) 428 i (F32)	10/11→		<p><b>H40754-00</b> 11 12 7 620 697 85,1 Ø 0,7 mm MLS <b>H40754-10</b> 11 12 7 620 698 85,1 Ø 1 mm MLS</p>	<p><b>T38789-00</b> 11 12 2 212 157</p>	<p><b>V38784-00</b> 11 12 7 588 418</p>	<p><b>N93202-00 ES</b> 11 34 0 038 719 <b>N93203-00 AS</b> 11 34 0 038 720</p>	<p><b>M38792-00</b> 11 61 2 297 462</p>	<p><b>X59998-01</b> 11 65 7 625 293</p>	<p>4x <b>X59997-01</b> 11 13 7 627 512</p>	<p><b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 ALD FPM</p>
2,0 N 42 B 20 N 46 B 20 A	105-115 kW (143-156 PS)	Z4 2.0 i (E85) 120 i (E87) 318 Ci (E46) 320 i (E90) 320 i (E92)	09/01→	<p><b>D37110-00</b> <sup>12</sup> 11 12 0 308 857</p> <p><b>B36846-00</b> <sup>13</sup> 11 11 7 511 529</p>	<p><b>H80670-00</b> 11 12 7 509 710 84,5 Ø 0,4 mm MLS →01/07</p> <p><b>H80670-01</b> 11 12 7 509 711 84,5 Ø 0,7 mm MLS →01/07</p> <p><b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS 02/07→</p> <p><b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS 02/07→</p>	<p><b>T80670-00</b> 11 12 7 511 534 →01/07</p> <p><b>T40366-00</b> 11 12 7 578 077 02/07→</p>	<p><b>V37110-00</b> 11 12 0 032 224</p> <p><b>V90283-00</b> 11 12 0 032 224</p>	<p><b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417</p>	<p><b>M38076-00</b> 11 61 7 530 703</p> <p>16x</p>	<p><b>X82039-01</b> 18 40 7 506 778</p> <p><b>X82040-01</b> <sup>13</sup> 18 30 7 506 779</p>	<p><b>X54785-01</b> 11 13 7 511 224</p>	<p><b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>



BMW												
Ltr.    1 2,0 N 42 B 20 A 95-125 kW X3 2.0 i (E83) N 42 B 20 B (129-170 PS) Z4 2.0 i (E85) N 46 B 20 118 i (E81) N 46 B 20 B 120 i (E81, E87) 120 i (E87) 318 Ci (E46) 318 i (E90) 318 i (E91) 320 i (E90)	09/01→	<b>D37110-01</b> <sup>12</sup> 11 12 0 391 974  <b>B36846-00</b> <sup>13</sup> 11 11 7 511 529	<b>H80670-00</b> 11 12 7 509 710 84,5 Ø 0,4 mm MLS →01/07  <b>H80670-01</b> 11 12 7 509 711 84,5 Ø 0,7 mm MLS →01/07  <b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS 02/07→ <b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS 02/07→ 	<b>T80670-00</b> 11 12 7 511 534 →01/07  <b>T40366-00</b> 11 12 7 578 077 02/07→ 	<b>V37110-00</b> 11 12 0 032 224  <b>V90283-00</b> 11 12 0 032 224	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417	<b>M38078-00</b> 11 61 7 528 584 16x 	<b>X82343-01</b> 18 30 7 540 797  <b>X82367-01</b> <sup>14</sup> 18 30 7 540 798 	<b>X54785-01</b> 11 13 7 511 224 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM		
2,0 N 42 B 20 A 105 kW (143 PS) 318 Ci (E46) 318 i (E46) 318 ti (E46)	09/01-07/06	<b>D37110-01</b> <sup>12</sup> 11 12 0 391 974  <b>B36846-00</b> <sup>13</sup> 11 11 7 511 529	<b>H80670-00</b> 11 12 7 509 710 84,5 Ø 0,4 mm MLS <b>H80670-01</b> 11 12 7 509 711 84,5 Ø 0,7 mm MLS 	<b>T80670-00</b> 11 12 7 511 534 	<b>V37110-00</b> 11 12 0 032 224  <b>V90283-00</b> 11 12 0 032 224	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417	<b>M38078-00</b> 11 61 7 528 584 16x 	<b>X82343-01</b> 18 30 7 540 797  <b>X82367-01</b> <sup>14</sup> 18 30 7 540 798 	<b>X54785-01</b> 11 13 7 511 224 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM		
2,0 N 43 B 20 A 90-125 kW (122-170 PS) 116 i (E81, E87) 116 i (E87) 118 i (E81, E87) 118 i (E87) 118 i (E88) 120 i (E81, E87) 120 i (E82) 120 i (E87) 120 i (E88) 318 i (E30) 318 i (E91) 318 i (E92) 318 i (E93) 320 i (E90) 320 i (E91) 320 i (E92) 320 i (E93) 520 i (E60) 520 i (E61)	11/03-12/13	<b>B36846-00</b> <sup>13</sup> 11 11 7 511 529	<b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS <b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS 	<b>T40366-00</b> 11 12 7 578 077 	<b>V38780-00</b>  <b>X71034-01</b> 11 12 7 555 738 	<b>N93204-00</b> 11 34 0 035 888	<b>M38779-00</b> 11 61 7 546 983 	<b>X82341-01</b> 18 40 7 530 606  <b>X59992-01</b> <sup>14</sup> 18 30 7 567 685 	4x <b>X54785-01</b> 11 13 7 511 224  2x	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM		

BMW													
Ltr.													
2,0 N 43 B 20 A 125 kW (170 PS)	120 i (E81, E87)	09/06-09/12											
				<b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS	<b>T40366-00</b> 11 12 7 578 077	<b>V38780-00</b>  <b>X71034-01</b> 11 12 7 555 738	<b>N93204-00</b> 11 34 0 035 888	<b>M38779-00</b> 11 61 7 546 983	<b>X82341-01</b> 18 40 7 530 606	4x <b>X54785-01</b> 11 13 7 511 224	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM		
2,0 N 45 B 20 A 127 kW (173 PS)	320 si (E90)	05/06-12/11		<b>D38805-00</b> 11 12 7 557 935  <b>B36846-00</b> <sup>13</sup> 11 11 7 511 529	<b>H40756-00</b> 11 12 7 557 933 87 Ø 1 mm MLS	<b>T38790-00</b> 11 12 7 557 934	<b>V38803-00</b> 11 12 0 033 999 FPM	<b>N93201-00</b> <b>P76973-00</b> 11 34 1 340 849	16x <b>M38806-00</b> 11 61 7 547 645	<b>X59993-01</b> 18 40 7 548 533 <b>X82368-01</b> <sup>13</sup> 18 40 7 527 796	<b>X54785-01</b> 11 13 7 511 224	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77874-01 K</b> → 11 11 7 511 396 90x110x12 AB SL LD	
2,0 N 46 B 20 A 105-110 kW (143-150 PS)	318 Ci (E46) 318 i (E46) 318 ti (E46)	09/01-07/06		<b>D37110-00</b> <sup>12</sup> 11 12 0 308 857  <b>B36846-00</b> <sup>13</sup> 11 11 7 511 529	<b>H80670-00</b> 11 12 7 509 710 84,5 Ø 0,4 mm MLS <b>H80670-01</b> 11 12 7 509 711 84,5 Ø 0,7 mm MLS	<b>T80670-00</b> 11 12 7 511 534	<b>V37110-00</b> 11 12 0 032 224  <b>V90283-00</b> 11 12 0 032 224	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417	16x <b>M38076-00</b> 11 61 7 530 703	<b>X82039-01</b> 18 40 7 506 778 <b>X82040-01</b> <sup>13</sup> 18 30 7 506 779	<b>X54785-01</b> 11 13 7 511 224	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
2,0 N 46 B 20 A 110 kW (149 PS)	320 i (E93)	03/07-08/07		<b>D37110-00</b> <sup>12</sup> 11 12 0 308 857  <b>B36846-00</b> <sup>13</sup> 11 11 7 511 529	<b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS 02/07→ <b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS 02/07→	<b>T40366-00</b> 11 12 7 578 077 02/07→	<b>V37110-00</b> 11 12 0 032 224  <b>V90283-00</b> 11 12 0 032 224	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417	16x <b>M38076-00</b> 11 61 7 530 703	<b>X82039-01</b> 18 40 7 506 778 <b>X82040-01</b> <sup>13</sup> 18 30 7 506 779	<b>X54785-01</b> 11 13 7 511 224	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
2,0 N 46 B 20 B 100 kW (136 PS)	318 i (E91)	09/07-06/12		<b>D37110-01</b> <sup>12</sup> 11 12 0 391 974  <b>B36846-00</b> <sup>13</sup> 11 11 7 511 529	<b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS 02/07→ <b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS 02/07→	<b>T40366-00</b> 11 12 7 578 077 02/07→	<b>V37110-00</b> 11 12 0 032 224  <b>V90283-00</b> 11 12 0 032 224	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417	16x <b>M38078-00</b> 11 61 7 528 584	<b>X82343-01</b> 18 30 7 540 797 <b>X82367-01</b> <sup>13</sup> 18 30 7 540 798	<b>X54785-01</b> 11 13 7 511 224	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	

BMW												
<p>Ltr. </p> <p>2,0 N 46 B 20 B 100-115 kW (136-156 PS)</p> <p>X1 1.8 i (E84) X3 2.0 i (E83) 120 i (E82) 120 i (E88) 320 i (E90) 320 i (E92) 320 i (E93) 520 i (E60)</p> <p>04/06-06/15</p> <p><b>D37110-01</b> <sup>12</sup> 11 12 0 391 974</p> <p></p> <p><b>B36846-00</b> <sup>13</sup> 11 11 7 511 529</p>	<p><b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS</p> <p><b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS</p> <p></p>	<p><b>T40366-00</b> 11 12 7 578 077</p> <p></p>	<p><b>V37110-00</b> 11 12 0 032 224</p> <p></p> <p><b>V90283-00</b> 11 12 0 032 224</p>	<p><b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417</p>	<p><b>M38078-00</b> 11 61 7 528 584</p> <p>16x</p> <p></p>		<p><b>X82343-01</b> 18 30 7 540 797</p> <p><b>X82367-01</b> <sup>13</sup> 18 30 7 540 798</p> <p></p>	<p><b>X54785-01</b> 11 13 7 511 224</p> <p></p>	<p><b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>			
<p>2,0 N 46 B 20 BD 110-115 kW (150-156 PS)</p> <p>N 46 B 20 C N 46 B 20 CC N 46 B 20 CD N 46 N 20 B</p> <p>120 i (E87) 120 i (E88) 320 i (E90)</p> <p>11/03→</p> <p><b>D37110-01</b> <sup>12</sup> 11 12 0 391 974</p> <p></p> <p><b>B36846-00</b> <sup>13</sup> 11 11 7 511 529</p>	<p><b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS</p> <p><b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS</p> <p></p>	<p><b>T40366-00</b> 11 12 7 578 077</p> <p></p>	<p><b>V38116-00</b> 11 12 0 035 738</p> <p></p>	<p><b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417</p>	<p><b>M38078-00</b> 11 61 7 528 584</p> <p>16x</p> <p></p>		<p><b>X82343-01</b> 18 30 7 540 797</p> <p><b>X82367-01</b> <sup>13</sup> 18 30 7 540 798</p> <p></p>	<p><b>X54785-01</b> 11 13 7 511 224</p> <p></p>	<p><b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>			
<p>2,0 N 46 B 20 C 110-115 kW (150-156 PS)</p> <p>120 i (E81, E87) 120 i (E87) 320 i (E90)</p> <p>11/03-09/12</p> <p><b>D37110-01</b> <sup>12</sup> 11 12 0 391 974</p> <p></p> <p><b>B36846-00</b> <sup>13</sup> 11 11 7 511 529</p>	<p><b>H80670-00</b> 11 12 7 509 710 84,5 Ø 0,4 mm MLS →01/07</p> <p><b>H80670-01</b> 11 12 7 509 711 84,5 Ø 0,7 mm MLS →01/07</p> <p><b>H40366-00</b> 11 12 7 563 412 85 Ø 0,5 mm MLS 02/07→</p> <p><b>H40366-01</b> 11 12 7 578 093 85 Ø 0,8 mm MLS 02/07→</p> <p></p>	<p><b>T80670-00</b> 11 12 7 511 534 →01/07</p> <p></p> <p><b>T40366-00</b> 11 12 7 578 077 02/07→</p> <p></p>	<p><b>V38116-00</b> 11 12 0 035 738</p> <p></p>	<p><b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417</p>	<p><b>M38078-00</b> 11 61 7 528 584</p> <p>16x</p> <p></p>		<p><b>X82343-01</b> 18 30 7 540 797</p> <p><b>X82367-01</b> <sup>13</sup> 18 30 7 540 798</p> <p></p>	<p><b>X54785-01</b> 11 13 7 511 224</p> <p></p>	<p><b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>			

BMW													
Ltr.													
2,0 N 47 D 20 A	66-130 kW (90-177 PS)	X3 (E83) 116 d (E81) 116 d (E87) 118 d (E88) 120 d (E82) 120 d (E88) 318 d (E91) 320 d (E90) 320 d (E91) 320 xd (E91) 520 d (E60) 520 d (E61)	09/07-12/13	<b>D37249-00</b> <sup>12</sup> 11 12 7 807 293  <b>B37249-00</b> <sup>13</sup> 11 11 7 807 292	<b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 MLS <b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 MLS <b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 MLS 	<b>T38791-00</b> 11 12 8 513 128 	<b>V38120-00</b> 11 12 7 807 017 	<b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b>	<b>X89893-01</b> 11 61 7 801 438 16x	4x	<b>X82358-01</b> 11 62 8 509 783 	2x <b>X54933-01</b> 11 13 7 807 302 Gummi/Metall 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM
2,0 N 47 D 20 A	90-130 kW (122-177 PS)	118 d (E81, E87) 118 d (E87) 120 d (E81, E87) 120 d (E87) 318 d (E90) 320 d (E92) 320 d (E93) 320 xd (E71) 520 d (E60) 520 d (E61)	11/03-12/13	<b>D37249-00</b> <sup>12</sup> 11 12 7 807 293  <b>B37249-00</b> <sup>13</sup> 11 11 7 807 292	<b>H40387-00</b> 11 12 7 803 099 1,65 mm 1 MLS →05/07 <b>H40387-10</b> 11 12 7 803 100 1,7 mm 2 MLS →05/07 <b>H40387-20</b> 11 12 7 803 101 1,75 mm 3 MLS →05/07 	<b>T38791-00</b> 11 12 8 513 128 	<b>V38120-00</b> 11 12 7 807 017 	<b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b>	<b>X89893-01</b> 11 61 7 801 438 16x	4x	<b>X82358-01</b> 11 62 8 509 783 	2x <b>X54933-01</b> 11 13 7 807 302 Gummi/Metall 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM

BMW												
Ltr.			<b>1</b>									
2,0 N 47 D 20 B 150 kW (204 PS)	123 d (E81, E87)	03/07-09/12	<b>D37249-01</b> <sup>12</sup> 11 12 7 811 594  <b>B37249-00</b> <sup>13</sup> 11 11 7 807 292	<b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 MLS <b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 MLS <b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 MLS 	<b>T38791-00</b> 11 12 8 513 128 	<b>V38120-00</b> 11 12 7 807 017 	<b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b> 16x 	<b>X89893-01</b> 11 61 7 801 438 4x 	<b>X82358-01</b> 11 62 8 509 783 2x 	<b>X54933-01</b> 11 13 7 807 302 Gummi/Metall →04/10 	<b>P77356-01</b> K ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01</b> K → 11 14 7 797 490 90x104x8,5 LD FPM	
2,0 N 47 D 20 B 150 kW (204 PS)	123 d (E82) 123 d (E87) 123 d (E88)	03/07-12/13	<b>D37249-01</b> <sup>12</sup> 11 12 7 811 594  <b>B37249-00</b> <sup>13</sup> 11 11 7 807 292	<b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 MLS <b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 MLS <b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 MLS 	<b>T38791-00</b> 11 12 8 513 128 	<b>V38120-00</b> 11 12 7 807 017 	<b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b> 16x 	<b>X89893-01</b> 11 61 7 801 438 4x 	<b>X82358-01</b> 11 62 8 509 783 →09/11 	<b>X54933-01</b> 11 13 7 807 302 Gummi/Metall →04/10 	<b>P77356-01</b> K ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01</b> K → 11 14 7 797 490 90x104x8,5 LD FPM	
2,0 N 47 D 20 C 66-135 kW (90-184 PS)	X1 2.0 d (E84) 116 d (E81) 116 d (E87)	01/11-06/15	<b>D37249-00</b> <sup>12</sup> 11 12 7 807 293  <b>B37249-00</b> <sup>13</sup> 11 11 7 807 292	<b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 MLS <b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 MLS <b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 MLS 	<b>T38791-00</b> 11 12 8 513 128 	<b>V38120-00</b> 11 12 7 807 017 	<b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b> 16x 	<b>X89893-01</b> 11 61 7 801 438 4x 	<b>X82358-01</b> 11 62 8 509 783 <b>X71045-01</b> 11 65 7 800 596 	<b>70-31414-10</b> 2x 	<b>P77356-01</b> K ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01</b> K → 11 14 7 797 490 90x104x8,5 LD FPM	


















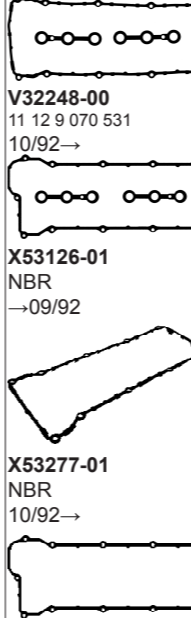





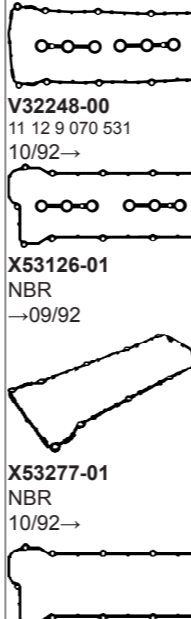



BMW												
Ltr.												
2,0 N 47 D 20 C	100 kW (136 PS)	118 d (E88)	09/08-12/13	<p><b>D37249-00</b> <sup>12</sup> 11 12 7 807 293</p> <p><b>B37249-00</b> <sup>13</sup> 11 11 7 807 292</p>	<p><b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 </p> <p>MLS</p> <p><b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 </p> <p>MLS</p> <p><b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 </p> <p>MLS</p>	<p><b>T38791-00</b> 11 12 8 513 128</p>	<p><b>V38120-00</b> 11 12 7 807 017</p> <p><b>V38782-00</b> 11 12 8 511 814</p>	<p><b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b></p>	<p><b>X71035-01</b> 11 61 8 506 407</p> <p>16x </p> <p><b>X89893-01</b> 11 61 7 801 438</p> <p>4x </p>	<p><b>X82358-01</b> 11 62 8 509 783</p> <p><b>X71045-01</b>  11 65 7 800 596</p>	<p>2x <b>X54933-01</b> 11 13 7 807 302 Gummi/Metall →04/10</p> <p><b>70-31414-10</b> 05/10→</p>	<p><b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM</p> <p><b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM</p>
2,0 N 47 D 20 C	105-145 kW (143-197 PS)	118 d (E82) 120 d (E88)	03/08-12/13	<p><b>D37249-00</b> <sup>12</sup> 11 12 7 807 293</p> <p><b>B37249-00</b> <sup>13</sup> 11 11 7 807 292</p>	<p><b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 </p> <p>MLS</p> <p><b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 </p> <p>MLS</p> <p><b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 </p> <p>MLS</p>	<p><b>T38791-00</b> 11 12 8 513 128 →08/10</p>	<p><b>V38120-00</b> 11 12 7 807 017</p>	<p><b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b></p>	<p><b>X89893-01</b> 11 61 7 801 438</p> <p>16x </p>	<p><b>X82358-01</b> 11 62 8 509 783</p> <p><b>X71045-01</b>  11 65 7 800 596</p>	<p>2x <b>X54933-01</b> 11 13 7 807 302 Gummi/Metall →04/10</p> <p><b>70-31414-10</b> 05/10→</p>	<p><b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM</p> <p><b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM</p>
2,0 N 47 D 20 C	120-130 kW (163-177 PS)	520 d (E60)	07/05-03/10	<p><b>D37249-00</b> <sup>12</sup> 11 12 7 807 293</p> <p><b>B37249-00</b> <sup>13</sup> 11 11 7 807 292</p>	<p><b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 </p> <p>MLS</p> <p><b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 </p> <p>MLS</p> <p><b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 </p> <p>MLS</p>	<p><b>T38791-00</b> 11 12 8 513 128</p>	<p><b>V38120-00</b> 11 12 7 807 017</p>	<p><b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b></p>	<p><b>X89893-01</b> 11 61 7 801 438</p> <p>16x </p>	<p><b>X82358-01</b> 11 62 8 509 783</p> <p><b>X71045-01</b>  11 65 7 800 596</p>	<p>2x <b>X54933-01</b> 11 13 7 807 302 Gummi/Metall</p>	<p><b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM</p> <p><b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM</p>

BMW												
Ltr.												
2,0 N 47 D 20 C 130 kW (177 PS)	X3 (E83)	09/07-03/09	<b>D37249-00</b> <sup>12</sup> 11 12 7 807 293  <b>B37249-00</b> <sup>13</sup> 11 11 7 807 292	<b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 MLS <b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 MLS <b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 MLS 	<b>T38791-00</b> 11 12 8 513 128 	<b>V38120-00</b> 11 12 7 807 017 	<b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b> 16x 	<b>X89893-01</b> 11 61 7 801 438 4x 	<b>X82358-01</b> 11 62 8 509 783  <b>X71045-01</b> 11 65 7 800 596	2x <b>X54933-01</b> 11 13 7 807 302 Gummi/Metall →04/10 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM	
2,0 N 47 D 20 D 150 kW (204 PS)	123 d (E81, E87) 123 d (E82) 123 d (E87) 123 d (E88)	03/07-12/13	<b>D37249-01</b> <sup>12</sup> 11 12 7 811 594  <b>B37249-00</b> <sup>13</sup> 11 11 7 807 292	<b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 MLS <b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 MLS <b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 MLS 	<b>T38791-00</b> 11 12 8 513 128 	<b>V38120-00</b> 11 12 7 807 017 	<b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b> 16x 	<b>X89893-01</b> 11 61 7 801 438 4x 	<b>X82358-01</b> 11 62 8 509 783 	2x <b>X54933-01</b> 11 13 7 807 302 Gummi/Metall 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM	
2,0 N 47 D 20 D 155-160 kW (211-218 PS)	X1 2.5 d (E84) X5 2.5 d (F15) 125 d (F20) 125 d (F21) 325 d (F30) 325 d (F31) 325 d (F34) 525 d (F10) 525 d (F11)	10/09→	<b>D37249-01</b> <sup>12</sup> 11 12 7 811 594 	<b>H40751-00</b> 11 12 8 509 146 84,7 Ø 1,45 mm 1 MLS <b>H40751-10</b> 11 12 8 509 147 84,7 Ø 1,55 mm 2 MLS <b>H40751-20</b> 11 12 8 509 148 84,7 Ø 1,65 mm 3 MLS 	<b>T38791-00</b> 11 12 8 513 128 	<b>V38782-00</b> 11 12 8 511 814 	<b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b> 16x 	<b>X71028-01</b> 11 61 7 812 938 	<b>X82358-01</b> 11 62 8 509 783 	2x <b>70-31414-10</b> 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM	
2,0 N 47S D 20 D 150 kW (204 PS)	X1 2.3 d (E84)	10/09-06/15	<b>D37249-01</b> <sup>12</sup> 11 12 7 811 594 	<b>H01450-00</b> 11 12 7 806 246 1,55 mm 1 MLS <b>H11450-10</b> 11 12 7 806 247 1,6 mm 2 MLS <b>H21450-20</b> 11 12 7 806 248 1,65 mm 3 MLS 	<b>T38791-00</b> 11 12 8 513 128 	<b>V38120-00</b> 11 12 7 807 017 	<b>N93136-00</b> 11 34 7 807 347 <b>P76845-00</b> 16x 	<b>X89893-01</b> 11 61 7 801 438 4x 	<b>X82358-01</b> 11 62 8 509 783 	2x <b>X54933-01</b> 11 13 7 807 302 Gummi/Metall 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM	



BMW												
Ltr.			<b>1</b>									
2,0 S 14 B 204 EA 141 kW (192 PS)				<b>D31662-00</b> <sup>12</sup> 11 12 1 316 992 <b>B31662-00</b> <sup>13</sup> 11 11 1 316 993	<b>H50232-00</b> 11 12 1 316 714 94,5 Ø 		<b>V31662-00</b> 11121212171 	<b>N91190-00</b> 2x <b>P76532-00</b> 16x 11 34 1 288 544		<b>X51363-01</b> 4x 11 62 1 312 961 	<b>X54101-01</b> 11 13 1 727 974 	<b>P76255-01 K</b> ← 11 14 1 435 848 44x60x10 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76074-01 N</b> 11141271415 28x40x7 A SL RD FPM
2,2 M 54 B 22 (226120-125 kW S1) (163-170 PS)	Z4 2.2 i (E85) 320 Ci (E46) 520 i (E60)	07/03-03/10	<b>D36833-00</b> 11 12 0 141 055 +11 12 7 506 983 +11 62 1 732 969 (2x) <b>B36012-00</b> <sup>13</sup> 11 11 1 432 478	<b>H80008-00</b> 11 12 7 506 983 81 Ø MLS 	<b>T80039-00</b> 11 12 1 740 065 	<b>V36833-00</b> 11 12 0 030 496  <b>X53722-01</b> NBR  <b>X83068-01</b> 2x NBR 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 24x 11 34 2 245 151	<b>M36012-00</b> 11 61 1 436 631 	<b>X52315-01</b> 2x 11 62 1 732 969 	<b>X54107-01</b> 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	
2,2 M 54 B 22 (226125 kW S1) (170 PS)	Z3 2.2 i (E36) 320 Ci (E46) 520 i (E39)	08/00-12/07	<b>D36832-00</b> <sup>12</sup> 11 12 7 507 597 +11 12 7 506 983 +11 62 1 732 969 →09/02 <b>D36833-00</b> 11 12 0 141 055 +11 12 7 506 983 +11 62 1 732 969 (2x) 10/02→ <b>B36012-00</b> <sup>13</sup> 11 11 1 432 478	<b>H80008-00</b> 11 12 7 506 983 81 Ø MLS 	<b>T80039-00</b> 11 12 1 740 065 	<b>V36012-00</b> 11 12 9 070 990 →09/02  <b>V36833-00</b> 11 12 0 030 496 10/02→  <b>X83068-01</b> 2x NBR 10/02→  <b>X53722-01</b> NBR 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 24x 11 34 2 245 151	<b>M36012-00</b> 11 61 1 436 631 	<b>X52315-01</b> 2x 11 62 1 732 969 	<b>X54107-01</b> 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	

BMW											
Ltr. 2,2 M 54 B 22 (226125 kW S1) (170 PS) M 54 226 S1	 520 i (E39)	 09/00→	<b>D36832-00</b> <sup>(12)</sup> 11 12 7 507 597 +11 12 7 506 983 +11 62 1 732 969 →09/02 <b>D36833-00</b> 11 12 0 141 055 +11 12 7 506 983 +11 62 1 732 969 (2x) 10/02→ <b>B36012-00</b> <sup>(13)</sup> 11 11 1 432 478	<b>H80008-00</b> 11 12 7 506 983 81 Ø MLS 	<b>T80039-00</b> 11 12 1 740 065 	<b>V36012-00</b> 11 12 9 070 990 →09/02  <b>V36833-00</b> 11 12 0 030 496 10/02→  <b>X83068-01</b> 2x NBR 10/02→  <b>X53722-01</b> NBR 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151	<b>M36012-00</b> 11 61 1 436 631 24x 	<b>X52315-01</b> 11 62 1 732 969 2x 	<b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
2,3 S 14 B 23 (EVO I) (143-162 kW (195-220 PS) S 14 B 23 (234S2)	M3 (E30) M3 2.3 (E30)	07/86→	<b>D31662-00</b> <sup>(12)</sup> 11 12 1 316 992 <b>B31662-00</b> <sup>(13)</sup> 11 11 1 316 993	<b>H50232-00</b> 11 12 1 316 714 94,5 Ø 	<b>V31662-00</b> 11121212171 	<b>N91190-00</b> 2x <b>P76532-00</b> 16x 11 34 1 288 544	<b>X51363-01</b> 11 62 1 312 961 4x 	<b>X54101-01</b> 11 13 1 727 974 	<b>P76255-01 K</b> ← 11 14 1 435 848 44x60x10 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM		
2,4-M 21 D 24 -2,5 (63 kW (86 PS)	M3 (E30) M3 2.3 (E30)	07/86→	<b>D31427-00</b> <sup>(12)</sup> 11 12 2 243 877  <b>B31427-00</b> 11 11 2 243 888	<b>H01125-00</b> 11 12 2 244 727 1,55 mm 1 <b>H11125-10</b> 11 12 2 244 728 1,69 mm 2 <b>H21125-20</b> 11 12 2 244 729 81 Ø 1,87 mm 3 	<b>T01125-00</b> 11 12 2 243 143(14x) 	<b>X53120-01</b> 11 12 1 285 973 	<b>N92450-00</b> 11 34 9 059 172 <b>P76532-00</b> 12x 11 34 1 288 544	<b>X55933-01</b> 3x 11 61 2 243 867 	<b>X51210-01</b> 11 62 2 243 884  <b>X51208-01</b> 2x 11 76 1 711 717 	<b>X54100-01</b> 11 13 1 730 234 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76080-01 N</b> 11 12 1 285 609 38x50x7 A SL FPM
2,5 M 20 B 25 (256EX) (125-126 kW (170-171 PS)	325 i (E30) 325 i X (E30)	03/86-10/93	<b>D31430-00</b> <sup>(12)</sup> 11 12 9 059 240 <b>B31425-00</b> 11 11 1 730 875	<b>H50057-00</b> 11 12 1 722 734 85 Ø <b>H50057-10</b> 11 12 1 722 735 	<b>T50052-00</b> 11 12 1 726 478 	<b>X51207-01</b> 11 12 1 730 229 	<b>N92450-00</b> 11 34 9 059 172 <b>P76532-00</b> 12x 11 34 1 288 544	<b>X55921-01</b> 4x 11 61 1 726 010  <b>X55922-01</b> 11 61 1 726 012 	<b>X51209-01</b> 2x 11 62 1 728 489  <b>X51204-01</b> 18 11 1 728 364  <b>X51217-01</b> 2x 	<b>X54100-01</b> 11 13 1 730 234 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76080-01 N</b> 11 12 1 285 609 38x50x7 A SL FPM
2,5 M 30 B 25 INAT (107-110 kW (146-150 PS) M 30 B 25 (256VA)	2.5 CS (E9) 2500 (E3) 525 (E12) 725 i (E23)	10/68-06/86	<b>D36913-00</b> <sup>(12)</sup> <b>B31431-00</b> <sup>(13)</sup> 11 00 1 267 942 <b>E31431-00</b> <sup>(2)</sup> 11 14 1 735 047	<b>H50050-00</b> 11 12 1 730 746 88 Ø <b>H50050-10</b> 11 12 1 730 748 88 Ø 	<b>T50050-00</b> 11 12 0 621 144(14x) 	<b>X51214-01</b> 11 12 1 730 935 	<b>P76744-00</b> 12x 11 34 1 256 556	<b>X55928-01</b> 6x 11 61 1 730 788 	<b>X51211-01</b> 6x 11 62 1 723 851 	<b>X54103-01</b> 11 13 1 315 085 	<b>P76231-01 K</b> ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM

<p><b>BMW</b></p> <p>Ltr.    <b>1</b></p>										
<p>2,5 M 50 B 25 TU 141 kW (192 PS)</p>	<p><b>D31675-00</b> <sup>12</sup> 11 12 1 730 253 →09/92 <b>D32255-00</b> <sup>12</sup> 11 12 9 064 467 10/92→ <b>B32248-00</b> <sup>13</sup> 11 11 9 064 460</p>	<p><b>H50235-00</b> 11 12 1 726 617 85 Ø <b>H50235-50</b> 11 12 1 726 620 85 Ø</p> 	<p><b>T50234-00</b> 11 12 1 721 938</p> 	<p><b>V31668-00</b> 11 12 9 070 530 →09/92 <b>V32248-00</b> 11 12 9 070 531 10/92→ <b>X53126-01</b> NBR →09/92 <b>X53277-01</b> NBR 10/92→</p> 	<p><b>N92450-00</b> 11 34 9 059 172 →09/92 <b>N92830-00</b> 11 34 9 064 457 10/92→ <b>P76532-00</b> 11 34 1 288 544 →09/92 <b>P76662-00</b> 11 34 2 245 151 10/92→</p>	<p>2x <b>X57723-01</b> 11 61 1 717 259</p>  <p>6x</p>		<p><b>X51361-01</b> 11 62 1 728 983 <b>X51368-01</b> <sup>13</sup> 18 30 1 716 888</p> 	<p>3x <b>X54250-01</b> 11 13 1 437 237</p>  <p>2x</p>	<p><b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>
<p>2,5 M 50 B 25 (Vanos) 141 kW (192 PS)</p>	<p><b>D31675-00</b> <sup>12</sup> 11 12 1 730 253 →09/92 <b>D32255-00</b> <sup>12</sup> 11 12 9 064 467 10/92→ <b>B32248-00</b> <sup>13</sup> 11 11 9 064 460</p>	<p><b>H50235-00</b> 11 12 1 726 617 85 Ø <b>H50235-50</b> 11 12 1 726 620 85 Ø</p> 	<p><b>T50234-00</b> 11 12 1 721 938</p> 	<p><b>V31668-00</b> 11 12 9 070 530 →09/92 <b>V32248-00</b> 11 12 9 070 531 10/92→ <b>X53126-01</b> NBR →09/92 <b>X53277-01</b> NBR 10/92→</p> 	<p><b>N92830-00</b> 11 34 9 064 457 →09/92 <b>P76662-00</b> 11 34 2 245 151</p>	<p>24x <b>X57723-01</b> 11 61 1 717 259</p>  <p>6x</p>		<p><b>X51361-01</b> 11 62 1 728 983 <b>X51368-01</b> <sup>13</sup> 18 30 1 716 888</p> 	<p>3x <b>X54250-01</b> 11 13 1 437 237</p>  <p>2x</p>	<p><b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>
























BMW												
2,5 M 51 D 25 (Inter.)	105 kW (143 PS)	<p><b>D31669-00</b> <sup>12</sup> 11 12 2 244 328 →09/92</p> <p><b>D32253-00</b> <sup>12</sup> 11 12 9 065 445 10/92-08/95</p> <p><b>D36016-00</b> <sup>12</sup> 11 12 9 070 622 09/95→</p> <p><b>B32253-00</b> <sup>13</sup> 11 11 9 066 462 →01/94</p> <p><b>B32254-00</b> <sup>13</sup> 11 11 2 245 749 02/94→</p>	<p><b>H09941-00</b> 11122245483 1,68 mm 2 </p> <p><b>H19941-10</b> 11 12 2 245 483 81,5 Ø 1,87 mm 3 </p> <p><b>H03920-00</b> 11122245426 1,68 mm 2 </p> <p><b>H13920-10</b> 11 12 2 245 427 81 Ø 1,87 mm 3 </p>	<p><b>T09941-00</b> 11 12 9 067 790</p>	<p><b>X53128-01</b> 11 12 2 244 398 NBR →08/95</p> <p><b>X53725-01</b> 11 12 2 245 686 NBR 09/95→</p>	<p><b>N92450-00</b> 11 34 9 059 172 →09/92</p> <p><b>N92993-00</b> 10/92→</p> <p><b>P76532-00</b> 11 34 1 288 544 →09/92</p> <p><b>P76662-00</b> 11 34 2 245 151 10/92→</p>	<p><b>X56526-01</b> 11 61 2 244 391 →12/95</p> <p><b>W57673-01</b> 11 61 2 245 438 01/96→</p>	6x	<p><b>X51221-01</b> 11 62 2 243 782 →08/95</p> <p><b>X52317-01</b> 11 62 2 246 174 09/95→</p> <p><b>X51370-01</b> 11 62 2 244 568</p> <p><b>X51371-01</b> <sup>13</sup> 11 62 2 244 515</p>	4x	<p><b>X54251-01</b> 11 13 9 066 503 Stahl</p>	<p><b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM</p> <p><b>P76378-01 N</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>
2,5 M 52 B 25 TU	125 kW (170 PS)	<p><b>D32683-00</b> <sup>12</sup> 11 12 1 427 826 →09/98</p> <p><b>D36014-00</b> <sup>12</sup> 11 12 1 436 822 +11 12 7 501 304 +11 62 1 732 969 (2x) 10/98→</p> <p><b>B32249-00</b> <sup>13</sup> 11 11 1 740 981 →09/98</p> <p><b>B36012-00</b> <sup>13</sup> 11 11 1 432 478 10/98→</p>	<p><b>H50235-00</b> 11 12 1 726 617 85 Ø →09/98</p> <p><b>H50235-50</b> 11 12 1 726 620 85 Ø →09/98</p> <p><b>H80007-00</b> 11 12 7 501 304 85 Ø MLS 10/98→</p> <p><b>H80007-10</b> 11 12 7 501 305 85 Ø 1 mm MLS 10/98→</p>	<p><b>T50234-00</b> 11 12 1 721 938 für Graugußblock</p> <p><b>T80039-00</b> <sup>47</sup> 11 12 1 740 065</p>	<p><b>V32250-00</b> 11 12 9 070 532 →09/98</p> <p><b>V36012-00</b> 11 12 9 070 990 10/98→</p> <p><b>X53278-01</b> NBR →09/98</p> <p><b>X53722-01</b> NBR 10/98→</p> <p><b>X53279-01</b> 2x NBR</p>	<p><b>N92830-00</b> 11 34 9 064 457 →09/98</p> <p><b>P76662-00</b> 11 34 2 245 151</p>	<p><b>M36012-00</b> 11 61 1 436 631 Zyl. 1 - 3 10/98→</p> <p><b>X57680-01</b> 2x 11 61 1 740 069 →09/98</p>	24x	<p><b>X51644-01</b> 11 62 1 744 252 →09/98</p> <p><b>X52315-01</b> 2x 11 62 1 732 969 10/98→</p> <p><b>X51368-01</b> <sup>13</sup> 2x 18 30 1 716 888 →09/98</p>	2x	<p><b>X54250-01</b> 11 13 1 437 237</p>	<p><b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM</p> <p><b>P76255-01 K</b> ← 11 14 1 435 848 44x60x10 A SL RD FPM</p> <p><b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>

BMW

Ltr.

2,5 M 52 B 25 (Vanos) 125-141 kW (170-192 PS)

1

<p><b>D31675-00</b> <sup>12</sup> 11 12 1 730 253 →09/92</p> <p><b>D32255-00</b> <sup>12</sup> 11 12 9 064 467 10/92-04/95</p> <p><b>D32251-00</b> <sup>12</sup> 11 12 1 740 984 05/95-09/95</p> <p><b>D32683-00</b> <sup>12</sup> 11 12 1 427 826 10/95-09/98</p> <p><b>D36014-00</b> <sup>12</sup> 11 12 1 436 822 +11 12 7 501 304 +11 62 1 732 969 (2x) 10/98→</p> <p><b>B32249-00</b> <sup>13</sup> 11 11 1 740 981 →09/98</p> <p><b>B36012-00</b> <sup>13</sup> 11 11 1 432 478 10/98→</p>  	<p><b>H50235-00</b> 11 12 1 726 617 85 Ø →09/98</p> <p><b>H50235-50</b> 11 12 1 726 620 85 Ø →09/98</p>  <p><b>H80007-00</b> 11 12 7 501 304 85 Ø MLS 10/98→</p> <p><b>H80007-10</b> 11 12 7 501 305 85 Ø 1 mm MLS 10/98→</p> 	<p><b>T50234-00</b> 11 12 1 721 938 für Graugußblock</p>  <p><b>T80039-00</b> <sup>47</sup> 11 12 1 740 065</p> 	<p><b>V31668-00</b> 11 12 9 070 530 →09/92</p>  <p><b>V32248-00</b> 11 12 9 070 531 10/92-09/95</p>  <p><b>V32250-00</b> 11 12 9 070 532 10/95-09/98</p>  <p><b>V36012-00</b> 11 12 9 070 990 10/98→</p>  <p><b>X53126-01</b> NBR →09/92</p>  <p><b>X53277-01</b> NBR 10/92-09/95</p>  <p><b>X53278-01</b> NBR 10/95-09/98</p>  <p><b>X53279-01</b> 2x NBR 10/95→</p>  <p><b>X53722-01</b> NBR 10/98→</p> 	<p><b>N92830-00</b> 11 34 9 064 457</p> <p><b>P76662-00</b> 11 34 2 245 151</p>	<p><b>M36012-00</b> 11 61 1 436 631 24x Zyl. 1 - 3 10/98→</p>  <p><b>X57723-01</b> 6x 11 61 1 717 259 →04/95</p>  <p><b>X57680-01</b> 2x 11 61 1 740 069 05/95-09/98</p> 	<p><b>X51361-01</b> 3x 11 62 1 728 983 →04/95</p>  <p><b>X51644-01</b> 2x 11 62 1 744 252 05/95-09/98</p>  <p><b>X52315-01</b> 2x 11 62 1 732 969 10/98→</p>  <p><b>X51368-01</b> <sup>13</sup> 2x 18 30 1 716 888</p> 	<p><b>X54250-01</b> 11 13 1 437 237</p> 	<p><b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM</p> <p><b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>	

BMW												
Ltr. 2,5 M 54 B 25 (256137-141 kW S5) M 54 256 S5	 325 Ci (E46) 325 i (E46) 325 xi (E46) 525 i (E39)	 09/00→	<b>D36915-00</b> <sup>(12)</sup> 11 12 7 507 597 +11 12 7 501 304 +11 62 1 732 969 (2x) →09/02 <b>D36767-00</b> <sup>(12)</sup> 11 12 0 141 055 +11 12 7 501 304 +11 62 1 732 969 (2x) 10/02→ <b>B36012-00</b> <sup>(13)</sup> 11 11 1 432 478	<b>H80007-00</b> 11 12 7 501 304 85 Ø MLS <b>H80007-10</b> 11 12 7 501 305 85 Ø 1 mm MLS 	<b>T80039-00</b> 11 12 1 740 065 	<b>V36012-00</b> 11 12 9 070 990 →09/02  <b>V36833-00</b> 11 12 0 030 496 10/02→  <b>X53279-01</b> 2x NBR →09/02  <b>X83068-01</b> 2x NBR 10/02→  <b>X53722-01</b> NBR 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151	<b>M36012-00</b> 11 61 1 436 631 24x 		<b>X52315-01</b> 2x 11 62 1 732 969 	<b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
2,5 M 54 B 25 (256141 kW S5) (192 PS)	X3 2.5 i (E83) Z4 2.5 i (E85) 525 i (E60) 525 i (E61)	02/03-12/10	<b>D36767-00</b> <sup>(12)</sup> 11 12 0 141 055 +11 12 7 501 304 +11 62 1 732 969 (2x) <b>B36012-00</b> <sup>(13)</sup> 11 11 1 432 478	<b>H80007-00</b> 11 12 7 501 304 85 Ø MLS <b>H80007-10</b> 11 12 7 501 305 85 Ø 1 mm MLS 	<b>T80039-00</b> 11 12 1 740 065 	<b>V36833-00</b> 11 12 0 030 496  <b>X53722-01</b> NBR  <b>X83068-01</b> 2x NBR 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151	<b>M36012-00</b> 11 61 1 436 631 24x 		<b>X52315-01</b> 2x 11 62 1 732 969 	<b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
2,5 M 57 D 25 TU 120-130 kW M 57 N 256 D4 (163-177 PS)	525 d (E61)	12/04→	<b>D36916-00</b> <sup>(12)</sup> 11 12 0 150 670  <b>B36916-00</b> <sup>(13)</sup> 11 11 0 150 669	<b>H01855-00</b> 11 12 7 788 587 1,45 mm 1 MLS <b>H11855-10</b> 11 12 7 788 588 1,55 mm 2 MLS <b>H21855-20</b> 11 12 7 788 589 1,65 mm 3 MLS 	<b>T09941-00</b> 11 12 9 067 790 	<b>X83350-01</b> 11 12 7 796 378 	<b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 6x 11 61 7 790 198  <b>X89855-01</b> <sup>(10)</sup> 6x 11 61 2 246 945 		<b>X52316-01</b> 3x 11 62 7 796 480 	<b>X54471-01</b> 11 13 0 149 329 	<b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77480-01 K</b> → 11 14 7 787 262

BMW																				
2,5 M 57 D 256 D1 120 kW (163 PS)	525 d (E39) 525 d (E60)	02/00-03/10	 <b>D36015-00</b> 11 12 2 248 985  <b>B36015-00</b> 11 11 2 248 975	 <b>H08009-00</b> 11 12 2 354 013 1,45 mm 1 MLS <b>H18009-10</b> 11 12 2 354 014 1,55 mm 2 MLS <b>H28009-20</b> 11 12 2 354 015 80 Ø 1,65 mm 3 MLS	 <b>T09941-00</b> 11 12 9 067 790	 <b>X83350-01</b> 11 12 7 796 378	 <b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171	 <b>X58955-01</b> 11 61 7 790 198 6x <b>X89855-01</b> 11 61 2 246 945 6x	 <b>X52316-01</b> 11 62 7 796 480 3x	 <b>X54471-01</b> 11 13 0 149 329	 <b>P76443-01 K ←</b> 11 14 2 249 534 55x68x8 A SL RD FPM <b>P76378-01 K →</b> 11 14 2 245 364 90x110x12 A SL LD FPM									
2,5 N 52 B 25 N 52 B 25 A	130-163 kW (177-222 PS) Z4 2.5 i (E85) Z4 2.5 si (E85) 325 i (E90) 325 xi (E90) 325 xi (E91) 523 i (E60) 523 i (E61) 525 i (E60) 525 i (E61) 525 xi (E60) 525 xi (E61)	01/05→	 <b>D37111-00</b> 11 12 7 548 921  <b>B38104-00</b> 11 11 7 548 101	 <b>H80745-00</b> 11 12 7 555 310 1,2 mm MLS <b>H80745-10</b> 11 12 7 555 756 1,5 mm MLS	 <b>T80745-00</b> 11 12 7 548 799	 <b>V38079-00</b> 11 12 7 581 215	 <b>N93120-00</b> 11 34 0 032 582 →03/06 <b>N93119-00 ES</b> 11 34 0 034 068 04/06→ <b>N93123-00 AS</b> 11 34 0 035 853 04/06→	 <b>M38071-00</b> 11 61 7 547 242	 <b>X82341-01</b> 18 40 7 530 606 <b>X82366-01</b> 18 10 7 549 447	 <b>X54927-01</b> 11 13 7 548 031 2x	 <b>P77410-01 K ←</b> 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K →</b> 11 11 7 584 398 90x110x12 A SL LD									
2,5 N 52 B 25 A	130-160 kW (177-218 PS) X3 2.5 i (E83) X3 2.5 si (E83) 323 i (E90) 323 i (E91) 325 i (E92) 325 i (E93) 325 xi (E92) 523 i (F11)	04/06-12/13	 <b>D37111-00</b> 11 12 7 548 921  <b>B38104-00</b> 11 11 7 548 101	 <b>H80745-00</b> 11 12 7 555 310 1,2 mm MLS <b>H80745-10</b> 11 12 7 555 756 1,5 mm MLS	 <b>T80745-00</b> 11 12 7 548 799	 <b>V38079-00</b> 11 12 7 581 215	 <b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	 <b>M38071-00</b> 11 61 7 547 242	 <b>X82341-01</b> 18 40 7 530 606 <b>X82366-01</b> 18 10 7 549 447	 <b>X54927-01</b> 11 13 7 548 031 2x	 <b>P77410-01 K ←</b> 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K →</b> 11 11 7 584 398 90x110x12 A SL LD									
2,5 N 52 B 25 A N 52 B 25 C N 52 N 25 A	130-160 kW (177-218 PS) Z4 (E89) 323 i (E90) 323 i (E92) 323 i (E93)	04/06→	 <b>D37112-00</b> 11 12 7 571 963  <b>B38104-00</b> 11 11 7 548 101	 <b>H80745-00</b> 11 12 7 555 310 1,2 mm MLS <b>H80745-10</b> 11 12 7 555 756 1,5 mm MLS	 <b>T80745-00</b> 11 12 7 548 799	 <b>V38072-00</b> 11 12 7 582 245	 <b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	 <b>M38071-00</b> 11 61 7 547 242	 <b>X82341-01</b> 18 40 7 530 606 <b>X82366-01</b> 18 10 7 549 447	 <b>X54927-01</b> 11 13 7 548 031 2x	 <b>P77410-01 K ←</b> 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K →</b> 11 11 7 584 398 90x110x12 A SL LD									
2,5 N 52 B 25 A	140 kW (190 PS) 523 i (E60) 523 i (E61)	01/07-12/10	 <b>D37111-00</b> 11 12 7 548 921  <b>B38104-00</b> 11 11 7 548 101	 <b>H80745-00</b> 11 12 7 555 310 1,2 mm MLS <b>H80745-10</b> 11 12 7 555 756 1,5 mm MLS	 <b>T80745-00</b> 11 12 7 548 799	 <b>V38079-00</b> 11 12 7 581 215	 <b>N93119-00 ES</b> 11 34 0 034 068 04/06→ <b>N93123-00 AS</b> 11 34 0 035 853 04/06→	 <b>M38071-00</b> 11 61 7 547 242	 <b>X82341-01</b> 18 40 7 530 606 <b>X82366-01</b> 18 10 7 549 447	 <b>X54927-01</b> 11 13 7 548 031 2x	 <b>P77410-01 K ←</b> 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K →</b> 11 11 7 584 398 90x110x12 A SL LD									

BMW													
Ltr.			<b>1</b>										
2,5 N 53 B 25 A 140 kW (190 PS)				<b>D38115-00</b> <sup>12</sup> 11 12 7 561 438  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101		<b>T80745-00</b> 11 12 7 548 799 	<b>X83365-01</b> 11 12 7 544 368 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>14</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031  2x	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD
2,5 N52NB25A 150 kW (204 PS)	523 i (F10)	03/10→		<b>D37111-00</b> <sup>12</sup> 11 12 7 548 921 	<b>H80745-00</b> 11 12 7 555 310 1,2 mm MLS <b>H80745-10</b> 11 12 7 555 756 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38079-00</b> 11 12 7 581 215 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>14</sup> 18 10 7 549 447 	6x <b>X71021-01</b> 11 13 7 600 482  2x	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD →02/11 <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 A LD FPM 03/11→
2,5 S 14 B 25 (EVO II) 175 kW (238 PS)				<b>D31662-00</b> <sup>12</sup> 11 12 1 316 992 <b>B31662-00</b> <sup>13</sup> 11 11 1 316 993	<b>H50232-00</b> 11 12 1 316 714 94,5 Ø 		<b>V31662-00</b> 11121212171 	<b>N91190-00</b> 2x <b>P76532-00</b> 16x 11 34 1 288 544			<b>X51363-01</b> 11 62 1 312 961 	4x <b>X54101-01</b> 11 13 1 727 974  <b>X54102-01</b> <sup>11</sup> 11 13 1 709 815 	<b>P76255-01 K</b> ← 11 14 1 435 848 44x60x10 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
2,8 M 30 B 28 INAT 121-135 kW (165-184 PS)	2.8 L (E3) 2800 CS (E9) 2800 (E3) 528 (E12) 528 i (E12) 628 CSi (E24) 728 (E23) 728 i (E23)	10/68-08/87		<b>D36913-00</b> <sup>12</sup> <b>B31431-00</b> <sup>13</sup> 11 00 1 267 942	<b>H50050-00</b> 11 12 1 730 746 88 Ø <b>H50050-10</b> 11 12 1 730 748 88 Ø 	<b>T50050-00</b> 11 12 0 621 144(14x) 	<b>X51214-01</b> 11 12 1 730 935 	<b>N93067-01</b> 11 34 1 256 556 (12x) <b>P76744-00</b> 12x 11 34 1 256 556	<b>X55928-01</b> 6x 11 61 1 730 788 		<b>X51211-01</b> 11 62 1 723 851 	6x <b>X54103-01</b> 11 13 1 315 085 	<b>P76231-01 K</b> ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM



















































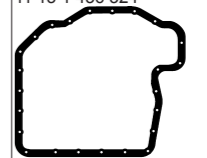

















BMW												
Ltr.			<b>1</b>	<p><b>D32251-00</b> <sup>12</sup> 11 12 1 740 984 →09/95</p> <p><b>D32683-00</b> <sup>12</sup> 11 12 1 427 826 10/95-09/98</p> <p><b>D36014-00</b> <sup>12</sup> 11 12 1 436 822 +11 12 7 501 304 +11 62 1 732 969 (2x) 10/98→</p> <p><b>B32249-00</b> <sup>13</sup> 11 11 1 740 981 →09/98</p> <p><b>B36012-00</b> <sup>13</sup> 11 11 1 432 478 09/98→</p>	<p><b>H50235-00</b> 11 12 1 726 617 85 Ø →09/98</p> <p><b>H50235-50</b> 11 12 1 726 620 85 Ø →09/98</p> <p><b>H80007-00</b> 11 12 7 501 304 85 Ø MLS 09/98→</p> <p><b>H80007-10</b> 11 12 7 501 305 85 Ø 1 mm MLS 09/98→</p>	<p><b>T50234-00</b> 11 12 1 721 938 Graugußblock</p> <p><b>T80039-00</b> 11 12 1 740 065 Alugußblock</p>	<p><b>V32248-00</b> 11 12 9 070 531 →09/95</p> <p><b>V32250-00</b> 11 12 9 070 532 10/95-09/98</p> <p><b>V36012-00</b> 11 12 9 070 990 10/98→</p>	<p><b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151</p>	<p><b>M36012-00</b> 11 61 1 436 631 Zyl. 1 - 3 10/98→</p> <p><b>X57680-01</b> 2x 11 61 1 740 069 →09/98</p>	<p><b>X51644-01</b> 2x 11 62 1 744 252 →09/98</p> <p><b>X52315-01</b> 2x 11 62 1 732 969 09/98→</p> <p><b>X51368-01</b> <sup>13</sup> 2x 18 30 1 716 888</p>	<p><b>X54250-01</b> 11 13 1 437 237</p>	<p><b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>
2,8 M 52 B 28 TU	142 kW (193 PS)			<p><b>D32251-00</b> <sup>12</sup> 11 12 1 740 984 →09/95</p> <p><b>D32683-00</b> <sup>12</sup> 11 12 1 427 826 10/95-09/98</p> <p><b>D36014-00</b> <sup>12</sup> 11 12 1 436 822 +11 12 7 501 304 +11 62 1 732 969 (2x) 10/98→</p> <p><b>B32249-00</b> <sup>13</sup> 11 11 1 740 981 →09/98</p> <p><b>B36012-00</b> <sup>13</sup> 11 11 1 432 478 09/98→</p>	<p><b>H50235-00</b> 11 12 1 726 617 85 Ø →09/98</p> <p><b>H50235-50</b> 11 12 1 726 620 85 Ø →09/98</p> <p><b>H80007-00</b> 11 12 7 501 304 85 Ø MLS 09/98→</p> <p><b>H80007-10</b> 11 12 7 501 305 85 Ø 1 mm MLS 09/98→</p>	<p><b>T50234-00</b> 11 12 1 721 938 Graugußblock</p> <p><b>T80039-00</b> 11 12 1 740 065 Alugußblock</p>	<p><b>V32248-00</b> 11 12 9 070 531 →09/95</p> <p><b>V32250-00</b> 11 12 9 070 532 10/95-09/98</p> <p><b>V36012-00</b> 11 12 9 070 990 10/98→</p>	<p><b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151</p>	<p><b>M36012-00</b> 11 61 1 436 631 10/98→</p> <p><b>X57680-01</b> 2x 11 61 1 740 069 →09/98</p>	<p><b>X51644-01</b> 2x 11 62 1 744 252 →09/98</p> <p><b>X52315-01</b> 2x 11 62 1 732 969 09/98→</p> <p><b>X51368-01</b> <sup>13</sup> 2x 18 30 1 716 888</p>	<p><b>X54250-01</b> 11 13 1 437 237</p>	<p><b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM</p>
3,0 M 30 B 30	132-147 kW (180-200 PS)	2500-3.3 (E3) - 3.0 L 2500-3.3 (E3) - 3.0 S 3.0 CS (E9) 3.0 Csi (E9) 3.0 Si (E3) 630 CS (E24) 730 (E23)	05/71-08/79	<p><b>D31433-00</b> <sup>12</sup> <b>B31433-00</b> <sup>13</sup> 11 00 9 058 775 <b>E31431-00</b> <sup>2</sup> 11 14 1 735 047</p>	<p><b>H50058-00</b> 11 12 1 730 217 90 Ø</p> <p><b>H50058-10</b> 11121730218 90 Ø</p>	<p><b>T50050-00</b> 11 12 0 621 144(14x)</p>	<p><b>X51212-01</b> 11 12 1 730 231</p>	<p><b>N91210-00</b> 11 34 9 059 170 <b>P76531-00</b> 11 34 1 273 501</p>	<p><b>X55928-01</b> 6x 11 61 1 730 788</p>	<p><b>X51215-01</b> 2x 11 62 1 723 656</p>	<p><b>X54106-01</b> 11 13 1 722 695 Kork</p>	<p><b>P76231-01 K</b> ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76074-01 N</b> 11141271415 28x40x7 A SL RD FPM</p>

BMW												
3,0 M 54 B 30 S3 Ltr.	163-170 kW (222-231 PS)	X5 3.0 i (E53) Z3 3.0 i (E36) 330 Ci (E46) 330 i (E46) 330 xi (E46) 530 i (E39)	05/00-12/07 	<b>D36915-00</b> <sup>(12)</sup> 11 12 7 507 597 +11 12 7 501 304 +11 62 1 732 969 (2x) →09/02 <b>D36767-00</b> <sup>(12)</sup> 11 12 0 141 055 +11 12 7 501 304 +11 62 1 732 969 (2x) 10/02→ <b>B36012-00</b> <sup>(13)</sup> 11 11 1 432 478	<b>H80007-00</b> 11 12 7 501 304 85 Ø MLS <b>H80007-10</b> 11 12 7 501 305 85 Ø 1 mm MLS 	<b>T80039-00</b> 11 12 1 740 065 	<b>V36012-00</b> 11 12 9 070 990 →09/02  <b>V36833-00</b> 11 12 0 030 496 10/02→ 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151	<b>M36012-00</b> 11 61 1 436 631 24x 	<b>X52315-01</b> 11 62 1 732 969 2x 	<b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
3,0 M 54 B 30 S3	170 kW (231 PS)	X3 3.0 i (E83) Z4 3.0 i (E85) 530 i (E60) 730 i, Li (E65, E66)	02/03-03/10	<b>D36767-00</b> <sup>(12)</sup> 11 12 0 141 055 +11 12 7 501 304 +11 62 1 732 969 (2x) <b>B36012-00</b> <sup>(13)</sup> 11 11 1 432 478	<b>H80007-00</b> 11 12 7 501 304 85 Ø MLS <b>H80007-10</b> 11 12 7 501 305 85 Ø 1 mm MLS 	<b>T80039-00</b> 11 12 1 740 065 	<b>V36833-00</b> 11 12 0 030 496 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151	<b>M36012-00</b> 11 61 1 436 631 24x 	<b>X52315-01</b> 11 62 1 732 969 2x 	<b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
3,0 M 54 306 S3	163-170 kW (222-231 PS)			<b>D36915-00</b> <sup>(12)</sup> 11 12 7 507 597 +11 12 7 501 304 +11 62 1 732 969 (2x) →09/02 <b>D36767-00</b> <sup>(12)</sup> 11 12 0 141 055 +11 12 7 501 304 +11 62 1 732 969 (2x) 10/02→ <b>B36012-00</b> <sup>(13)</sup> 11 11 1 432 478	<b>H80007-00</b> 11 12 7 501 304 85 Ø MLS <b>H80007-10</b> 11 12 7 501 305 85 Ø 1 mm MLS 	<b>T80039-00</b> 11 12 1 740 065 	<b>V36012-00</b> 11 12 9 070 990 →09/02  <b>V36833-00</b> 11 12 0 030 496 10/02→  <b>X53279-01</b> 2x NBR →09/02  <b>X83068-01</b> 2x NBR 10/02→  <b>X53722-01</b> NBR 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151	<b>M36012-00</b> 11 61 1 436 631 24x 	<b>X52315-01</b> 11 62 1 732 969 2x 	<b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
3,0 M 57 D 30 (306D1)	135-142 kW (184-193 PS)	X5 3.0 d (E53) 330 d (E46) 330 xd (E46) 530 d (E39) 730 d (E38)	08/98-02/05	<b>D36015-00</b> <sup>(12)</sup> 11 12 2 248 985  <b>B36015-00</b> <sup>(13)</sup> 11 11 2 248 975	<b>H06546-00</b> 11 12 2 248 982 1,45 mm 1 MLS <b>H16546-10</b> 11 12 2 248 983 1,55 mm 2 MLS <b>H26546-20</b> 11 12 2 248 984 84,5 Ø 1,65 mm 3 MLS 	<b>T09941-00</b> 11 12 9 067 790 	<b>X83350-01</b> 11 12 7 796 378 	<b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 6x 11 61 7 790 198 24x  <b>X89855-01</b> <sup>(10)</sup> 6x 11 61 2 246 945 	<b>X52316-01</b> 3x 11 62 7 796 480 	<b>X54471-01</b> 11 13 0 149 329 	<b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM

BMW													
Ltr. 3,0 M 57 D 30 (306D2) M 57 N 306 D2 M 57 N 306 D4 N 57 306 D2	150-160 kW (204-218 PS)	X3 3.0 d (E83) X5 3.0 d (E53) 330 Cd (E46) 330 d (E46) 330 xd (E46) 530 d (E60) 530 d (E61) 730 d (E65, E66)	10/02→ 	<b>D36916-00</b> <sup>(12)</sup> 11 12 0 150 670  <b>B36916-00</b> <sup>(13)</sup> 11 11 0 150 669	<b>H01855-00</b> 11 12 7 788 587 1,45 mm 1 MLS <b>H11855-10</b> 11 12 7 788 588 1,55 mm 2 MLS <b>H21855-20</b> 11 12 7 788 589 1,65 mm 3 MLS 	<b>T09941-00</b> 11 12 9 067 790 	<b>X83350-01</b> 11 12 7 796 378 	<b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 11 61 7 790 198 24x <b>X89855-01</b> <sup>(10)</sup> 11 61 2 246 945 	6x 6x	<b>X52316-01</b> 11 62 7 796 480 	3x <b>X54471-01</b> 11 13 0 149 329 	<b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77480-01 K</b> → 11 14 7 787 262
3,0 M 57 D 30 (306D3)	145-173 kW (197-235 PS)	X3 3.0 d (E83) X3 3.0 d (E83) X5 3.0 d (E70) X6 3.0 d (E71) 325 d (E90) 325 d (E91) 325 d (E92) 325 d (E93) 330 d (E90) 330 d (E92) 330 d (E93) 330 xd (E90) 330 xd (E91) 330 xd (E92) 525 d (E60) 525 d (E61) 525 d (E91) 525 xd (E60) 525 xd (E61) 530 d (E60) 530 d (E61) 530 xd (E60) 530 xd (E61) 730 d (E65, E66) 730 Ld (E65, E66)	10/02-12/13	<b>D38084-00</b> <sup>(12)</sup> 11 12 7 798 533  <b>B38087-00</b> <sup>(13)</sup> 11 11 0 413 924	<b>H01451-00</b> 11 12 7 801 698 1,47 mm 1 MLS <b>H11451-10</b> 11 12 7 801 699 1,57 mm 2 MLS <b>H21451-20</b> 11 12 7 801 700 1,67 mm 3 MLS <b>H31451-30</b> 11 12 7 801 701 1,77 mm MLS 	<b>T40381-00</b> 11 12 7 798 532 	<b>X83350-01</b> 11 12 7 796 378 	<b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 11 61 7 790 198 24x	6x	<b>X82042-01</b> 11 62 7 798 177 	3x <b>X54924-01</b> 11 13 7 802 669 	<b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77676-01 K</b> → 11 14 7 794 168
3,0 M 57 D 30 (306D4)	200 kW (272 PS)	535 d (E60) 535 d (E61)	09/04-12/10	<b>D38083-00</b> <sup>(12)</sup> 11 12 0 393 750  <b>B37250-00</b> <sup>(13)</sup> 11 11 0 395 221	<b>H01855-00</b> 11 12 7 788 587 1,45 mm 1 MLS <b>H11855-10</b> 11 12 7 788 588 1,55 mm 2 MLS <b>H21855-20</b> 11 12 7 788 589 1,65 mm 3 MLS 	<b>T09941-00</b> 11 12 9 067 790 	<b>X83350-01</b> 11 12 7 796 378 	<b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 11 61 7 790 198 24x <b>X89855-01</b> <sup>(10)</sup> 11 61 2 246 945 	6x 6x	<b>X52316-01</b> 11 62 7 796 480  <b>X82369-01</b> <sup>(10)</sup> 11 65 7 794 493 	3x <b>X54471-01</b> 11 13 0 149 329 	<b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77480-01 K</b> → 11 14 7 787 262

BMW													
Ltr.													
3,0 M 57 D 30 (306D5) 210 kW (286 PS) M 57 N 306 D5	X3 3.0 sd (E83) X3 3.5 d (E83) X5 3.0 sd (E70) X5 3.5 d (E70) X6 3.5 d (E71) 335 d (E90) 335 d (E91) 335 d (E92) 535 d (E60) 535 d (E61) 635 d (E63) 635 d (E64)	09/06→	<b>D38085-00</b> <sup>12</sup> 11 12 0 421 276  <b>B38087-00</b> <sup>13</sup> 11 11 0 413 924	<b>H01451-00</b> 11 12 7 801 698 1,47 mm 1 MLS <b>H11451-10</b> 11 12 7 801 699 1,57 mm 2 MLS <b>H21451-20</b> 11 12 7 801 700 1,67 mm 3 MLS <b>H31451-30</b> 11 12 7 801 701 1,77 mm MLS 	<b>T40381-00</b> 11 12 7 798 532 	<b>X83350-01</b> 11 12 7 796 378 	<b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 11 61 7 790 198 6x  <b>X89855-01</b> <sup>10</sup> 11 61 2 246 945 6x 	<b>X82357-01</b> 11 62 7 799 728 3x 	<b>X54924-01</b> 11 13 7 802 669 	<b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77676-01 K</b> → 11 14 7 794 168		
3,0 M 57 D30 TU2 (197-235 PS) M 57 306 D3 (197-235 PS) N 57 N 306 D2			<b>D38084-00</b> <sup>12</sup> 11 12 7 798 533  <b>B38086-01</b> <sup>13</sup> 11 11 7 798 531 →02/06 <b>B38087-00</b> <sup>13</sup> 11 11 0 413 924 03/06→	<b>H40381-00</b> 11 12 7 794 067 1,47 mm 1 MLS →02/06 <b>H40381-10</b> 11 12 7 794 068 1,57 mm 2 MLS →02/06 <b>H40381-20</b> 11 12 7 794 069 1,67 mm 3 MLS →02/06 <b>H40381-30</b> 11 12 7 794 857 1,77 mm MLS →02/06  <b>H01451-00</b> 11 12 7 801 698 1,47 mm 1 MLS 03/06→ <b>H11451-10</b> 11 12 7 801 699 1,57 mm 2 MLS 03/06→ <b>H21451-20</b> 11 12 7 801 700 1,67 mm 3 MLS 03/06→ <b>H31451-30</b> 11 12 7 801 701 1,77 mm MLS 03/06→ 	<b>T40381-00</b> 11 12 7 798 532 	<b>X83350-01</b> 11 12 7 796 378 	<b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171	<b>X58955-01</b> 11 61 7 790 198 6x  24x	<b>X82042-01</b> 11 62 7 798 177 3x 	<b>X54934-01</b> 11 13 7 798 122 →02/06  <b>X54924-01</b> 11 13 7 802 669 03/06→ 	<b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77676-01 K</b> → 11 14 7 794 168		

<p><b>BMW</b></p> <p>Ltr.    <b>1</b></p>										
<p>3,0 M 57 N 306 D2 160 kW (218 PS)</p>	<p><b>D36916-00</b> <sup>(12)</sup> 11 12 0 150 670  <b>B36916-00</b> <sup>(13)</sup> 11 11 0 150 669 →09/04 <b>B38086-00</b> <sup>(13)</sup> 11 11 0 398 704 10/04→</p>	<p><b>H01855-00</b> 11 12 7 788 587 1,45 mm 1  MLS <b>H11855-10</b> 11 12 7 788 588 1,55 mm 2  MLS <b>H21855-20</b> 11 12 7 788 589 1,65 mm 3  MLS </p>	<p><b>T09941-00</b> 11 12 9 067 790 </p>	<p><b>X83350-01</b> 11 12 7 796 378 </p>	<p><b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171</p>	<p><b>X58955-01</b> 11 61 7 790 198 6x 24x </p>		<p><b>X52316-01</b> 11 62 7 796 480 3x </p>	<p><b>X54471-01</b> 11 13 0 149 329 →09/04  <b>X54934-01</b> 11 13 7 798 122 10/04→ </p>	<p><b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77480-01 K</b> →  11 14 7 787 262</p>
<p>3,0 M 57 N2 306 150-180 kW D3 (204-245 PS)</p>	<p><b>D38084-00</b> <sup>(12)</sup> 11 12 7 798 533  <b>B38087-00</b> <sup>(13)</sup> 11 11 0 413 924</p>	<p><b>H01451-00</b> 11 12 7 801 698 1,47 mm 1  MLS <b>H11451-10</b> 11 12 7 801 699 1,57 mm 2  MLS <b>H21451-20</b> 11 12 7 801 700 1,67 mm 3  MLS <b>H31451-30</b> 11 12 7 801 701 1,77 mm MLS </p>	<p><b>T40381-00</b> 11 12 7 798 532 </p>	<p><b>X83350-01</b> 11 12 7 796 378 </p>	<p><b>N92116-00</b> 11 34 9 071 732 <b>P76702-00</b> 11342247171</p>	<p><b>X57674-01</b> 11 61 2 245 439 24x  <b>X58955-01</b> 11 61 7 790 198 6x </p>		<p><b>X82042-01</b> 11 62 7 798 177 3x </p>	<p><b>X54924-01</b> 11 13 7 802 669 </p>	<p><b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77676-01 K</b> →  11 14 7 794 168</p>
<p>3,0 M 60 B 30 155-160 kW (211-218 PS)</p>	<p><b>D32685-01</b> <sup>(12)</sup> 11 12 1 736 906  <b>B32685-00</b> <sup>(13)</sup> 11 11 9 070 240</p>	<p><b>H50754-00</b> 11 12 1 736 345 85 Ø Zyl. 1 - 4 <b>H50755-00</b> 11 12 1 736 346 85 Ø Zyl. 5 - 8 </p>	<p><b>T80052-00</b> 11 12 1 729 246 </p>	<p>2x <b>V32699-00 R</b> 11 12 9 069 871 Zyl. 5 - 8  <b>V36883-00 L</b> 11 12 9 069 872 Zyl. 1 - 4 </p>	<p><b>N92990-00</b> <b>P76662-00</b> 11 34 2 245 151</p>	<p>2x <b>X58957-01</b> 11 61 1 433 328 32x  <b>X89847-01</b> <sup>(10) V</sup> 11 61 1 729 727  <b>X89848-01</b> <sup>(10) H</sup> 11 61 1 729 728 </p>		<p><b>X51759-01</b> 11 62 7 505 789  <b>X52318-01</b> 11 62 7 509 677  <b>X81908-01</b>  18 30 1 728 734 </p>	<p>3x <b>X54476-01</b> 11 13 1 742 109 NBR  4x <b>X54475-01</b> <sup>(11)</sup> 11 13 1 436 324 </p>	<p><b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P77137-01 K</b> → 11 14 1 713 730 100x125x13 A SL LD FPM</p>
<p>3,0 N 51 B 30 A 160-172 kW (218-234 PS)</p>	<p><b>D37112-00</b> <sup>(12)</sup> 11 12 7 571 963  <b>B38104-00</b> <sup>(13)</sup> 11 11 7 548 101</p>	<p><b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS </p>	<p><b>T80745-00</b> 11 12 7 548 799 </p>	<p><b>V53745-00</b> </p>	<p><b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853</p>	<p><b>M38071-00</b> 11 61 7 547 242      </p>		<p><b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b>  18 10 7 549 447 </p>	<p>6x <b>X54927-01</b> 11 13 7 548 031  2x </p>	<p><b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD →01/09 <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 A LD FPM 02/09→</p>



BMW													
3,0 N 52 B 30 A	187-190 kW (254-258 PS)	330 i (E90) 330 xi (E90) 330 xi (E91) 530 i (E60) 530 xi (E61)	01/05-12/10	<p><b>D37111-00</b> <sup>12</sup> 11 12 7 548 921 →09/06</p> <p><b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 10/06→</p> <p><b>B38104-00</b> <sup>13</sup> 11 11 7 548 101</p>	<p><b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS</p> <p><b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS</p>	<p><b>T80745-00</b> 11 12 7 548 799</p>	<p><b>V38079-00</b> 11 12 7 581 215 →09/06</p> <p><b>V38072-00</b> 11 12 7 582 245 10/06→</p>	<p><b>N93120-00</b> 11 34 0 032 582 →03/06</p> <p><b>N93119-00</b> ES 11 34 0 034 068 04/06→</p> <p><b>N93123-00</b> AS 11 34 0 035 853 04/06→</p>	<p><b>M38071-00</b> 11 61 7 547 242</p>	<p><b>X82341-01</b> 18 40 7 530 606</p> <p><b>X82366-01</b> <sup>13</sup> 18 10 7 549 447</p>	<p>6x <b>X54927-01</b> 11 13 7 548 031</p> <p>2x</p>	<p><b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P77341-01</b> K → 11 11 7 584 398 90x110x12 A SL LD</p>	
3,0 N 52 B 30 A N 52 N B30 B	187-200 kW (254-272 PS)	X5 3.0 si (E70) 130 i (E87) 328 i (E90) 328 i (E92)	07/05→	<p><b>D37112-00</b> <sup>12</sup> 11 12 7 571 963</p> <p><b>B38104-00</b> <sup>13</sup> 11 11 7 548 101</p>	<p><b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS</p> <p><b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS</p>	<p><b>T80745-00</b> 11 12 7 548 799</p>	<p><b>V38072-00</b> 11 12 7 582 245</p>	<p><b>N93119-00</b> ES 11 34 0 034 068</p> <p><b>N93123-00</b> AS 11 34 0 035 853</p>	<p><b>M38071-00</b> 11 61 7 547 242</p>	<p><b>X82341-01</b> 18 40 7 530 606</p> <p><b>X82366-01</b> <sup>13</sup> 18 10 7 549 447</p>	<p>6x <b>X54927-01</b> 11 13 7 548 031</p> <p>2x</p>	<p><b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P77341-01</b> K → 11 11 7 584 398 90x110x12 A SL LD</p>	
3,0 N 52 B 30 A	190 kW (258 PS)	X3 (F25)	04/11→	<p><b>D37112-00</b> <sup>12</sup> 11 12 7 571 963</p>	<p><b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS</p> <p><b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS</p>	<p><b>T80745-00</b> 11 12 7 548 799</p>	<p><b>V38072-00</b> 11 12 7 582 245</p>	<p><b>N93119-00</b> ES 11 34 0 034 068</p> <p><b>N93123-00</b> AS 11 34 0 035 853</p>	<p><b>M38071-00</b> 11 61 7 547 242</p>	<p><b>X82341-01</b> 18 40 7 530 606</p> <p><b>X82366-01</b> <sup>13</sup> 18 10 7 549 447</p>	<p>6x <b>X71021-01</b> 11 13 7 600 482</p> <p>2x</p>	<p><b>P77865-01</b> K ← 11 11 7 593 353 65x79x10 RD FPM</p> <p><b>P77866-01</b> K → 11 11 7 587 168 90x110x8 ALD FPM</p>	
3,0 N 52 B 30 A	190 kW (258 PS)	130 i (E87)	03/05-09/12	<p><b>D37111-00</b> <sup>12</sup> 11 12 7 548 921</p> <p><b>B38104-00</b> <sup>13</sup> 11 11 7 548 101</p>	<p><b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS</p> <p><b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS</p>	<p><b>T80745-00</b> 11 12 7 548 799</p>	<p><b>V38079-00</b> 11 12 7 581 215 →09/06</p>	<p><b>N93120-00</b> 11 34 0 032 582 →03/06</p> <p><b>N93119-00</b> ES 11 34 0 034 068 04/06→</p> <p><b>N93123-00</b> AS 11 34 0 035 853 04/06→</p>	<p><b>M38071-00</b> 11 61 7 547 242</p>	<p><b>X82341-01</b> 18 40 7 530 606</p> <p><b>X82366-01</b> <sup>13</sup> 18 10 7 549 447</p>	<p>6x <b>X54927-01</b> 11 13 7 548 031</p> <p>2x</p>	<p><b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM</p> <p>→02/11</p> <p><b>P77865-01</b> K ← 11 11 7 593 353 65x79x10 RD FPM</p> <p>03/11→</p> <p><b>P77341-01</b> K → 11 11 7 584 398 90x110x12 A SL LD</p> <p>→01/09</p> <p><b>P77866-01</b> K → 11 11 7 587 168 90x110x8 ALD FPM</p> <p>02/09→</p>	

BMW														
3,0 N 52 B 30 A	190 kW (258 PS)	530 i (E60)	07/05-03/10	<p><b>D37111-00</b> <sup>12</sup> 11 12 7 548 921 →09/06</p> <p><b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 10/06→</p> <p><b>B38104-00</b> <sup>13</sup> 11 11 7 548 101</p>	<p><b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS</p> <p><b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS</p>	<p><b>T80745-00</b> 11 12 7 548 799</p>	<p><b>V38079-00</b> 11 12 7 581 215 →09/06</p> <p><b>V38072-00</b> 11 12 7 582 245 10/06→</p>	<p><b>N93120-00</b> 11 34 0 032 582 →03/06</p> <p><b>N93119-00</b> ES 11 34 0 034 068 04/06→</p> <p><b>N93123-00</b> AS 11 34 0 035 853 04/06→</p>	<p><b>M38071-00</b> 11 61 7 547 242</p>	<p><b>X82341-01</b> 18 40 7 530 606</p> <p><b>X82366-01</b> <sup>A</sup> 18 10 7 549 447</p>	<p>6x <b>X54927-01</b> 11 13 7 548 031</p> <p>2x</p>	<p><b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P77341-01</b> K → 11 11 7 584 398 90x110x12 A SL LD →01/09</p> <p><b>P77866-01</b> K → 11 11 7 587 168 90x110x8 A LD FPM 02/09→</p>		
3,0 N 52 B 30 A	190 kW (258 PS)	530 i (E61) 630 i (E64)	09/04-12/10	<p><b>D37111-00</b> <sup>12</sup> 11 12 7 548 921 →09/06</p> <p><b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 10/06→</p> <p><b>B38104-00</b> <sup>13</sup> 11 11 7 548 101</p>	<p><b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS</p> <p><b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS</p>	<p><b>T80745-00</b> 11 12 7 548 799</p>	<p><b>V38079-00</b> 11 12 7 581 215 →09/06</p> <p><b>V38072-00</b> 11 12 7 582 245 10/06→</p>	<p><b>N93120-00</b> 11 34 0 032 582 →03/06</p> <p><b>N93119-00</b> ES 11 34 0 034 068 04/06→</p> <p><b>N93123-00</b> AS 11 34 0 035 853 04/06→</p>	<p><b>M38071-00</b> 11 61 7 547 242</p>	<p><b>X82341-01</b> 18 40 7 530 606</p> <p><b>X82366-01</b> <sup>A</sup> 18 10 7 549 447</p>	<p>6x <b>X54927-01</b> 11 13 7 548 031</p> <p>2x</p>	<p><b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P77341-01</b> K → 11 11 7 584 398 90x110x12 A SL LD →01/09</p> <p><b>P77866-01</b> K → 11 11 7 587 168 90x110x8 A LD FPM 02/09→</p>		
3,0 N 52 B 30 A	190 kW (258 PS)	530 xi (E60)	07/05-03/10	<p><b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 10/06→</p> <p><b>D37111-00</b> <sup>12</sup> 11 12 7 548 921</p> <p><b>B38104-00</b> <sup>13</sup> 11 11 7 548 101</p>	<p><b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS</p> <p><b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS</p>	<p><b>T80745-00</b> 11 12 7 548 799</p>	<p><b>V38072-00</b> 11 12 7 582 245 10/06→</p> <p><b>V38079-00</b> 11 12 7 581 215</p>	<p><b>N93120-00</b> 11 34 0 032 582 →03/06</p> <p><b>N93119-00</b> ES 11 34 0 034 068 04/06→</p> <p><b>N93123-00</b> AS 11 34 0 035 853 04/06→</p>	<p><b>M38071-00</b> 11 61 7 547 242</p>	<p><b>X82341-01</b> 18 40 7 530 606</p> <p><b>X82366-01</b> <sup>A</sup> 18 10 7 549 447</p>	<p>6x <b>X54927-01</b> 11 13 7 548 031</p> <p>2x</p>	<p><b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P77341-01</b> K → 11 11 7 584 398 90x110x12 A SL LD</p>		
3,0 N 52 B 30 A	190 kW (258 PS)	630 i (E63)	09/04-07/10	<p><b>D37111-00</b> <sup>12</sup> 11 12 7 548 921 →09/06</p> <p><b>B38104-00</b> <sup>13</sup> 11 11 7 548 101</p>	<p><b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS</p> <p><b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS</p>	<p><b>T80745-00</b> 11 12 7 548 799</p>	<p><b>V38079-00</b> 11 12 7 581 215 →09/06</p> <p><b>V38072-00</b> 11 12 7 582 245 10/06→</p>	<p><b>N93120-00</b> 11 34 0 032 582 →03/06</p> <p><b>N93119-00</b> ES 11 34 0 034 068 04/06→</p> <p><b>N93123-00</b> AS 11 34 0 035 853 04/06→</p>	<p><b>M38071-00</b> 11 61 7 547 242</p>	<p><b>X82341-01</b> 18 40 7 530 606</p> <p><b>X82366-01</b> <sup>A</sup> 18 10 7 549 447</p>	<p>6x <b>X54927-01</b> 11 13 7 548 031</p> <p>2x <b>X71021-01</b> 11 13 7 600 482</p>	<p><b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM</p> <p><b>P77341-01</b> K → 11 11 7 584 398 90x110x12 A SL LD →01/09</p> <p><b>P77866-01</b> K → 11 11 7 587 168 90x110x8 A LD FPM 02/09→</p>		



BMW													
Ltr.			<b>1</b>										
3,0 N 52 B 30 A N 52 B 30 BF N52 B30 B	190-195 kW (258-265 PS)	130 i (E81, E87) 130 i (E87) 730 i (F01, F02)	03/05-12/15	<b>D37112-00</b> <sup>12</sup> 11 12 7 571 963  <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38072-00</b> 11 12 7 582 245 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X71021-01</b> 11 13 7 600 482 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 ALD FPM
3,0 N 52 B 30 A	190-200 kW (258-272 PS)	X3 3.0 si (E83) 330 i (E92) 330 xi (E92)	09/06-12/13	<b>D37111-00</b> <sup>12</sup> 11 12 7 548 921 →09/06  <b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 10/06→  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38079-00</b> 11 12 7 581 215 →09/06  <b>V38072-00</b> 11 12 7 582 245 10/06→ 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD
3,0 N 52 B 30 A	195 kW (265 PS)	Z4 3.0 si (E86)	03/06-01/09	<b>D37111-00</b> <sup>12</sup> 11 12 7 548 921 →09/06  <b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 10/06→  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38079-00</b> 11 12 7 581 215 →09/06  <b>V38072-00</b> 11 12 7 582 245 10/06→ 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD →01/09
3,0 N 52 B 30 A	200 kW (272 PS)	X5 (E70)	09/08-03/10	<b>D37112-00</b> <sup>12</sup> 11 12 7 571 963  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38072-00</b> 11 12 7 582 245 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD →01/09 <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 ALD FPM 02/09→

BMW												
Ltr.												
3,0 N 52 B 30 A 200 kW (272 PS)	330 i (E92) 530 xi (E60) 530 xi (E61)	09/06-12/10	<b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 10/06→  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38072-00</b> 11 12 7 582 245 10/06→ 	<b>N93119-00</b> ES 11 34 0 034 068 04/06→ <b>N93123-00</b> AS 11 34 0 035 853 04/06→	<b>M38071-00</b> 11 61 7 547 242 	<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031  2x <b>X71021-01</b> 11 13 7 600 482 	<b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77341-01</b> K → 11 11 7 584 398 90x110x12 A SL LD →01/09 <b>P77866-01</b> K → 11 11 7 587 168 90x110x8 A LD FPM 02/09→	
3,0 N 52 B 30 A 200 kW (272 PS)	330 xi (E92)	09/06-12/13	<b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 10/06→  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38072-00</b> 11 12 7 582 245 10/06→ 	<b>N93119-00</b> ES 11 34 0 034 068 04/06→ <b>N93123-00</b> AS 11 34 0 035 853 04/06→	<b>M38071-00</b> 11 61 7 547 242 	<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031  2x <b>X71021-01</b> 11 13 7 600 482 	<b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01</b> K ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77341-01</b> K → 11 11 7 584 398 90x110x12 A SL LD →01/09 <b>P77866-01</b> K → 11 11 7 587 168 90x110x8 A LD FPM 02/09→	
3,0 N 52 B 30 AF 190 kW (258 PS)	130 i (E87)	03/05-09/12	<b>D37111-00</b> <sup>12</sup> 11 12 7 548 921  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38079-00</b> 11 12 7 581 215 	<b>N93119-00</b> ES 11 34 0 034 068 <b>N93123-00</b> AS 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 	<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031  2x	<b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01</b> K ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77866-01</b> K → 11 11 7 587 168 90x110x8 A LD FPM	
3,0 N 52 B 30 BF 190 kW (258 PS)	730 i (F01, F02)	06/08-12/15	<b>D37112-00</b> <sup>12</sup> 11 12 7 571 963  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38072-00</b> 11 12 7 582 245 	<b>N93119-00</b> ES 11 34 0 034 068 <b>N93123-00</b> AS 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 	<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X71021-01</b> 11 13 7 600 482  2x	<b>P77410-01</b> K ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01</b> K ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77866-01</b> K 11 11 7 587 168 90x110x8 A LD FPM	

BMW												
Ltr.												
3,0 N 52 B 30 BF 195 kW (265 PS)	130 i (E87)	09/06-09/12	<b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38072-00</b> 11 12 7 582 245 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X71021-01</b> 11 13 7 600 482 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 ALD FPM →01/09
3,0 N 53 B 30 N 53 B 30 A 155-200 kW (211-272 PS)	325 i (E90) 325 i (E92) 325 i (E93) 325 xi (E91) 325 xi (E92) 330 i (E90) 330 i (E92) 330 xi (E90) 330 xi (E91) 525 i (E60) 525 i (E61) 525 xi (E60)	10/06→	<b>D38115-00</b> <sup>12</sup> 11 12 7 561 438  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101 	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>X83365-01</b> 11 12 7 544 368 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD
3,0 N 53 B 30 A 150-190 kW (204-258 PS)	523 i (F10) 523 i (F11) 528 i (F11)	12/09→	<b>D38115-00</b> <sup>12</sup> 11 12 7 561 438 	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>X83365-01</b> 11 12 7 544 368 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X71021-01</b> 11 13 7 600 482 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 ALD FPM
3,0 N 53 B 30 A 160 kW (218 PS)	325 i (E90) 325 i (E92) 325 i (E93) 325 xi (E90)	03/07-12/13	<b>D38115-00</b> <sup>12</sup> 11 12 7 561 438  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101 	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>X83365-01</b> 11 12 7 544 368 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD
3,0 N 53 B 30 A 160 kW (218 PS)	525 i (E61)	01/07-12/10	<b>D38115-00</b> <sup>12</sup> 11 12 7 561 438  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101 	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>X83365-01</b> 11 12 7 544 368 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>13</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD

BMW													
Ltr.			<b>1</b>										
3,0 N 53 B 30 A	160-200 kW (218-272 PS)	325 i (E91) 330 i (E91)	09/07-06/12	<b>D38115-00</b> <sup>12</sup> 11 12 7 561 438  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>X83365-01</b> 11 12 7 544 368 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>14</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031  2x 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD
3,0 N 53 B 30 A	160-200 kW (218-272 PS)	525 xi (E61) 530 i (E60) 630 i (E63) 630 i (E64)	01/07-12/10	<b>D38115-00</b> <sup>12</sup> 11 12 7 561 438  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>X83365-01</b> 11 12 7 544 368 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>14</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031  2x <b>X71021-01</b> 11 13 7 600 482 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 A LD FPM
3,0 N 53 B 30 A	190 kW (258 PS)	528 i (F10)	02/10→	<b>D37112-00</b> <sup>12</sup> 11 12 7 571 963 	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>V38072-00</b> 11 12 7 582 245 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>14</sup> 18 10 7 549 447 	6x  2x 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM 03/11→
3,0 N 53 B 30 A	200 kW (272 PS)	330 i (E90) 330 i (E93)	03/07-12/13	<b>D38115-00</b> <sup>12</sup> 11 12 7 561 438  <b>B38104-00</b> <sup>13</sup> 11 11 7 548 101	<b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS 	<b>T80745-00</b> 11 12 7 548 799 	<b>X83365-01</b> 11 12 7 544 368 	<b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	<b>M38071-00</b> 11 61 7 547 242 		<b>X82341-01</b> 18 40 7 530 606  <b>X82366-01</b> <sup>14</sup> 18 10 7 549 447 	6x <b>X54927-01</b> 11 13 7 548 031  2x <b>X71021-01</b> 11 13 7 600 482 	<b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 A LD FPM

BMW												
3,0 N 53 B 30 A	200 kW (272 PS)	530 i (F10) 530 i (F11)	09/11→	 <b>D38115-00</b> <sup>(12)</sup> 11 12 7 561 438	 <b>H80746-00</b> 11 12 7 553 209 1,2 mm MLS <b>H80746-10</b> 11 12 7 555 758 1,5 mm MLS	 <b>T80745-00</b> 11 12 7 548 799	 <b>X83365-01</b> 11 12 7 544 368	 <b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	 <b>M38071-00</b> 11 61 7 547 242	 <b>X82341-01</b> 18 40 7 530 606 <b>X82366-01</b> <sup>(13)</sup> 18 10 7 549 447	6x <b>X71021-01</b> 11 13 7 600 482	 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 A LD FPM
3,0 N 54 B 30 A	220-240 kW (299-326 PS)	X6 3.5 i (E71) 135 i (E82) 135 i (E88) 335 i (E90) 335 i (E91) 335 i (E92) 335 i (E93) 335 xi (E90) 335 xi (E91) 335 xi (E92) 540 i (E60) 740 i (F01, F02)	08/05-12/15	 <b>D37251-00</b> 11 12 7 572 758 <b>B38105-00</b> <sup>(13)</sup> 11 11 7 567 210	 <b>H40380-00</b> 11 12 7 557 265 1,22 mm MLS <b>H40380-10</b> 11 12 7 557 266 1,52 mm MLS	 <b>T40380-00</b> 11 12 7 574 303	 <b>X83369-01</b> 11 12 7 565 286 ACM	 <b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	 <b>M38071-00</b> 11 61 7 547 242	 <b>X71042-01</b> 11 62 7 558 906	6x <b>X54927-01</b> 11 13 7 548 031	 <b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD →01/09 <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 A LD FPM 02/09→
3,0 N 54 B 30 A	225 kW (306 PS)	X6 3.5 i (E71)	05/08-08/08	 <b>D37251-00</b> 11 12 7 572 758 <b>B38105-00</b> <sup>(13)</sup> 11 11 7 567 210	 <b>H40380-00</b> 11 12 7 557 265 1,22 mm MLS <b>H40380-10</b> 11 12 7 557 266 1,52 mm MLS	 <b>T40380-00</b> 11 12 7 574 303	 <b>X83369-01</b> 11 12 7 565 286 ACM	 <b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	 <b>M38071-00</b> 11 61 7 547 242	 <b>X71042-01</b> 11 62 7 558 906	6x <b>X54927-01</b> 11 13 7 548 031	 <b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD →01/09
3,0 N 54 B 30 A	225-250 kW (306-340 PS)	M 130 i (E82) X6 3.5 i (E72) Z4 3.5 i (E89) Z4 3.5 is (E89)	05/09→	 <b>D37251-00</b> 11 12 7 572 758 <b>B38105-00</b> <sup>(13)</sup> 11 11 7 567 210	 <b>H40380-00</b> 11 12 7 557 265 1,22 mm MLS <b>H40380-10</b> 11 12 7 557 266 1,52 mm MLS	 <b>T40380-00</b> 11 12 7 574 303	 <b>X83369-01</b> 11 12 7 565 286 ACM	 <b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	 <b>M38071-00</b> 11 61 7 547 242	 <b>X71042-01</b> 11 62 7 558 906	6x <b>X54927-01</b> 11 13 7 548 031	 <b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 A LD FPM
3,0 N 54 B 30 B	225 kW (306 PS)	335 i (E93)	03/07-12/13	 <b>D37251-00</b> 11 12 7 572 758 <b>B38105-00</b> <sup>(13)</sup> 11 11 7 567 210	 <b>H40380-00</b> 11 12 7 557 265 1,22 mm MLS <b>H40380-10</b> 11 12 7 557 266 1,52 mm MLS	 <b>T40380-00</b> 11 12 7 574 303	 <b>X83369-01</b> 11 12 7 565 286 ACM	 <b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	 <b>M38071-00</b> 11 61 7 547 242	 <b>X71042-01</b> 11 62 7 558 906	6x <b>X54927-01</b> 11 13 7 548 031	 <b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM <b>P77341-01 K</b> → 11 11 7 584 398 90x110x12 A SL LD →01/09 <b>P77676-01 K</b> → 11 14 7 794 168 02/09→

BMW												
3,0 N 55 B 30 A	220-240 kW (299-326 PS)	X3 3.5 i (F25) X5 (E70) X6 3.5 i (E71) 135 i (E82) 135 i (E88) 335 i (E90) 335 i (E91) 335 i (E92) 335 i (E93) 335 xi (E90) 335 xi (E91) 335 xi (E92) 535 i (F07) 535 i (F07) 535 i (F10) 535 i (F11) 640 i (F13)	09/06→	 <b>D90194-00</b> <sup>12</sup>	 <b>H40762-00</b> <sup>X</sup> 11 12 7 599 212 85 Ø 1,2 mm MLS <b>H40762-10</b> <sup>X</sup> 11 12 7 599 213 85 Ø 1,5 mm MLS	 <b>T38804-00</b> 11 12 2 165 470	 <b>V38802-00</b> 11 12 7 587 804	 <b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	 <b>M38071-00</b> 11 61 7 547 242  <b>X71026-01</b> <sup>10</sup> 11 61 7 588 624	 <b>X71040-01</b> 11 65 7 593 303	6x <b>X71021-01</b> 11 13 7 600 482	 <b>P77410-01 K</b> ← 11 11 7 547 842 65x79x20 RD FPM →02/11 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM 03/11→ <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 ALD FPM
3,0 N 55 B 30 A	225-260 kW (306-354 PS)	M 135 i (F20) M 135 i (F21) M 235 i X5 3.5 i (E70) X5 3.5 i (F15) X6 3.5 i (E71, E72) 3 (F30) Hybrid 3 335 i (F30) 335 i (F31) 335 i (F34) 435 i (F32) 5 (F10) Hybrid 5 535 i (F10) 535 i (F11) 640 i (F06) 640 i (F12) 640 i (F13) 7 (F01, F02) Hybrid 7 7 (F01, F02, F04) Hybrid 7	03/11→	 <b>D90194-00</b> <sup>12</sup>	 <b>H40762-00</b> <sup>X</sup> 11 12 7 599 212 85 Ø 1,2 mm MLS <b>H40762-10</b> <sup>X</sup> 11 12 7 599 213 85 Ø 1,5 mm MLS	 <b>T38804-00</b> 11 12 2 165 470	 <b>V38802-00</b> 11 12 7 587 804	 <b>N93119-00 ES</b> 11 34 0 034 068 <b>N93123-00 AS</b> 11 34 0 035 853	 <b>M38071-00</b> 11 61 7 547 242  <b>X71026-01</b> <sup>10</sup> 11 61 7 588 624	 <b>X71040-01</b> 11 65 7 593 303	6x <b>X71021-01</b> 11 13 7 600 482	 <b>P77865-01 K</b> ← 11 11 7 593 353 65x79x10 RD FPM <b>P77866-01 K</b> → 11 11 7 587 168 90x110x8 ALD FPM
3,0 N 57 D 30 A	150-190 kW (204-258 PS)	X5 3.0 d (E70) X6 3.0 d (E71) X6 3.0 d (E71, E72) 325 d (E90) 325 d (E91) 325 d (E92) 325 d (E93) 330 d (E90) 330 d (E91) 330 d (E92) 330 d (E93) 330 xd (E91) 330 xd (E92) 525 d (F10) 525 d (F11) 530 d (F07) 530 d (F10) 530 d (F11) 730 d (F01, F02) 730 d (F01, F02)	09/08→	 <b>D38807-00</b> 11 12 8 508 558  <b>B38808-00</b> <sup>13</sup> 11 11 8 508 077	 <b>H40750-00</b> 11 12 7 809 755 84,7 Ø 1,45 mm 1 □ MLS <b>H40750-10</b> 11 12 7 809 756 84,7 Ø 1,55 mm 2 □ MLS <b>H40750-20</b> 11 12 7 809 757 84,7 Ø 1,65 mm 3 □ MLS 	 <b>T38788-00</b> 11 12 8 513 130	 <b>V38781-00</b> 11 12 7 823 943 →12/10  <b>V38783-00</b> 11 12 8 515 732 01/11→ 	 <b>N93206-00</b> 11 34 7 812 926	 <b>X71027-01</b> 11 61 7 807 480	6x <b>X82358-01</b> 11 62 8 509 783  <b>X71033-01</b> <sup>14</sup> 11 65 7 808 159 	3x <b>X71023-01</b> 11 13 7 809 836	 <b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM

BMW												
Ltr.												
3,0 N 57 D 30 A 190 kW (258 PS)	X3 3.0 d (F25) X5 3.0 d (F15) 330 d (F30) 330 d (F31) 430 d (F32) 730 d (F01, F02)	05/11→										
				<b>H40752-00</b> 11 12 8 509 152 85 Ø 1,45 mm 1	<b>T38788-00</b> 11 12 8 513 130 	<b>V38783-00</b> 11 12 8 515 732 	<b>N93206-00</b> 11 34 7 812 926 	<b>X71036-01</b> 11 61 8 507 335 6x 	<b>X82358-01</b> 11 62 8 509 783 3x 	<b>70-31414-10</b> 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM	
3,0 N 57 D 30 A 190 kW (258 PS)	530 d (F10) 530 d (F11)	09/11→		<b>H40752-00</b> 11 12 8 509 152 85 Ø 1,45 mm 1	<b>T38788-00</b> 11 12 8 513 130 	<b>V38783-00</b> 11 12 8 515 732 	<b>N93206-00</b> 11 34 7 812 926 	<b>X71036-01</b> 11 61 8 507 335 6x 	<b>X82358-01</b> 11 62 8 509 783 3x 	<b>X71023-01</b> 11 13 7 809 836 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM	
3,0 N 57 D30 B 220-225 kW (299-306 PS)	535 d (F07) 535 d (F10) 535 d (F11) 740 d (F01, F02) 740 d (F01, F02)	09/09→		<b>B38808-00</b> <sup>13</sup> 11 11 8 508 077 	<b>H40750-00</b> 11 12 7 809 755 84,7 Ø 1,45 mm 1	<b>T38788-00</b> 11 12 8 513 130 	<b>V38781-00</b> 11 12 7 823 943 →12/10 	<b>N93206-00</b> 11 34 7 812 926 	<b>X71027-01</b> 11 61 7 807 480 6x 	<b>X82358-01</b> 11 62 8 509 783 3x 	<b>X71023-01</b> 11 13 7 809 836 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM

BMW																					
3,0 N 57 D30 B	225 kW (306 PS)	X6 (E71, E72)	10/10-06/14																		
Ltr.																					
3,0 N 57 D30 B	230 kW (313 PS)	X3 (F25) 335 d (F30) 435 d (F32) 640 d (F06) 640 d (F12) 640 d (F13) 740 d (F01)	11/10→																		
3,0 N 57 D30 B	230 kW (313 PS)	535 d (F07) 535 d (F10)	09/11→																		



BMW															
3,0 N 57 D30 B	230 kW (313 PS)	535 d (F11)	09/11→												
Ltr.			<b>1</b>												
3,0 N 57 D30 B	230 kW (313 PS)	535 d (F11)	09/11→	<b>B38808-00</b> 11 11 8 508 077			<b>H40750-00</b> 11 12 7 809 755 84,7 Ø 1,45 mm 1 MLS <b>H40750-10</b> 11 12 7 809 756 84,7 Ø 1,55 mm 2 MLS <b>H40750-20</b> 11 12 7 809 757 84,7 Ø 1,65 mm 3 MLS 	<b>T38788-00</b> 11 12 8 513 130 	<b>V38783-00</b> 11 12 8 515 732 	<b>N93206-00</b> 11 34 7 812 926	<b>X71027-01</b> 11 61 7 807 480 <b>X71036-01</b> 11 61 8 507 335 6x 		<b>X82358-01</b> 11 62 8 509 783 	3x <b>X71023-01</b> 11 13 7 809 836 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM
3,0 N 57 D30 B	230 kW (313 PS)	740 d (F01, F02)	07/12-12/15				<b>H40752-00</b> 11 12 8 509 152 85 Ø 1,45 mm 1 MLS <b>H40752-10</b> 11 12 8 509 153 85 Ø 1,55 mm 2 MLS <b>H40752-20</b> 11 12 8 509 154 85 Ø 1,65 mm 3 MLS 	<b>T38788-00</b> 11 12 8 513 130 	<b>V38783-00</b> 11 12 8 515 732 	<b>N93206-00</b> 11 34 7 812 926	<b>X71036-01</b> 11 61 8 507 335 6x 		<b>X82358-01</b> 11 62 8 509 783 	3x <b>X71023-01</b> 11 13 7 809 836 	<b>P77356-01 K</b> ← 11 11 7 802 665 55x68x8 RD FPM <b>P77674-01 K</b> → 11 14 7 797 490 90x104x8,5 LD FPM

BMW												
Ltr.			<b>1</b>									
3,0 N 57 N 306 D3	145-170 kW (197-231 PS)			<b>D38083-00</b> <sup>12</sup> 11 12 0 393 750  <b>B38087-00</b> <sup>13</sup> 11 11 0 413 924	<b>H01451-00</b> 11 12 7 801 698 1,47 mm 1 MLS <b>H11451-10</b> 11 12 7 801 699 1,57 mm 2 MLS <b>H21451-20</b> 11 12 7 801 700 1,67 mm 3 MLS <b>H31451-30</b> 11 12 7 801 701 1,77 mm MLS 	<b>T40381-00</b> 11 12 7 798 532 	<b>X83350-01</b> 11 12 7 796 378 	<b>N92116-00</b> 11 34 9 071 732	<b>X58955-01</b> 11 61 7 790 198  6x <b>X89855-01</b> <sup>10</sup> 11 61 2 246 945  6x	<b>X82042-01</b> 11 62 7 798 177  3x <b>X54924-01</b> 11 13 7 802 669 	<b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77676-01 K</b> → 11 14 7 794 168	
3,0 N 57 N 306 D5	145-210 kW N 57 306 D3 (197-286 PS)			<b>D38083-00</b> <sup>12</sup> 11 12 0 393 750  <b>B38087-00</b> <sup>13</sup> 11 11 0 413 924	<b>H01451-00</b> 11 12 7 801 698 1,47 mm 1 MLS <b>H11451-10</b> 11 12 7 801 699 1,57 mm 2 MLS <b>H21451-20</b> 11 12 7 801 700 1,67 mm 3 MLS <b>H31451-30</b> 11 12 7 801 701 1,77 mm MLS 	<b>T40381-00</b> 11 12 7 798 532 	<b>X83350-01</b> 11 12 7 796 378 	<b>N92116-00</b> 11 34 9 071 732	<b>X58955-01</b> 11 61 7 790 198  4x <b>X89855-01</b> <sup>10</sup> 11 61 2 246 945  6x	<b>X82042-01</b> 11 62 7 798 177  3x <b>X54924-01</b> 11 13 7 802 669 	<b>P76443-01 K</b> ← 11 14 2 249 534 55x68x8 A SL RD FPM <b>P77676-01 K</b> → 11 14 7 794 168	
3,0 S 50 B 30 USA	176 kW (240 PS)	01/93-10/96	<b>D36919-00</b> <sup>12</sup> 11 12 9 067 421 <b>B36023-00</b> <sup>13</sup> 11 11 1 402 381	<b>H50935-00</b> 11 12 1 405 106 87 Ø 1,74 mm 	<b>V32248-00</b> 11 12 9 070 531 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151	<b>X57723-01</b> 11 61 1 717 259 24x 	<b>X51361-01</b> 11 62 1 728 983  3x <b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P77003-01 K</b> → 90x110x12 AB SL LD PTFE			
3,2 M 30 B 32	145 kW (197 PS)	633 CSi (E24) 732 i (E23) 732 i / 733 i (E23)	05/77-08/86	<b>D36920-00</b> <sup>12</sup> 11 12 9 065 713 →09/80 <b>D31666-00</b> <sup>12</sup> 11129065714 10/80→ <b>B31431-00</b> <sup>13</sup> 11 00 1 267 942 <b>E31431-00</b> <sup>2</sup> 11 14 1 735 047	<b>H50051-00</b> 11 12 9 065 638 90 Ø <b>H50051-10</b> 11129065639 90 Ø 	<b>T50050-00</b> 11 12 0 621 144(14x) 	<b>X51212-01</b> 11 12 1 730 231 	<b>N91210-00</b> 11 34 9 059 170 <b>P76531-00</b> 11 34 1 273 501	<b>X55928-01</b> 11 61 1 730 788 12x 	<b>X51211-01</b> 11 62 1 723 851  6x <b>X51216-01</b> <sup>10</sup> 18 11 1 245 500 	<b>X54103-01</b> 11 13 1 315 085 	<b>P76231-01 K</b> ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
3,2 M 30 B 32 L- Jetronic	152 kW (206 PS)	2000 3.2 CSL (E9)	01/74-12/75	<b>D36391-00</b> <sup>12</sup> 11 12 9 065 705 <b>B31431-00</b> <sup>13</sup> 11 00 1 267 942	<b>H50051-00</b> 11 12 9 065 638 90 Ø <b>H50051-10</b> 11129065639 90 Ø 	<b>T50050-00</b> 11 12 0 621 144(14x) 	<b>X51214-01</b> 11 12 1 730 935 	<b>P76744-00</b> 11 34 1 256 556	<b>X55928-01</b> 11 61 1 730 788 12x 	<b>X51211-01</b> 11 62 1 723 851  6x <b>X54103-01</b> 11 13 1 315 085 	<b>P76231-01 K</b> ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM	


BMW													
Ltr.			<b>1</b>										
3,2 S 50 B 32 S 50 326 S4	236-252 kW (321-343 PS)			<b>D32684-00</b> <sup>12</sup> <b>B36023-00</b> <sup>13</sup> 11 11 1 402 381	<b>H50761-00</b> 11 12 1 405 748 86,5 Ø 		<b>X53486-01</b> 11 12 1 404 358 NBR  <b>X53487-01</b> 11 12 1 317 386 NBR 	<b>N92830-00</b> 11 34 9 064 457 <b>P76662-00</b> 11 34 2 245 151	24x		<b>X51949-01</b> 11 62 1 317 109 	6x <b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
3,2 S 54 B 32 S 54 B (326 S4) S 54 N 326 S4 S 54 326 S4	239-265 kW (325-360 PS)	M3 CSL (E46) M3 (E46) M3 3.2 (E46) Z3 M 3.2 (E36) Z3 M 3.2 i (E36) Z4 M 3.2 (E85) Z4 M 3.2 (E86)	06/00→	<b>D38063-00</b> <sup>12</sup> 11 12 7 831 920 +11 12 7 835 918 <b>B38039-00</b> <sup>13</sup> 11 11 0 302 722	<b>H80696-00</b> 11 12 7 835 918 0,65 mm MLS 	<b>T80696-00</b> 11 12 7 831 862 	<b>V38066-00</b> 11 12 7 832 034 <b>X83349-01</b> 11 12 7 832 034 	<b>N92993-00</b> <b>P76662-00</b> 11 34 2 245 151	12x		<b>X82345-01</b> 11 62 7 830 667 	6x <b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P77003-01 K</b> → 90x110x12 AB SL LD PTFE
3,2 S54 B 32	239-265 kW (325-360 PS)			<b>D38063-00</b> <sup>12</sup> 11 12 7 831 920 +11 12 7 835 918 <b>B38039-00</b> <sup>13</sup> 11 11 0 302 722	<b>H80969-00</b> 92,5 Ø 	<b>T80696-00</b> 11 12 7 831 862 	<b>V38066-00</b> 11 12 7 832 034 <b>X83349-01</b> 11 12 7 832 034 	<b>N92993-00</b> <b>P76662-00</b> 11 34 2 245 151	12x		<b>X82345-01</b> 11 62 7 830 667 	6x <b>X54250-01</b> 11 13 1 437 237 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P77003-01 K</b> → 90x110x12 AB SL LD PTFE
3,3 M 30 B 33 (35/40 INAT)	140 kW (190 PS)	3.3 L (E3)	01/74-09/76	<b>D36391-00</b> <sup>12</sup> 11 12 9 065 705 <b>B31431-00</b> <sup>13</sup> 11 00 1 267 942 <b>E31431-00</b> <sup>2</sup> 11 14 1 735 047	<b>H50051-00</b> 11 12 9 065 638 90 Ø <b>H50051-10</b> 11129065639 90 Ø 	<b>T50050-00</b> 11 12 0 621 144(14x) 	<b>X51214-01</b> 11 12 1 730 935 	<b>P76744-00</b> 11 34 1 256 556	12x	<b>X55928-01</b> 11 61 1 730 788 	6x <b>X51211-01</b> 11 62 1 723 851 	6x <b>X54103-01</b> 11 13 1 315 085 	<b>P76231-01 K</b> ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
3,4 M 30 B 35	141-185 kW (192-252 PS)	635 CSi (E24) 745 i (E32)	05/83-09/90	<b>D31678-00</b> <sup>12</sup> 11121730223 <b>B31431-00</b> <sup>13</sup> 11 00 1 267 942	<b>H50053-00</b> 11 12 1 730 223 92,5 Ø <b>H50053-10</b> 11121716224 92,5 Ø 	<b>T50050-00</b> 11 12 0 621 144(14x) 	<b>X51214-01</b> 11 12 1 730 935 	<b>N91210-00</b> 11 34 9 059 170 <b>P76531-00</b> 11 34 1 273 501	12x	<b>X55928-01</b> 11 61 1 730 788 	6x <b>X51369-01</b> <sup>A</sup> 11 62 1 271 957 	<b>X54103-01</b> 11 13 1 315 085 	<b>P76231-01 K</b> ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM
3,4 M 30 B 35 L- Jetronic,10:1 M 30 B 35 Motronic,9.3:1	160 kW (218 PS)	635 CSi (E24)	06/78-08/88	<b>D36922-00</b> <sup>12</sup> 11 12 9 059 247 →09/80 <b>D36923-00</b> <sup>12</sup> 11 12 1 730 933 09/80-05/82 <b>D31434-00</b> <sup>12</sup> 11 12 1 730 780 05/82-08/86 <b>D31435-00</b> <sup>12</sup> 11 12 9 059 238 08/86→ <b>B31431-00</b> <sup>13</sup> 11 00 1 267 942 <b>E31431-00</b> <sup>2</sup> 11 14 1 735 047	<b>H50054-00</b> 11 12 1 730 951 94,5 Ø →04/82 <b>H50054-10</b> 11 12 9 065 639 94,5 Ø →04/82  <b>H50053-00</b> 11 12 1 730 223 92,5 Ø 05/82→ <b>H50053-10</b> 11121716224 92,5 Ø 05/82→ 	<b>T50050-00</b> 11 12 0 621 144(14x) 	<b>X51214-01</b> 11 12 1 730 935 →09/80  <b>X51212-01</b> 11 12 1 730 231 10/80→ 	<b>N91210-00</b> 11 34 9 059 170 <b>P76531-00</b> 11 34 1 273 501	12x	<b>X55928-01</b> 11 61 1 730 788 	6x <b>X51211-01</b> 11 62 1 723 851 →04/82  <b>X51215-01</b> 11 62 1 723 656 05/82→  <b>X51216-01</b> <sup>A</sup> 18 11 1 245 500 10/80→  <b>X51208-01</b> <sup>A</sup> 11 76 1 711 717 	6x <b>X54103-01</b> 11 13 1 315 085 	<b>P76231-01 K</b> ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01 K</b> → 11 14 2 245 364 90x110x12 A SL LD FPM

BMW														
3,4 M 30 B 35 Motronic M 30 B 35 Motronic,10:1	141-160 kW (192-218 PS)	M 535 i (E28) 635 CSi (E24) 635 i (E24) 735 i (E23)	06/78-10/89	<b>D31434-00</b> ⑫ 11 12 1 730 780 <b>B31431-00</b> ⑬ 11 00 1 267 942 <b>E31431-00</b> ② 11 14 1 735 047	<b>H50053-00</b> 11 12 1 730 223 92,5 Ø <b>H50053-10</b> 11121716224 92,5 Ø	<b>T50050-00</b> 11 12 0 621 144(14x)	<b>X51212-01</b> 11 12 1 730 231	<b>N91210-00</b> 11 34 9 059 170 <b>P76531-00</b> 11 34 1 273 501	<b>X55928-01</b> 11 61 1 730 788 12x	6x	<b>X51211-01</b> 11 62 1 723 851 <b>X51208-01</b> ⚠ 11 76 1 711 717	6x 2x	<b>X54103-01</b> 11 13 1 315 085	<b>P76231-01</b> K ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01</b> K → 11 14 2 245 364 90x110x12 A SL LD FPM
3,4 M 30 B 35 Motronic,9.2:1 M 30 B35 (Motronic,9:1, Kat.)	155-162 kW (211-220 PS)	735 i,iL (E32)	09/86→	<b>D31435-00</b> ⑫ 11 12 9 059 238 <b>B31433-00</b> ⑬ 11 00 9 058 775 <b>E31431-00</b> ② 11 14 1 735 047	<b>H50053-00</b> 11 12 1 730 223 92,5 Ø <b>H50053-10</b> 11121716224 92,5 Ø	<b>T50050-00</b> 11 12 0 621 144(14x)	<b>X51212-01</b> 11 12 1 730 231	<b>N91210-00</b> 11 34 9 059 170 <b>P76531-00</b> 11 34 1 273 501	<b>X55950-01</b> 11 61 1 726 016 12x	6x	<b>X51215-01</b> 11 62 1 723 656 <b>X51208-01</b> ⚠ 11 76 1 711 717	2x	<b>X54106-01</b> 11 13 1 722 695 Kork	<b>P76231-01</b> K ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01</b> K → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76074-01</b> N 11141271415 28x40x7 A SL RD FPM
3,4 M 30 B 35 Motronic,9.3:1	160 kW (218 PS)	M 535 i (E12)	06/80-08/81	<b>D36922-00</b> ⑫ 11 12 9 059 247 →09/80 <b>D36923-00</b> ⑫ 11 12 1 730 933 09/80→ <b>B31431-00</b> ⑬ 11 00 1 267 942 <b>E31431-00</b> ② 11 14 1 735 047	<b>H50054-00</b> 11 12 1 730 951 94,5 Ø <b>H50054-10</b> 11 12 9 065 639 94,5 Ø	<b>T50050-00</b> 11 12 0 621 144(14x)	<b>X51214-01</b> 11 12 1 730 935 →09/80 <b>X51212-01</b> 11 12 1 730 231 10/80→	<b>N91210-00</b> 11 34 9 059 170 <b>P76531-00</b> 11 34 1 273 501	<b>X55928-01</b> 11 61 1 730 788 12x	6x	<b>X51211-01</b> 11 62 1 723 851 <b>X51208-01</b> ⚠ 11 76 1 711 717	6x 2x	<b>X54103-01</b> 11 13 1 315 085	<b>P76231-01</b> K ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01</b> K → 11 14 2 245 364 90x110x12 A SL LD FPM
3,4 M 30 B 35 Motronic,9.3:1	160 kW (218 PS)	735 i (E23)	09/79-08/86	<b>D36922-00</b> ⑫ 11 12 9 059 247 →09/80 <b>D36923-00</b> ⑫ 11 12 1 730 933 09/80-05/82 <b>D31434-00</b> ⑫ 11 12 1 730 780 05/82→ <b>B31431-00</b> ⑬ 11 00 1 267 942 <b>E31431-00</b> ② 11 14 1 735 047	<b>H50054-00</b> 11 12 1 730 951 94,5 Ø →04/82 <b>H50054-10</b> 11 12 9 065 639 94,5 Ø →04/82 <b>H50053-00</b> 11 12 1 730 223 92,5 Ø 05/82→ <b>H50053-10</b> 11121716224 92,5 Ø 05/82→	<b>T50050-00</b> 11 12 0 621 144(14x)	<b>X51214-01</b> 11 12 1 730 935 →09/80 <b>X51212-01</b> 11 12 1 730 231 10/80→	<b>N91210-00</b> 11 34 9 059 170 <b>P76531-00</b> 11 34 1 273 501	<b>X55928-01</b> 11 61 1 730 788 12x	6x	<b>X51211-01</b> 11 62 1 723 851 →04/82 <b>X51215-01</b> 11 62 1 723 656 05/82→ <b>X51208-01</b> ⚠ 11 76 1 711 717	6x 2x	<b>X54103-01</b> 11 13 1 315 085	<b>P76231-01</b> K ← 11 14 1 715 100 42x62x12 A SL RD FPM <b>P76378-01</b> K → 11 14 2 245 364 90x110x12 A SL LD FPM

BMW												
Ltr.												
3,5 M 62 B 35 S1 173 kW (235 PS)	535 i (E39) 735 i,L (E38)	01/96-11/01	<b>D36021-00</b> <sup>(12)</sup> 11 12 9 069 055  <b>B32685-00</b> <sup>(13)</sup> 11 11 9 070 240	<b>H80052-00 R</b> 11 12 1 433 463 85 Ø 1,74 mm MLS Zyl. 1 - 4 <b>H80052-10 R</b> 11 12 1 433 464 85 Ø 2,07 mm MLS Zyl. 1 - 4  <b>H80053-00 L</b> 11 12 1 433 467 85 Ø 1,74 mm MLS Zyl. 5 - 8 <b>H80053-10 L</b> 11 12 1 433 468 85 Ø 2,07 mm MLS Zyl. 5 - 8 	<b>T80052-00</b> 11 12 1 729 246 	<b>V32699-00 R</b> 11 12 9 069 871 Zyl. 5 - 8  <b>V36883-00 L</b> 11 12 9 069 872 Zyl. 1 - 4 	<b>N92990-00</b> <b>P76662-00</b> 11 34 2 245 151	2x 32x <b>X58957-01</b> 11 61 1 433 328  <b>X89847-01</b> <sup>(10) V</sup> 11 61 1 729 727  <b>X89848-01</b> <sup>(10) H</sup> 11 61 1 729 728 	4x <b>X51759-01</b> 11 62 7 505 789  <b>X52318-01</b> 11 62 7 509 677 	3x <b>X54476-01</b> 11 13 1 742 109 NBR  <b>X54475-01</b> <sup>(11)</sup> 11 13 1 436 324 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P77137-01 K</b> → 11 14 1 713 730 100x125x13 A SL LD FPM	
3,5 M 62 B 35 TU 175-180 kW (238-245 PS)			<b>D36017-00</b> <sup>(12)</sup> 11 12 0 004 553  <b>B32685-00</b> <sup>(13)</sup> 11 11 9 070 240	<b>H80052-00 R</b> 11 12 1 433 463 85 Ø 1,74 mm MLS Zyl. 1 - 4 <b>H80052-10 R</b> 11 12 1 433 464 85 Ø 2,07 mm MLS Zyl. 1 - 4  <b>H80053-00 L</b> 11 12 1 433 467 85 Ø 1,74 mm MLS Zyl. 5 - 8 <b>H80053-10 L</b> 11 12 1 433 468 85 Ø 2,07 mm MLS Zyl. 5 - 8 	<b>T80052-00</b> 11 12 1 729 246 	2x <b>V36844-00 R</b> 11 12 0 034 104 Zyl. 1 - 4  <b>V36845-00 L</b> 11 12 0 034 105 Zyl. 5 - 8 	<b>N92990-00</b> <b>P76662-00</b> 11 34 2 245 151	2x 32x <b>X58957-01</b> 11 61 1 433 328  <b>X89847-01</b> <sup>(10) V</sup> 11 61 1 729 727  <b>X89848-01</b> <sup>(10) H</sup> 11 61 1 729 728 	4x <b>X51759-01</b> 11 62 7 505 789  <b>X52318-01</b> 11 62 7 509 677 	3x <b>X54476-01</b> 11 13 1 742 109 NBR 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P77137-01 K</b> → 11 14 1 713 730 100x125x13 A SL LD FPM	

BMW												
Ltr. 3,5 S 38 B 36 210 kW S38 B36 (Kat) (286 PS)	M5 (E34) 535 i (E28)	01/85-12/88	<b>D31677-00</b> <sup>12</sup> 11 12 9 059 244 <b>B31677-00</b> <sup>13</sup> 11111315106	<b>H50233-00</b> 11 12 1 316 705 95 Ø 	<b>V31676-00</b> 11 12 1 317 689 +11 12 1 312 173 (3x)  <b>X51362-01</b> 3x  <b>X53127-01</b> 11 12 1 317 689 	<b>N92450-00</b> 2x 11 34 9 059 172 <b>P76532-00</b> 24x 11 34 1 288 544		<b>X51363-01</b> 6x 11 62 1 312 961 	<b>X54106-01</b> 6x 11 13 1 722 695 Kork 	<b>P76256-01</b> K ← 11 14 1 312 007 44x62x10 RD FPM <b>P76378-01</b> K → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76074-01</b> N 11141271415 28x40x7 A SL RD FPM		
3,6 N 62 B 36 200 kW (272 PS)			<b>D38080-00</b> <sup>12</sup> 11 12 7 518 017  <b>B38053-00</b> <sup>13</sup> <sup>35</sup> 11 11 7 551 866	<b>H40382-00</b> 11 12 7 514 378 0,75 mm MLS <b>H40382-10</b> 11 12 7 514 379 1,05 mm MLS	<b>V38081-00</b> 11 12 7 513 194 Zyl. 1 - 4  <b>V38082-00</b> 11 12 7 513 195 Zyl. 5 - 8 	<b>N93124-00</b> 2x 11 34 0 029 751 <b>P76840-00</b> 32x 11 34 7 505 417	<b>X89895-01</b> 2x 11 61 7 521 181 	<b>X51759-01</b> 3x 11 62 7 505 789 →09/03  <b>X82344-01</b> 11 62 7 505 788 →09/03  <b>X51759-01</b> 4x 11 62 7 505 789 10/03→ 	<b>X54820-01</b> 3x 11 13 7 545 293  <b>X54935-01</b> 4x 11 13 7 506 774 	<b>P77335-01</b> K ← 11 14 7 512 100 45x75x8/12 RD FPM <b>P77673-01</b> K → 11 14 7 512 101 100 LD PTFE		
3,6 S 38 B 36 232 kW (366S1) (315 PS)	M5 (E34)	10/88-05/92	<b>D31677-00</b> <sup>12</sup> 11 12 9 059 244 <b>B31677-00</b> <sup>13</sup> 11111315106	<b>H50233-00</b> 11 12 1 316 705 95 Ø 	<b>V31676-00</b> 11 12 1 317 689 +11 12 1 312 173 (3x)  <b>X51362-01</b> 3x  <b>X53127-01</b> 11 12 1 317 689 	<b>N92450-00</b> 2x 11 34 9 059 172 <b>P76532-00</b> 24x 11 34 1 288 544		<b>X51363-01</b> 6x 11 62 1 312 961 	<b>X54106-01</b> 6x 11 13 1 722 695 Kork 	<b>P76256-01</b> K ← 11 14 1 312 007 44x62x10 RD FPM <b>P76378-01</b> K → 11 14 2 245 364 90x110x12 A SL LD FPM <b>P76074-01</b> N 11141271415 28x40x7 A SL RD FPM		
4,0 N 62 B 40 A 225 kW (306 PS)	540 i (E60) 735i (E65, E66) 740 i,Li (E65, E66)	03/05-03/10	<b>D37253-00</b> <sup>12</sup> 11 12 7 551 822  <b>B38053-00</b> <sup>13</sup> <sup>35</sup> 11 11 7 551 866	<b>H40383-00</b> 11 12 7 531 863 0,75 mm MLS <b>H40383-10</b> 11 12 7 531 861 1,05 mm MLS	<b>V38081-00</b> 11 12 7 513 194 Zyl. 1 - 4  <b>V38082-00</b> 11 12 7 513 195 Zyl. 5 - 8 	<b>N93124-00</b> 2x 11 34 0 029 751 <b>P76840-00</b> 32x 11 34 7 505 417	<b>X89894-01</b> 8x 11 61 7 537 999	<b>X51759-01</b> 4x 11 62 7 505 789 	<b>X54820-01</b> 4x 11 13 7 545 293  <b>X54935-01</b> 11 13 7 506 774 	<b>P77335-01</b> K ← 11 14 7 512 100 45x75x8/12 RD FPM <b>P77673-01</b> K → 11 14 7 512 101 100 LD PTFE		


BMW



Ltr. 







1




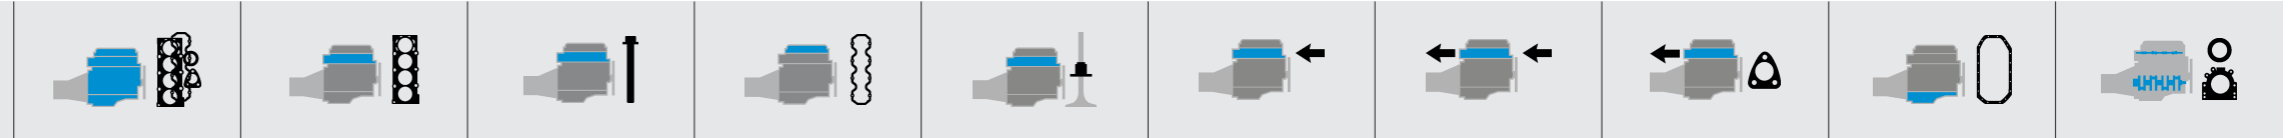
4,4 M 62 B 44 210 kW (286 PS)






**D36021-00** <sup>(12)</sup>  
11 12 9 069 055  
→08/98  
  
**D36017-00** <sup>(12)</sup>  
11 12 0 004 553  
09/98→  
  
**B32685-00** <sup>(13)</sup>  
11 11 9 070 240  
**B38119-00** <sup>(13)</sup>  
11 11 0 008 361



**H80015-00**  
11 12 1 433 473  
93 Ø  
1,74 mm  
MLS  
Zyl. 1 - 4  
10/97→  
  
**H80015-10**  
11 12 1 433 474  
93 Ø  
2,07 mm  
MLS  
Zyl. 1 - 4  
10/97→  
  
**H80016-00**  
11 12 1 433 477  
93 Ø  
1,74 mm  
MLS  
Zyl. 5 - 8  
10/97→  
  
**H80016-10**  
11 12 1 433 478  
93 Ø  
2,07 mm  
MLS  
Zyl. 5 - 8  
10/97→  






**T80052-00**  
11 12 1 729 246  


2x **V32699-00 R**  
11 12 9 069 871  
Zyl. 5 - 8  
→08/98  
  
**V36883-00 L**  
11 12 9 069 872  
Zyl. 1 - 4  
→08/98  
  
**V36844-00 R**  
11 12 0 034 104  
Zyl. 1 - 4  
09/98→  
  
**V36845-00 L**  
11 12 0 034 105  
Zyl. 5 - 8  
09/98→  


**N92990-00**  
**P76662-00**  
11 34 2 245 151


2x **X58957-01** 4x  
32x 11 61 1 433 328  
  
**X89847-01** <sup>(10) V</sup>  
11 61 1 729 727  
  
**X89848-01** <sup>(10) H</sup>  
11 61 1 729 728  

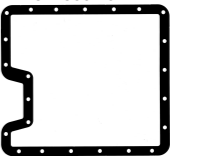
**X51759-01**  
11 62 7 505 789  
  
**X52318-01**  
11 62 7 509 677  


3x **X54476-01**  
11 13 1 742 109  
NBR  
  
**X54930-01**  
11 13 7 500 261  
  
**X54931-01**  
11 13 7 500 260  
  
**X54475-01** <sup>(11)</sup>  
11 13 1 436 324  


**P76220-01 K** ←  
11 14 1 274 346  
48x65x10  
AB SL RD FPM  
**P77137-01 K** →  
11 14 1 713 730  
100x125x13  
A SL LD FPM

BMW

Ltr. 




1





4,4 M 62 B 44 TU 210 kW  
M 62 B 44 (286 PS)  
(448S2)


540 i (E39)  
740 i,iL (E38)





01/96→



**D36021-00** <sup>12</sup>  
11 12 9 069 055  
→08/98  
  
**D36017-00** <sup>12</sup>  
11 12 0 004 553  
09/98→  
  
**B32685-00** <sup>13</sup>  
11 11 9 070 240

**H80015-00**  
11 12 1 433 473  
93 Ø  
1,74 mm  
MLS  
Zyl. 1 - 4  
10/97→  
  
**H80015-10**  
11 12 1 433 474  
93 Ø  
2,07 mm  
MLS  
Zyl. 1 - 4  
10/97→  
  
**H80016-00**  
11 12 1 433 477  
93 Ø  
1,74 mm  
MLS  
Zyl. 5 - 8  
10/97→  
  
**H80016-10**  
11 12 1 433 478  
93 Ø  
2,07 mm  
MLS  
Zyl. 5 - 8  
10/97→  




**T80052-00**  
11 12 1 729 246  


2x **V32699-00 R**  
11 12 9 069 871  
Zyl. 5 - 8  
→08/98  
  
**V36883-00 L**  
11 12 9 069 872  
Zyl. 1 - 4  
→08/98  
  
**V36844-00 R**  
11 12 0 034 104  
Zyl. 1 - 4  
09/98→  
  
**V36845-00 L**  
11 12 0 034 105  
Zyl. 5 - 8  
09/98→  


**N92990-00**  
**P76662-00**  
11 34 2 245 151

2x **X58957-01** 4x  
32x 11 61 1 433 328  


**X51759-01**  
11 62 7 505 789  
  
**X52318-01**  
11 62 7 509 677  


3x **X54476-01**  
11 13 1 742 109  
NBR  
  
**X54475-01** <sup>11</sup>  
11 13 1 436 324  


**P76220-01 K** ←  
11 14 1 274 346  
48x65x10  
AB SL RD FPM  
**P77137-01 K** →  
11 14 1 713 730  
100x125x13  
A SL LD FPM



BMW												
Ltr.												
4,4 M 62 B 44 (448S2)	210 kW (286 PS)	X5 4.4 i (E53)	05/00-12/03	<b>D36017-00</b> <sup>12</sup> 11 12 0 004 553  <b>B32685-00</b> <sup>13</sup> 11 11 9 070 240	<b>H80015-00</b> 11 12 1 433 473 93 Ø 1,74 mm MLS Zyl. 1 - 4  <b>H80015-10</b> 11 12 1 433 474 93 Ø 2,07 mm MLS Zyl. 1 - 4  <b>H80016-00</b> 11 12 1 433 477 93 Ø 1,74 mm MLS Zyl. 5 - 8  <b>H80016-10</b> 11 12 1 433 478 93 Ø 2,07 mm MLS Zyl. 5 - 8 	<b>T80052-00</b> 11 12 1 729 246 	2x <b>V36844-00 R</b> 11 12 0 034 104 Zyl. 1 - 4  <b>V36845-00 L</b> 11 12 0 034 105 Zyl. 5 - 8 	<b>N92990-00</b> <b>P76662-00</b> 11 34 2 245 151	2x <b>X58957-01</b> 11 61 1 433 328 4x	<b>X51759-01</b> 11 62 7 505 789  <b>X52318-01</b> 11 62 7 509 677 	3x <b>X54476-01</b> 11 13 1 742 109 NBR  <b>X54475-01</b> <sup>11</sup> 11 13 1 436 324 	<b>P76220-01 K</b> ← 11 14 1 274 346 48x65x10 AB SL RD FPM <b>P77137-01 K</b> → 11 14 1 713 730 100x125x13 A SL LD FPM
4,4 N 62 B 44 N 62 B 44 A	235 kW (320 PS)	X5 4.4 i (E53)	12/03-09/06	<b>D38080-00</b> <sup>12</sup> 11 12 7 518 017  <b>B38054-00</b> <sup>13</sup> 11 11 0 304 864	<b>H80747-00</b> 11 12 7 513 944 0,75 mm MLS <b>H80747-10</b> 11 12 7 513 945 1,05 mm MLS 	2x <b>T80747-00</b> 11 12 7 583 113 	2x <b>V38081-00</b> 11 12 7 513 194 Zyl. 1 - 4  <b>V38082-00</b> 11 12 7 513 195 Zyl. 5 - 8 	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417	2x <b>X89895-01</b> 11 61 7 521 181 2x	<b>X51759-01</b> 11 62 7 505 789 	4x <b>X54820-01</b> 11 13 7 545 293  <b>X54936-01</b> 11 13 7 539 582 	<b>P77357-01 K</b> ← 11 14 7 558 914 45x75x13,5/20 A SL RD <b>P77673-01 K</b> → 11 14 7 512 101 100 LD PTFE
4,4 N 62 B 44 A	245 kW (333 PS)	545 i (E60) 545 i (E61)	09/03-12/10	<b>D38080-00</b> <sup>12</sup> 11 12 7 518 017  <b>B38053-00</b> <sup>13</sup> <sup>35</sup> 11 11 7 551 866	<b>H80747-00</b> 11 12 7 513 944 0,75 mm MLS <b>H80747-10</b> 11 12 7 513 945 1,05 mm MLS 	2x <b>T80747-00</b> 11 12 7 583 113 	2x <b>V38081-00</b> 11 12 7 513 194 Zyl. 1 - 4  <b>V38082-00</b> 11 12 7 513 195 Zyl. 5 - 8 	<b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417	2x <b>X89895-01</b> 11 61 7 521 181 2x	<b>X51759-01</b> 11 62 7 505 789 	4x <b>X54820-01</b> 11 13 7 545 293  <b>X54935-01</b> 11 13 7 506 774 	<b>P77335-01 K</b> ← 11 14 7 512 100 45x75x8/12 RD FPM <b>P77673-01 K</b> → 11 14 7 512 101 100 LD PTFE

BMW												
Ltr.  4,4 N 62 B 44 A 245 kW (333 PS) 645 Ci (E63) 645 Ci (E64) 745 i, Li (E65, E66)	11/01-07/08 											
4,4 N 63 B 44 A [NEW] 300-357 kW (407-485 PS) X5 5.0 i (E70) X6 (E71, E72) Hybrid X6 X6 5.0 i (E71) X6 5.0 i (E71, E72) 550 i (F07) 550 i F07) 550 i (F10) 550 i (F11) 650 i (F12) 650 i (F12) 650 i (F13) 7 (F01, F02) Hybrid 7 7 (F01, F02, F04) Hybrid 7 750 i (F01, F02) 750 i (F01, F02)	05/08→											
4,4 S 63 B 44 A 408 kW (555 PS) X5 M 4.4 i (E70) X6 (E71)	09/09-06/14											

BMW												
Ltr.    1 4,6 M 62 B 46 (468S1) M 67 468 S1 255 kW (347 PS) X5 (E53) 02/02→	<del>D36017-00</del> <sup>12</sup> 11 12 0 004 553  B38119-00 <sup>13</sup> 11 11 0 008 361	H40455-00 11 12 7 519 406 93,5 Ø 1,65 mm MLS Zyl. 1 - 4 H40455-10 11 12 7 519 405 93,5 Ø 1,95 mm MLS Zyl. 1 - 4  H40456-00 11 12 7 519 410 93,5 Ø 1,65 mm MLS Zyl. 5 - 8 H40456-10 11 12 7 519 409 93,5 Ø 1,95 mm MLS Zyl. 5 - 8 	T80052-00 11 12 1 729 246 	2x V36844-00 R 11 12 0 034 104 Zyl. 1 - 4  V36845-00 L 11 12 0 034 105 Zyl. 5 - 8 	N92990-00 P76662-00 11 34 2 245 151 2x 32x	X58957-01 11 61 1 433 328 4x 	X51759-01 11 62 7 505 789 3x  X52318-01 11 62 7 509 677 	X54930-01 11 13 7 500 261 3x  X54931-01 11 13 7 500 260 	P76220-01 K ← 11 14 1 274 346 48x65x10 AB SL RD FPM P77137-01 K → 11 14 1 713 730 100x125x13 A SL LD FPM			
4,8 N 62 B 48 A 265 kW (360 PS) X5 4.8 is (E53) 04/04-09/06	<del>D37254-00</del> <sup>12</sup> 11 12 0 306 824 +11 61 7 521 181 (2x)  B38054-00 <sup>13</sup> 11 11 0 304 864	H40384-00 11 12 7 530 256 0,75 mm MLS H40384-10 11 12 7 530 257 1,05 mm MLS 2x 	2x T80747-00 11 12 7 583 113 	2x V38081-00 11 12 7 513 194 Zyl. 1 - 4  V38082-00 11 12 7 513 195 Zyl. 5 - 8 	N93124-00 11 34 0 029 751 P76840-00 11 34 7 505 417 2x 32x	X89895-01 11 61 7 521 181 2x 	X51759-01 11 62 7 505 789 3x  X52318-01 11 62 7 509 677 	X54820-01 11 13 7 545 293 3x  X54936-01 11 13 7 539 582 	P77673-01 K → 11 14 7 512 101 100 LD PTFE			
4,8 N 62 B 48 A 270 kW (367 PS) 550 i (E60) 550 i (E61) 07/05-12/10	<del>D37253-00</del> <sup>12</sup> 11 12 7 551 822  B38054-00 <sup>13</sup> 11 11 0 304 864	H40384-00 11 12 7 530 256 0,75 mm MLS H40384-10 11 12 7 530 257 1,05 mm MLS 2x 	2x T80747-00 11 12 7 583 113 	2x V38081-00 11 12 7 513 194 Zyl. 1 - 4  V38082-00 11 12 7 513 195 Zyl. 5 - 8 	N93124-00 11 34 0 029 751 P76840-00 11 34 7 505 417 2x 32x	X89894-01 11 61 7 537 999 8x 	X51759-01 11 62 7 505 789 4x 	X54820-01 11 13 7 545 293 4x  X54936-01 11 13 7 539 582 	P77357-01 K ← 11 14 7 558 914 45x75x13,5/20 A SL RD P77673-01 K → 11 14 7 512 101 100 LD PTFE			

BMW												
Ltr. <b>4,8 N 62 B 48 B</b> [NEW] 261 kW (355 PS)	X5 4.8 i (E70)	02/07-06/13	<b>D37253-00</b> <sup>12</sup> 11 12 7 551 822  <b>B82509-00</b> <sup>13</sup> <sup>35</sup> 11 11 2 349 047	<b>H40384-00</b> 11 12 7 530 256 0,75 mm MLS <b>H40384-10</b> 11 12 7 530 257 1,05 mm MLS	2x <b>T80747-00</b> 11 12 7 583 113 	2x <b>V38081-00</b> 11 12 7 513 194 Zyl. 1 - 4  <b>V38082-00</b> 11 12 7 513 195 Zyl. 5 - 8 	2x <b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417 32x	8x <b>X89894-01</b> 11 61 7 537 999	4x <b>X51759-01</b> 11 62 7 505 789 	4x <b>X54820-01</b> 11 13 7 545 293  <b>X71043-01</b> 11 13 7 561 427	<b>P77357-01 K</b> ← 11 14 7 558 914 45x75x13,5/20 A SL RD <b>P77673-01 K</b> → 11 14 7 512 101 100 LD PTFE	
Ltr. <b>4,8 N 62 B 48 B</b> [NEW] 270 kW (367 PS)	550 i (E60) 550 i (E61) 650 i (E63) 650 i (E64) 750 i, Li (E65, E66)	07/05-12/10	<b>D37253-00</b> <sup>12</sup> 11 12 7 551 822  <b>B38053-00</b> <sup>13</sup> <sup>35</sup> 11 11 7 551 866	<b>H40384-00</b> 11 12 7 530 256 0,75 mm MLS <b>H40384-10</b> 11 12 7 530 257 1,05 mm MLS	2x <b>T80747-00</b> 11 12 7 583 113 	2x <b>V38081-00</b> 11 12 7 513 194 Zyl. 1 - 4  <b>V38082-00</b> 11 12 7 513 195 Zyl. 5 - 8 	2x <b>N93124-00</b> 11 34 0 029 751 <b>P76840-00</b> 11 34 7 505 417 32x	8x <b>X89894-01</b> 11 61 7 537 999	4x <b>X51759-01</b> 11 62 7 505 789 	4x <b>X54820-01</b> 11 13 7 545 293  <b>X54935-01</b> 11 13 7 506 774 	<b>P77335-01 K</b> ← 11 14 7 512 100 45x75x8/12 RD FPM <b>P77673-01 K</b> → 11 14 7 512 101 100 LD PTFE	
Ltr. <b>5,0 M70 B50</b> 230 kW (313 PS)	M5 (E39)	09/98-06/03	<b>D32686-00</b> <sup>12</sup> 11 12 9 059 239  <b>B32686-00</b> 11 11 9 059 235	<b>H50757-00</b> 11121729893 86 Ø 1,6 mm 1 Zyl. 1 - 6 <b>H50757-10</b> 11121731653 86 Ø 2,13 mm 3 Zyl. 1 - 6  <b>H50758-00</b> 11121729987 86 Ø 1,6 mm 1 Zyl. 7 - 12 <b>H50758-10</b> 11121731654 2,13 mm 3 Zyl. 7 - 12 	2x <b>T80013-00</b> 11 12 1 729 247 	2x <b>X53490-01 R</b> 11 12 1 725 002  <b>X53491-01 L</b> 11 12 1 725 003 	2x <b>N92450-00</b> 11 34 9 059 172 <b>P76532-00</b> 11 34 1 288 544 24x	12x <b>X52320-01</b> 11 62 1 708 965  4x <b>X51217-01</b>	2x <b>P77137-01 K</b> → 11 14 1 713 730 100x125x13 A SL LD FPM <b>P76074-01 N</b> 2x 11141271415 28x40x7 A SL RD FPM			
Ltr. <b>5,4 M 73 B 54</b> 240 kW (326 PS)			<b>B36020-00</b> <sup>13</sup> 11119068117	<b>H50757-00</b> 11121729893 86 Ø 1,6 mm 1 Zyl. 1 - 6  <b>H50758-00</b> 11121729987 86 Ø 1,6 mm 1 Zyl. 7 - 12 		2x <b>X53490-01 R</b> 11 12 1 725 002  <b>X53491-01 L</b> 11 12 1 725 003 	2x <b>N92450-00</b> 11 34 9 059 172 <b>P76532-00</b> 11 34 1 288 544 24x	8x <b>X81909-01</b> 11 62 1 704 539  4x <b>X81910-01</b> 11 62 1 704 540 	2x <b>P76219-01 K</b> ← 11 14 1 271 415 55x72x10 LD ACM <b>P77137-01 K</b> → 11 14 1 713 730 100x125x13 A SL LD FPM <b>P76074-01 N</b> 2x 11141271415 28x40x7 A SL RD FPM			

BMW													
Ltr.			1										
5,6 M 70 B 56	280 kW (380 PS)			<b>D32686-00</b> <sup>12</sup> 11 12 9 059 239  <b>B32686-00</b> 11 11 9 059 235		<b>T80013-00</b> 11 12 1 729 247 	2x <b>X53490-01 R</b> 11 12 1 725 002  <b>X53491-01 L</b> 11 12 1 725 003 	<b>N92450-00</b> 11 34 9 059 172 <b>P76532-00</b> 11 34 1 288 544	2x 24x		<b>X52320-01</b> 11 62 1 708 965  <b>X51217-01</b> 4x 	12x 2x <b>P77137-01 K</b> → 11 14 1 713 730 100x125x13 A SL LD FPM <b>P76074-01 N</b> 11141271415 28x40x7 A SL RD FPM	
6,0 N 73 B 60 A	327 kW (445 PS)	760 i,Li (E65, E66)	01/03-07/08	<b>D38820-00</b> 11 12 0 152 551  <b>B38820-00</b> <sup>13</sup> 11 11 7 521 322	<b>H40763-00</b> 11 12 7 515 147 0,75 mm MLS <b>H40763-10</b> 11 12 7 515 148 1,05 mm MLS	2x 2x	<b>X71016-01</b> 11 12 7 515 647 Zyl. 1 - 6  <b>X71017-01</b> 11 12 7 515 661 Zyl. 7 - 12  <b>X71018-01</b> 11 12 7 521 085 	2x 2x 6x	<b>N93205-00</b> 11 34 0 030 707	<b>X71044-01</b> 11 61 7 568 910 <b>X71025-01</b> <sup>10</sup> 11 61 1 440 321	2x 6x	<b>X51759-01</b> 11 62 7 505 789  <b>X54935-01</b> 11 13 7 506 774  <b>X71070-01</b> 11 13 7 500 006 Metall	6x 2x <b>P77335-01 K</b> ← 11 14 7 512 100 45x75x8/12 RD FPM <b>P77673-01 K</b> → 11 14 7 512 101 100 LD PTFE
6,0 N 74 B 60 A	326-400 kW (443-544 PS)				<b>H59607-00</b> 11 12 7 584 618 0,75 mm MLS <b>H59607-10</b> 11 12 7 584 612 1,05 mm MLS 	2x 2x							<b>P77335-01 K</b> ← 11 14 7 512 100 45x75x8/12 RD FPM