

DEUTZ																	
F 1L 411 D	1 Zyl.	D34754-00 ¹⁸ 0291 0295	H50782-00 0223 0384 95 Ø					X53791-01 0213 8562		X58527-01 0213 6122		X52092-01 0292 9644					P77072-01 K → 0213 6911 58x75x8 A SL ACM
F 2L 411 D	2 Zyl.	D34754-00 ¹⁸ 0291 0295	H50782-00 0223 0384 95 Ø					X53791-01 0213 8562		X58527-01 0213 6122		X52092-01 0292 9644	X54777-01 0213 9453				P77072-01 K → 0213 6911 58x75x8 A SL ACM
F 5L 413 FR	5 Zyl.	D34756-00 ¹⁸ 0291 1550						X53521-01 0414 1486		X58528-01 0414 1486		X52094-01 0418 4903					P77073-01 K ← 95x130x13 RD FPM P77074-01 K → 135x160x13/16 LD FPM
F 5L 413 R	5 Zyl.	D34755-00 ¹⁸ 0291 1516						X53520-01 0240 2812		X58528-01 0414 1486							P77073-01 K ← 95x130x13 RD FPM P77074-01 K → 135x160x13/16 LD FPM
F 6L 413 F 6L 413 V	6 Zyl.	A38345-00 ¹⁴ ¹⁶ 0291 1525 S32755-00 ¹³ D34755-00 ¹⁸ 0291 1516						X53520-01 0240 2812		X58528-01 0414 1486			X54387-01 0213 1576 Kork X54388-01 0240 3119 Stahlblech				P77075-01 K ← 90x110x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM
F 6L 413 F	6 Zyl.	S38347-00 ¹⁶ 0292 8811 D34756-00 ¹⁸ ³² 0291 1550 D34757-00 ¹⁸ ²⁶ 0291 1536						X53520-01 ²⁶ 0240 2812 X53521-01 ³²		X58528-01 0414 1486		X52094-01 0418 4903	X54387-01 ²³ 0213 1576 Kork X54388-01 ²⁴ 0240 3119 Stahlblech				P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM
F 6L 413 FR	6 Zyl.	D34756-00 ¹⁸ 0291 1550						X53521-01 0414 1486		X58528-01 0414 1486		X52094-01 0418 4903	X54387-01 0213 1576 Kork X54388-01 0240 3119 Stahlblech				P77073-01 K ← 95x130x13 RD FPM P77074-01 K → 135x160x13/16 LD FPM

DEUTZ											
F 6L 413 FW	6 Zyl.	<p>S36806-00 ¹³ 0292 8818</p> <p>D34874-00 ¹² ¹⁸ 0291 1545</p>			<p>X53521-01 6x</p>	<p>P76690-00 12x</p>	<p>X58528-01 6x 0414 1486</p>		<p>X52094-01 6x 0418 4903</p>	<p>X54387-01 0213 1576 Kork</p>	<p>P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM</p>
F 6L 413 R	6 Zyl.	<p>D34755-00 ¹⁸ 0291 1516</p>			<p>X53520-01 6x 0240 2812</p>		<p>X58528-01 6x 0414 1486</p>		<p>X88649-01 6x 0336 2170</p>		<p>P77073-01 K ← 95x130x13 RD FPM P77074-01 K → 135x160x13/16 LD FPM</p>
BF 8L 413 F BF 8L 513	8 Zyl.	<p>A38346-00 ¹⁴ 0291 1539</p> <p>D34756-00 ¹⁸ 0291 1550</p> <p>D34757-00 ¹⁸ ²⁶ 0291 1536</p>			<p>X53520-01 ²⁶ 8x 0240 2812</p> <p>X53521-01</p>		<p>X58528-01 8x 0414 1486</p>		<p>X52094-01 8x 0418 4903</p>	<p>X54389-01 0213 1577</p>	<p>P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM</p>
F 8L 413	8 Zyl.	<p>A32755-00 ¹⁴ 0291 1526</p> <p>D34755-00 ¹⁸ 0291 1516</p>			<p>X53520-01 8x 0240 2812</p>		<p>X58528-01 8x 0414 1486</p>		<p>X88649-01 8x 0336 2170</p>	<p>X54389-01 0213 1577</p>	<p>P77075-01 K ← 90x110x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM</p>
F 8L 413 F	8 Zyl.	<p>A38344-00 ¹⁴ 0291 1537</p> <p>S32757-00 ¹³ 0291 1537</p> <p>S36576-00 ¹³ 0292 8809 +0242 1819 +0242 1820</p> <p>D34756-00 ¹⁸ 0291 1550</p> <p>D34757-00 ¹⁸ ²⁶ 0291 1536</p>			<p>X53520-01 ²⁶ 8x 0240 2812</p> <p>X53521-01</p>		<p>X58528-01 8x 0414 1486</p>		<p>X52094-01 8x 0418 4903</p>	<p>X54389-01 0213 1577</p>	<p>P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM</p>
F 8L 413 FW F 8L 413 W	8 Zyl.	<p>S36807-00 ¹² ¹³ 0292 8985</p> <p>D34874-00 ¹² ¹⁸ 0291 1545</p>			<p>X53521-01 8x</p>	<p>P76690-00 16x</p>	<p>X58528-01 8x 0414 1486</p>		<p>X52094-01 8x 0418 4903</p>	<p>X54389-01 0213 1577</p>	<p>P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM</p>

DEUTZ																		
BF 10L 413 F	10 Zyl.	S36808-00 ⁽¹³⁾ ⁽³¹⁾ 0291 1554 D34756-00 ⁽¹⁸⁾ ⁽³¹⁾ 0291 1550 D34757-00 ⁽¹⁸⁾ ⁽²⁵⁾ 0291 1536 						X53520-01 ⁽²⁵⁾ 0240 2812 X53521-01 ⁽³¹⁾ 	10x			X58528-01 0414 1486 	10x		X52094-01 0418 4903 	10x	P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM	
F 10L 413	10 Zyl.	D34755-00 ⁽¹⁸⁾ 0291 1516 						X53520-01 0240 2812 	10x			X58528-01 0414 1486 	10x		X88649-01 0336 2170 	10x	P77075-01 K ← 90x110x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM	
F 10L 413 F	10 Zyl.	S36808-00 ⁽¹³⁾ ⁽³²⁾ 0291 1554 D34756-00 ⁽¹⁸⁾ ⁽³²⁾ 0291 1550 D34757-00 ⁽¹⁸⁾ ⁽²⁶⁾ 0291 1536 						X53520-01 ⁽²⁶⁾ 0240 2812 X53521-01 ⁽³²⁾ 	10x			X58528-01 0414 1486 	10x		X52094-01 0418 4903 	10x	P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM	
F 10L 413 FW	10 Zyl.	S36809-00 ⁽¹²⁾ ⁽¹³⁾ 0292 8986 D34874-00 ⁽¹²⁾ ⁽¹⁸⁾ 0291 1545 						X53521-01 	10x	P76690-00 20x		X58528-01 0414 1486 	10x		X52094-01 0418 4903 	10x	P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM	
BF 12L 413 F 12L 513	12 Zyl.	D34756-00 ⁽¹⁸⁾ 0291 1550 	12x					X53521-01 	12x			X58528-01 0414 1486 	12x		X52094-01 0418 4903 	12x	X54390-01 0213 1579 	P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM
BF 12L 413 F BF 12L 513 F	12 Zyl.	D34756-00 ⁽¹⁸⁾ ⁽³²⁾ 0291 1550 D34757-00 ⁽¹⁸⁾ ⁽²⁶⁾ 0291 1536 						X53520-01 ⁽²⁶⁾ 0240 2812 X53521-01 ⁽³²⁾ 	12x			X58528-01 0414 1486 	12x		X52094-01 0418 4903 	12x	X54390-01 0213 1579 	P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM
F 12L 413	12 Zyl.	D34755-00 ⁽¹⁸⁾ 0291 1516 						X53520-01 0240 2812 	12x			X58528-01 0414 1486 	12x		X88649-01 0336 2170 	12x	X54390-01 0213 1579 	P77075-01 K ← 90x110x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM

DEUTZ																							
F 12L 413 F	12 Zyl.																						
F 12L 413 FW	12 Zyl.																						
F 1L 511 D	1 Zyl.																						

DEUTZ											
F 2L 511 D	2 Zyl.	S36813-00 ¹³ D34371-00 ¹² ¹⁸ 0291 1563 2x	H40551-30 2x 0415 7468 102,6 Ø 1,5 mm H40551-40 2x 0415 7656 102,6 Ø 1,2 mm H40551-50 2x 0415 7467 102,6 Ø 1,45 mm H40551-60 2x 0415 7658 102,6 Ø 1,3 mm H40551-70 2x 0415 7466 102,6 Ø 1,4 mm H40551-90 2x 0415 7470 102,6 Ø 1,6 mm H50024-00 2x 0223 0216 102,6 Ø 1,1 mm	X02951-01 2x 0337 1692 	X02936-01 2x 0223 0704 	X02922-01 2x 0337 1689 	P77380-01 K ← 0116 3273 30x42x8 A SL LD ACM P93220-01 K → ✕ 0223 4498 62x80x12 A SL LD FPM				
BF 8L 513 LC BF 8L 513-225 BF 8L 513-243	8 Zyl.	D34756-00 ¹⁸ 0291 1550 		X53521-01 8x 	X58528-01 8x 0414 1486 	X52094-01 8x 0418 4903 	X54389-01 8x 0213 1577 	P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM			
F 8L 513	8 Zyl.	S36576-00 ¹³ ³² 0292 8809 +0242 1819 +0242 1820 D34756-00 ¹⁸ 0291 1550 		X53521-01 ³² 8x 	X58528-01 8x 0414 1486 	X52094-01 8x 0418 4903 	X54389-01 8x 0213 1577 	P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM			
F 10L 513	10 Zyl.	S36814-00 ¹³ ³² 0292 8813 +0242 1819 +0242 1820 D34757-00 ¹⁸ 0291 1536 		X53521-01 10x 	X58528-01 10x 0414 1486 	X52094-01 10x 0418 4903 		P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM			
BF 12L 513	12 Zyl.	D34756-00 ¹⁸ 0291 1550 		X53521-01 12x 	X58528-01 12x 0414 1486 	X52094-01 12x 0418 4903 	X54390-01 12x 0213 1579 	P77077-01 K ← 0242 1819 100x120x15 RD FPM P77076-01 K → 0241 3332 102x130x15 LD FPM			

DEUTZ																
F 2L 514	2 Zyl.	D34760-00 ¹⁸ 0330 5749	2x								X52096-01 ⁷ 0292 9305	4x			X54391-01 0336 7527	2x
F 3L 514	3 Zyl.	D34760-00 ¹⁸ 0330 5749	3x								X52096-01 ⁷ 0292 9305	6x			X54392-01 0336 7578	2x
F 1L 712 F 1L 812	1 Zyl.	D34761-00 ¹⁸ 0291 0165								X02936-01 0223 0704			X02922-01 0337 1689			P76257-01 K → ← 0116 3205 60x80x10 A SL NBR
F 2L 712 F 2L 812	2 Zyl.	D34761-00 ¹⁸ 0291 0165	2x							X02936-01 0223 0704	2x		X02922-01 0337 1689	2x		P76257-01 K → ← 0116 3205 60x80x10 A SL NBR
F 3L 712 F 3L 812 F 3L 812 D	3 Zyl.	D34761-00 ¹⁸ 0291 0165	3x							X02936-01 0223 0704	3x		X02922-01 0337 1689	3x	X03205-01 0336 2573	P76397-01 K → 0415 0783 115x140x16 B SL LD NBR P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM
F 4L 712 F 4L 812 F 4L 812 D	4 Zyl.	D34761-00 ¹⁸ 0291 0165	4x							X02936-01 0223 0704	4x		X02922-01 0337 1689	4x	X54394-01 ²⁴ 0213 6719 X54525-01 ²³ 0336 2574	P76397-01 K → 0415 0783 115x140x16 B SL LD NBR P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM
F 6L 712 F 6L 812 F 6L 812 D	6 Zyl.	D34761-00 ¹⁸ 0291 0165	6x							X02936-01 0223 0704	6x		X02922-01 0337 1689	6x	X54395-01 ²⁴ 0213 6720 X54396-01 ²³ 0336 2581	P76397-01 K → 0415 0783 115x140x16 B SL LD NBR P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM
F 6L 714	6 Zyl.	D34762-00 ¹⁸ 0291 1586	6x								X52096-01 ⁷ 0292 9305	12x		X54397-01		P77084-01 K → 150x172x18,3 A LD MVQ

DEUTZ											
F 8L 714 F 8L 714 A	8 Zyl.	D34762-00 ⁽¹⁸⁾ 0291 1586 			X53523-01 0241 2311 	8x		X52096-01 ⁽⁷⁾ 0292 9305 	16x	X54398-01 0336 9032 	P77084-01 K → 150x172x18,3 A LD MVQ
F 10L 714	10 Zyl.	D34762-00 ⁽¹⁸⁾ 0291 1586 			X53523-01 0241 2311 	10x		X52096-01 ⁽⁷⁾ 0292 9305 	20x		P77084-01 K → 150x172x18,3 A LD MVQ
F 12L 714	12 Zyl.	D34762-00 ⁽¹⁸⁾ 0291 1586 			X53523-01 0241 2311 	12x		X52096-01 ⁽⁷⁾ 0292 9305 	24x		P77084-01 K → 150x172x18,3 A LD MVQ
F 4M 716	4 Zyl.	D34764-00 ⁽¹⁸⁾ 0291 0179 Mot.4982369→	H50785-00 0215 8472 157,3 Ø 1,5 mm 	4x	X53524-01 0347 0138 	4x					
BF 6M 716	6 Zyl.	D34764-00 ⁽¹⁸⁾ 0291 0179 Mot.4982495→	H50785-00 0215 8472 157,3 Ø 1,5 mm 	6x	X53524-01 0347 0138 	6x					
F 6M 716	6 Zyl.		H50785-00 0215 8472 157,3 Ø 1,5 mm 	6x	X53524-01 0347 0138 	6x					
BF 8M 716 F 12M 716	12 Zyl.	D34764-00 ⁽¹⁸⁾ 0291 0179 Mot.4982673→	H50785-00 0215 8472 157,3 Ø 1,5 mm 	12x	X53524-01 0347 0138 	12x					
BA 6M 816	6 Zyl.	D34766-00 ⁽¹⁸⁾ 0291 1558	H50786-00 0405 0720 165 Ø 1,5 mm 	6x	X53525-01 0215 9580 	6x	X58530-01 0215 6432 	6x			
BA 8M 816	8 Zyl.	D34766-00 ⁽¹⁸⁾ 0291 1558	H50786-00 0405 0720 165 Ø 1,5 mm 	8x	X53525-01 0215 9580 	8x	X58530-01 0215 6432 	8x			

DEUTZ



BA 16M 816

16 Zyl.

D34766-00 ¹⁸
0291 1558

H50786-00 16x
0405 0720
165 Ø
1,5 mm



X53525-01 16x
0215 9580



X58530-01 16x
0215 6432



F 3L 911
F 3L 912
F 3L 913

3 Zyl.

A31275-00 ¹⁴
0292 8973



S32139-00 ¹³
0291 0182

D34275-01 ¹⁸
0293 1476



H40551-30 3x
0415 7468
102,6 Ø
1,5 mm

H40551-40 3x
0415 7656
102,6 Ø
1,2 mm

H40551-50 3x
0415 7467
102,6 Ø
1,45 mm


H40551-60 3x
0415 7658
102,6 Ø
1,3 mm

H40551-70 3x
0415 7466
102,6 Ø
1,4 mm

H40551-90 3x
0415 7470
102,6 Ø
1,6 mm

H50024-00 3x
0223 0216
102,6 Ø
1,1 mm

X02951-01 3x
0337 1692

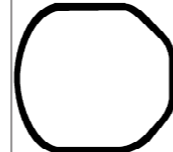

X02936-01 3x
0223 0704





X02922-01 3x
0337 1689















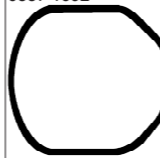



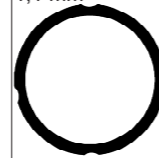
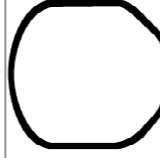



X03205-01 3x
0336 2573














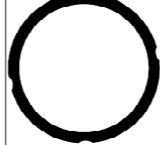
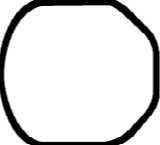





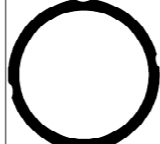
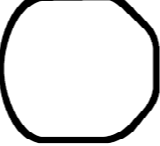




P77070-01 K ←
0415 0782
65x85x13
B SL RD FPM
P77344-01 K ←
0415 0782
65x85x10,5
A FIL RD ACM FPM
P76397-01 K →
0415 0783
115x140x16
B SL LD NBR
P77345-01 K →
0415 0392
115x140x13,5
A SL LD ACM FPM



DEUTZ											
F 4L 911 F 4L 912	4 Zyl.	<p>A31375-00 ¹⁴ S31275-01 ¹³ S31375-00 ¹³ 0292 8974</p> <p>D34275-01 ¹⁸ 0293 1476</p>	<p>H40551-30 4x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 4x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 4x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 4x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 4x 0415 7466 102,6 Ø 1,4 mm</p> <p>H40551-90 4x 0415 7470 102,6 Ø 1,6 mm</p> <p>H50024-00 4x 0223 0216 102,6 Ø 1,1 mm</p>	X02951-01 4x 0337 1692 	X02936-01 4x 0223 0704 	X02922-01 4x 0337 1689 	<p>X54394-01 4x 0213 6719 Stahlblech</p> <p>X54525-01 ²³ 0336 2574</p>	<p>P77070-01 K ← 0415 0782 65x85x13 B SL RD FPM</p> <p>P76397-01 K → 0415 0783 115x140x16 B SL LD NBR</p>			
F 6L 911 F 6L 912	6 Zyl.	<p>A36577-00 ¹³ 0291 0184</p> <p>S36577-00 ¹³ ¹⁶ 0292 8976</p> <p>D34275-01 ¹⁸ 0293 1476</p>	<p>H40551-30 6x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 6x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 6x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 6x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 6x 0415 7466 102,6 Ø 1,4 mm</p> <p>H40551-90 6x 0415 7470 102,6 Ø 1,6 mm</p> <p>H50024-00 6x 0223 0216 102,6 Ø 1,1 mm</p>	X02951-01 6x 0337 1692 	X02936-01 6x 0223 0704 	X02922-01 6x 0337 1689 	<p>X54395-01 ²⁴ 0213 6720</p> <p>X54396-01 ²³ 0336 2581</p>	<p>P77070-01 K ← 0415 0782 65x85x13 B SL RD FPM</p> <p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P76397-01 K → 0415 0783 115x140x16 B SL LD NBR</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>			

DEUTZ											
F 2L 912	2 Zyl.	<p>S32156-00 ¹³ ¹⁶ 0291 0198 D34275-01 ¹⁸ 0293 1476</p> 	<p>H40551-30 2x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 2x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 2x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 2x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 2x 0415 7466 102,6 Ø 1,4 mm</p> <p>H40551-90 2x 0415 7470 102,6 Ø 1,6 mm</p> <p>H50024-00 2x 0223 0216 102,6 Ø 1,1 mm</p> 	<p>X02951-01 2x 0337 1692</p> 	<p>X02936-01 2x 0223 0704</p> 	<p>X02922-01 2x 0337 1689</p> 	<p>P76257-01 K → ← 0116 3205 60x80x10 A SL NBR</p>				
F 5L 912	5 Zyl.	<p>S36652-00 ¹³ 0291 0228 D34275-01 ¹⁸ 0293 1476</p> 	<p>H40551-30 5x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 5x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 5x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 5x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 5x 0415 7466 102,6 Ø 1,4 mm</p> <p>H40551-90 5x 0415 7470 102,6 Ø 1,6 mm</p> <p>H50024-00 5x 0223 0216 102,6 Ø 1,1 mm</p> 	<p>X02951-01 5x 0337 1692</p> 	<p>X02936-01 5x 0223 0704</p> 	<p>X02922-01 5x 0337 1689</p> 	<p>X54778-01 0224 0933</p>  <p>P76283-01 K ← 0415 0782 65x82x12 AB 2SL WD NBR</p> <p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P76397-01 K → 0415 0783 115x140x16 B SL LD NBR</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>				

DEUTZ											
BF 6L 912	6 Zyl.	<p>A36658-00 ¹⁴ 0291 0256</p> <p>D34275-01 ¹⁸ 0293 1476</p>	<p>H40551-30 6x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 6x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 6x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 6x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 6x 0415 7466 102,6 Ø 1,4 mm</p> <p>H40551-90 6x 0415 7470 102,6 Ø 1,6 mm</p> <p>H50024-00 6x 0223 0216 102,6 Ø 1,1 mm</p>	<p>X02951-01 6x 0337 1692</p>	<p>X02936-01 6x 0223 0704</p>	<p>X02922-01 6x 0337 1689</p>	<p>X54395-01 ²⁴ 6x 0213 6720</p> <p>X54396-01 ²³ 0336 2581</p>	<p>P76283-01 K ← 0415 0782 65x82x12 AB 2SL WD NBR</p> <p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P76397-01 K → 0415 0783 115x140x16 B SL LD NBR</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>			
BF 4L 913 BF 4L 913 T	4 Zyl.	<p>D34275-01 ¹⁸ 0293 1476</p>	<p>H40551-30 4x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 4x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 4x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 4x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 4x 0415 7466 102,6 Ø 1,4 mm</p> <p>H40551-90 4x 0415 7470 102,6 Ø 1,6 mm</p> <p>H50024-00 4x 0223 0216 102,6 Ø 1,1 mm</p>	<p>X02951-01 4x 0337 1692</p>	<p>X02936-01 4x 0223 0704</p>	<p>X02922-01 4x 0337 1689</p>	<p>X54394-01 ²⁴ 4x 0213 6719</p> <p>X54525-01 ²³ 0336 2574</p>	<p>P76283-01 K ← 0415 0782 65x82x12 AB 2SL WD NBR</p> <p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P76397-01 K → 0415 0783 115x140x16 B SL LD NBR</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>			

DEUTZ											
F 4L 913	4 Zyl.	<p>A36653-00 ⁽¹⁴⁾ 0291 1535</p> <p>S36653-00 ⁽¹³⁾ 0291 1535 +0415 7236 +0423 0392 +0336 2574</p> <p>D34275-01 ⁽¹⁸⁾ 0293 1476</p> 	<p>H40551-30 4x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 4x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 4x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 4x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 4x 0415 7466 102,6 Ø 1,4 mm</p> <p>H40551-90 4x 0415 7470 102,6 Ø 1,6 mm</p> <p>H50024-00 4x 0223 0216 102,6 Ø 1,1 mm</p> 	X02951-01 4x 0337 1692 	X02936-01 4x 0223 0704 	X02922-01 4x 0337 1689 	<p>X54394-01 4x 0213 6719 Stahlblech</p>  <p>X54525-01 0336 2574</p> 	<p>P77070-01 K ← 0415 0782 65x85x13 B SL RD FPM</p> <p>P76397-01 K → 0415 0783 115x140x16 B SL LD NBR</p>			
BF 6L 913 BF 6L 913 C BF 6L 913 T	6 Zyl.	<p>A36655-00 ⁽¹⁴⁾ 0291 0279</p> <p>S36655-00 ⁽¹³⁾ 0292 9333</p> <p>D34275-01 ⁽¹⁸⁾ 0293 1476</p> 	<p>H40551-30 6x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 6x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 6x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 6x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 6x 0415 7466 102,6 Ø 1,4 mm</p> <p>H40551-90 6x 0415 7470 102,6 Ø 1,6 mm</p> <p>H50024-00 6x 0223 0216 102,6 Ø 1,1 mm</p> 	X02951-01 6x 0337 1692 	X02936-01 6x 0223 0704 	X02922-01 6x 0337 1689 	<p>X54395-01 6x 0213 6720 Stahlblech</p>  <p>X54396-01 0336 2581</p> 	<p>P76283-01 K ← 0415 0782 65x82x12 AB 2SL WD NBR</p> <p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P76397-01 K → 0415 0783 115x140x16 B SL LD NBR</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>			

DEUTZ												
F 6L 913	6 Zyl.	<p>A36654-00 ¹⁴ 0291 0278</p> <p>S36654-00 ¹³ 0291 0278</p> <p>D34275-01 ¹⁸ 0293 1476</p>	<p>H40551-30 6x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 6x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 6x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 6x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 6x 0415 7466 102,6 Ø 1,4 mm</p> <p>H40551-90 6x 0415 7470 102,6 Ø 1,6 mm</p> <p>H50024-00 6x 0223 0216 102,6 Ø 1,1 mm</p>	<p>X02951-01 6x 0337 1692</p>		<p>X02936-01 6x 0223 0704</p>		<p>X02922-01 6x 0337 1689</p>	<p>X54395-01 ²⁴ 0213 6720</p> <p>X54396-01 ²³ 0336 2581</p>	<p>P76283-01 K ← 0415 0782 65x82x12 AB 2SL WD NBR</p> <p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P76397-01 K → 0415 0783 115x140x16 B SL LD NBR</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>		
BF 3L 914	3 Zyl.	<p>S59652-01 ¹³ 0293 7523</p> <p>D59652-00 ¹⁸ 0293 7521</p>	<p>H40676-00 3x 0415 8321 3 mm</p> <p>H40676-10 3x 0415 8323 3,1 mm</p> <p>H40676-20 3x 0415 8325 3,2 mm</p> <p>H40676-30 3x 0415 8327 3,3 mm</p>	<p>X59652-01 3x 0423 8230</p>	<p>P76791-00 6x 0415 3728</p>	<p>X59391-01 3x 0223 0704</p>		<p>X59760-01 3x 0423 3529</p>	<p>X03205-01 3x 0336 2573</p>	<p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>		

DEUTZ												
D 914 L3 F 3L 914	3 Zyl.	<p>S59652-01 ¹³ 0293 7523</p> <p>D59652-00 ¹⁸ 0293 7521</p>	<p>H40551-20 3x 0415 7654 102,6 Ø 1,1 mm</p> <p>H40551-30 3x 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 3x 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 3x 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 3x 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 3x 0415 7466 102,6 Ø 1,4 mm</p>		<p>X59652-01 3x 0423 8230</p>	<p>P76791-00 6x 0415 3728</p>	<p>X59391-01 3x 0223 0704</p>		<p>X59760-01 3x 0423 3529</p>	<p>X03205-01 3x 0336 2573</p>	<p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>	
BF 4L 914	4 Zyl.	<p>S59652-02 ¹³ 0293 7524</p> <p>D59652-00 ¹⁸ 0293 7521</p>	<p>H40676-00 4x 0415 8321 3 mm</p> <p>H40676-10 4x 0415 8323 3,1 mm</p> <p>H40676-20 4x 0415 8325 3,2 mm</p> <p>H40676-30 4x 0415 8327 3,3 mm</p>		<p>X59652-01 4x 0423 8230</p>		<p>X59391-01 4x 0223 0704</p>		<p>X59760-01 4x 0423 3529</p>	<p>X54394-01 4x 0213 6719</p> <p>X54525-01 0336 2574</p>	<p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>	

DEUTZ

D 914 L4

4 Zyl.



S59652-02 ¹³
0293 7524



D59652-00 ¹⁸
0293 7521



H40551-20 4x
0415 7654
102,6 Ø
1,1 mm


H40551-30 4x
0415 7468
102,6 Ø
1,5 mm

H40551-40 4x
0415 7656
102,6 Ø
1,2 mm

H40551-50 4x
0415 7467
102,6 Ø
1,45 mm

H40551-60 4x
0415 7658
102,6 Ø
1,3 mm

H40551-70 4x
0415 7466
102,6 Ø
1,4 mm

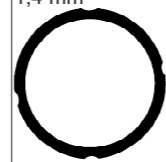

X59652-01 4x
0423 8230



P76791-00 8x
0415 3728

X59391-01 4x
0223 0704



X59760-01 4x
0423 3529



X54394-01 4x
0213 6719



X54525-01
0336 2574



P77344-01 K ←
0415 0782
65x85x10,5
A FIL RD ACM FPM

P77345-01 K →
0415 0392
115x140x13,5
A SL LD ACM FPM

F 4L 914

4 Zyl.

S59652-02 ¹³
0293 7524



D59652-00 ¹⁸
0293 7521



H40551-20 4x
0415 7654
102,6 Ø
1,1 mm


H40551-30 4x
0415 7468
102,6 Ø
1,5 mm

H40551-40 4x
0415 7656
102,6 Ø
1,2 mm

H40551-50 4x
0415 7467
102,6 Ø
1,45 mm

H40551-60 4x
0415 7658
102,6 Ø
1,3 mm

H40551-70 4x
0415 7466
102,6 Ø
1,4 mm

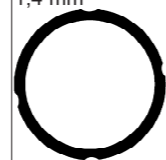

X59652-01 4x
0423 8230



X59391-01 4x
0223 0704



X59760-01 4x
0423 3529





X54394-01 4x
0213 6719













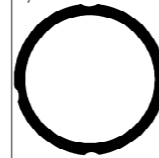
















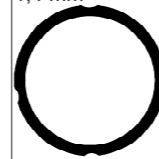

















P77344-01 K ←
0415 0782
65x85x10,5
A FIL RD ACM FPM

P77345-01 K →
0415 0392
115x140x13,5
A SL LD ACM FPM



DEUTZ											
D 914 L5 F 5L 914	5 Zyl.	D59652-00 ¹⁸ 0293 7521 	H40551-20 5x 0415 7654 102,6 Ø 1,1 mm H40551-30 5x 0415 7468 102,6 Ø 1,5 mm H40551-40 5x 0415 7656 102,6 Ø 1,2 mm H40551-50 5x 0415 7467 102,6 Ø 1,45 mm H40551-60 5x 0415 7658 102,6 Ø 1,3 mm H40551-70 5x 0415 7466 102,6 Ø 1,4 mm 		X59652-01 5x 0423 8230 	P76791-00 10x 0415 3728	X59391-01 5x 0223 0704 		X59760-01 5x 0423 3529 	X54778-01 5x 0224 0933 	P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM
BF 6L 914 BF 6L 914 C	6 Zyl.	S59652-05 ¹³ 0293 7526 D59652-00 ¹⁸ 0293 7521 	H40676-00 6x 0415 8321 3 mm H40676-10 6x 0415 8323 3,1 mm H40676-20 6x 0415 8325 3,2 mm H40676-30 6x 0415 8327 3,3 mm 		X59652-01 6x 0423 8230 		X59391-01 6x 0223 0704 		X59760-01 6x 0423 3529 	X54395-01 6x 0213 6720 X54396-01 ¹³ X 0336 2581 	P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM

DEUTZ												
D 914 L6	6 Zyl.	<p>S59652-04 ⁽¹³⁾ 0293 7715</p>  <p>D59652-00 ⁽¹⁸⁾ 0293 7521</p> 	<p>H40551-20 0415 7654 102,6 Ø 1,1 mm</p> <p>H40551-30 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 0415 7466 102,6 Ø 1,4 mm</p> 	6x	6x	6x	6x	6x	6x	6x	6x	<p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>
F 6L 914	6 Zyl.	<p>S59652-04 ⁽¹³⁾ 0293 7715</p>  <p>D59652-00 ⁽¹⁸⁾ 0293 7521</p> 	<p>H40551-20 0415 7654 102,6 Ø 1,1 mm</p> <p>H40551-30 0415 7468 102,6 Ø 1,5 mm</p> <p>H40551-40 0415 7656 102,6 Ø 1,2 mm</p> <p>H40551-50 0415 7467 102,6 Ø 1,45 mm</p> <p>H40551-60 0415 7658 102,6 Ø 1,3 mm</p> <p>H40551-70 0415 7466 102,6 Ø 1,4 mm</p> 	6x	6x	6x	6x	6x	6x	6x	6x	<p>P77344-01 K ← 0415 0782 65x85x10,5 A FIL RD ACM FPM</p> <p>P77345-01 K → 0415 0392 115x140x13,5 A SL LD ACM FPM</p>
F 8L 914	8 Zyl.	<p>D34763-00 ⁽¹⁸⁾ 0291 1514</p> 										<p>P77084-01 K → 150x172x18,3 A LD MVQ</p>

DEUTZ														
F 2L 1011	2 Zyl.	<p>D36815-00 ⑫ 0292 8843</p>  <p>B36815-00 ⑬ 0292 8729</p>	<p>H06255-00 0417 6117 1,55 mm 1 </p> <p>H16255-10 0417 6118 1,6 mm 2 </p> <p>H26255-20 0417 6119 92,5 Ø 1,7 mm 3 </p>		<p>X83054-01 0417 3857</p> 	<p>N92016-00 0415 3728 (4x)</p> <p>P76791-00 0415 3728</p>	<p>X52097-01 0410 2120</p> 	2x		<p>X58531-01 0417 3862</p> 	2x	<p>70-31414-10</p> 	<p>P76204-01 K ← 0417 5434 55x75x10 AB SL RD ACM P77086-01 K → 0417 5433 105x125x13 A SL LD ACM P76228-01 N 0417 5435 45x60x8 A SL RD NBR</p>	
F 2L 1011 F	2 Zyl.	<p>D32767-00 ⑫ 0292 9852</p>  <p>B32767-00 ⑬ 0292 9856 +0100 8383</p>	<p>H09160-00 0417 8861 1,55 mm 1 </p> <p>H19160-10 0417 8862 1,6 mm 2 </p> <p>H29160-20 0417 8863 92,5 Ø 1,7 mm 3 </p>	<p>T01905-00 0427 0815 (6X)</p> 	<p>X53526-01 0417 9845</p> 	<p>N92016-00 0415 3728 (4x)</p> <p>P76791-00 0415 3728</p>	<p>X52097-01 0410 2120</p> 	2x		<p>X58531-01 0417 3862</p> 	2x	<p>70-31414-10</p> 	<p>P76204-01 K ← 0417 5434 55x75x10 AB SL RD ACM P77086-01 K → 0417 5433 105x125x13 A SL LD ACM P76228-01 N 0417 5435 45x60x8 A SL RD NBR</p>	
F 3L 1011	3 Zyl.	<p>D36816-00 ⑫ 0292 8844</p>  <p>B36815-00 ⑬ 0292 8729</p>	<p>H01057-00 0417 6489 1,55 mm 1 </p> <p>H11057-10 0417 6490 1,6 mm 2 </p> <p>H21057-20 0417 6491 1,7 mm 3 </p>		<p>X83055-01 0417 3858</p> 	<p>N92017-00 0415 3728 (6x)</p> <p>P76791-00 0415 3728</p>	<p>X52097-01 0410 2120</p> 	3x		<p>X58531-01 0417 3862</p> 	3x	<p>70-31414-10</p> 	<p>P76204-01 K ← 0417 5434 55x75x10 AB SL RD ACM P77086-01 K → 0417 5433 105x125x13 A SL LD ACM P76288-01 N 0417 5435 35x50x9 AB SL LD Kork FPM</p>	
F 3L 1011 F F 3M 1011 F	3 Zyl.	<p>S32768-00 ⑫ ⑬ 0292 9853 +0292 9856 +0100 8383</p>  <p>D32768-00 ⑫ 0292 9853</p>  <p>B32767-00 ⑬ 0292 9856 +0100 8383</p>	<p>H09161-00 0417 6489 1,55 mm 1 </p> <p>H19161-10 0417 6490 1,6 mm 2 </p> <p>H29161-20 92 Ø 1,7 mm 3 </p>	<p>T01908-00 0427 0815 (8X)</p> 	<p>X53527-01 0417 9846</p> 	<p>N92017-00 0415 3728 (6x)</p> <p>P76791-00 0415 3728</p>	<p>X52097-01 0410 2120</p> 	3x		<p>X58531-01 0417 3862</p> 	3x	<p>70-31414-10</p> 	<p>P76204-01 K ← 0417 5434 55x75x10 AB SL RD ACM P77086-01 K → 0417 5433 105x125x13 A SL LD ACM P76228-01 N 0417 5435 45x60x8 A SL RD NBR</p>	
BF 4L 1011 BF 4L 1011 T [NEW]	4 Zyl.	<p>D36818-00 ⑫ 0292 8879</p>  <p>B36815-00 ⑬ 0292 8729</p>	<p>H06259-00 0417 6101 1,48 mm 1 </p> <p>H16259-10 0417 6102 1,55 mm 2 </p> <p>H26259-20 0417 6103 92,5 Ø 1,6 mm 3 </p>		<p>X83056-01 0417 3859</p> 	<p>P76791-00 0415 3728</p>	<p>X52097-01 0410 2120</p> 	8x	4x		<p>X58531-01 0417 3862</p> 	4x	<p>70-31414-10</p> 	<p>P76204-01 K ← 0417 5434 55x75x10 AB SL RD ACM P77086-01 K → 0417 5433 105x125x13 A SL LD ACM P76228-01 N 0417 5435 45x60x8 A SL RD NBR</p>

DEUTZ																
BF 4L 1011 F BF 4L 1011 FT BF 4M 1011 F	4 Zyl.															
TCD 3.6 L4 TD 3.6 L4 [NEW]	4 Zyl.															
F 4L 1011	4 Zyl.															
F 4L 1011 F F 4L 1011 FL F 4M 1011 F [NEW]	4 Zyl.															
BF 4M 1012 BF 4M 1012 C BF 4M 1012 E BF 4M 1012 EC	4 Zyl.															

DEUTZ																				
BF 6M 1012 BF 6M 1012 C BF 6M 1012 E BF 6M 1012 EC	6 Zyl.																			
BF 4M 1013 BF 4M 1013 C BF 4M 1013 E BF 4M 1013 EC	4 Zyl.																			
BF 6M 1013 BF 6M 1013 C BF 6M 1013 CP BF 6M 1013 E BF 6M 1013 ECP BF 6M 1013 EC	6 Zyl.																			
BF 6M 1015 BF 6M 1015 C BF 6M 1015 CP	6 Zyl.																			
BF 8M 1015 BF 8M 1015 C BF 8M 1015 CP	8 Zyl.																			

DEUTZ												
D 2009 L3 [NEW]	3 Zyl.											
D 2009 L4 TD 2009 L4 [NEW]	4 Zyl.											
BF 3L 2011 BF 3M 2011	3 Zyl.											

DEUTZ																				
BF 4L 2011 BF 4M 2011 F 4L 2011 F 4M 2011	4 Zyl.																			
D 2011 L4 D 2011 L04 I D 2011 L04 W [NEW]	4 Zyl.																			
F 2L 2011 F 2M 2011	2 Zyl.																			

DEUTZ																
F 3L 2011 F 3M 2011	3 Zyl.															
TD 2011 L4 TD 2011 L04 I	4 Zyl.															
BF 4M 2012 BF 4M 2012 C BF 4M 2012 C*	4 Zyl.															

DEUTZ																	
BF 6M 2012 C BF 6M 2012 C* BF 6M 2012 [NEW]	6 Zyl.	 	S38371-00 ⑫ ⑬ 0293 1739 	H01864-10 0428 9405 99 Ø 1,26 mm 1 MLS H11864-20 0428 9404 99 Ø 1,36 mm 2 MLS H21864-30 0428 9403 99 Ø 1,46 mm 3 MLS H40637-00 0428 9411 102 Ø 1,2 mm 1 MLS H40637-10 0428 9410 102 Ø 1,34 mm 2 MLS H40637-20 0428 9409 102 Ø 1,4 mm 3 MLS 				X83058-01 0419 8969 X83118-01 0428 3392 Stahl 	N93174-00 P76791-00 0415 3728	12x	X59544-01 0428 3576 	6x		X81839-01 0419 7463 	6x	E36820-00 0420 4453 	P93268-01 K ← 0450 2202 74x95x11 A SL FPM P77855-01 K → 0450 2203 120x140x11 A SL FPM
TCD 2012 L4 2V	4 Zyl.		S38373-00 ⑫ ⑬ 0293 1762 	H01862-00 0428 9408 102 Ø 1,2 mm 1 MLS H11862-10 0428 9407 102 Ø 1,3 mm 2 MLS H21862-20 0428 9406 102 Ø 1,4 mm 3 MLS 				X83471-01 0429 1419 	N92985-00 0415 3728 (8x) P76791-00 0415 3728	8x	X59544-01 0428 3576 	4x	X89449-01 0429 2820 	4x	E36819-00 0420 4452 	P93268-01 K ← 0450 2202 74x95x11 A SL FPM P77855-01 K → 0450 2203 120x140x11 A SL FPM	

DEUTZ												
TCD 2012 L6 2V	6 Zyl.											
		S38372-00 ⑫ ⑬ 0293 1662	H01864-10 0428 9405 99 Ø 1,26 mm 1 MLS H11864-20 0428 9404 99 Ø 1,36 mm 2 MLS H21864-30 0428 9403 99 Ø 1,46 mm 3 MLS 	X83472-01 0429 1418 	N93174-00 P76791-00 0415 3728	X59544-01 0428 3576 	6x	X89449-01 0429 2820 	6x	E36820-00 0420 4453 	P93268-01 K ← 0450 2202 74x95x11 A SL FPM P77855-01 K → 0450 2203 120x140x11 A SL FPM	
BF 4M 2013	4 Zyl.											
		S37171-00 ⑫ ⑬ 0293 7583	H01860-00 0425 9841 1,1 mm 1 H11860-10 0425 9842 1,2 mm 2 H21860-20 0425 9843 1,3 mm 3 	X83147-01 0425 0634 Gummi X83148-01 0425 2217 Stahl 	P76791-00 0415 3728	16x	X89567-01 0425 2298 	X82095-01 0428 4670 	2x	70-31414-10 	P93268-01 K ← 0450 2202 74x95x11 A SL FPM P77855-01 K → 0450 2203 120x140x11 A SL FPM	

DEUTZ												
BF 4M 2013 C	4 Zyl.											
BF 6M 2013 BF 6M 2013 C	6 Zyl.											
TCD 2013 L4 2V	4 Zyl.											
TCD 2013 L4 4V	4 Zyl.											

DEUTZ													
TCD 2013 L6 2V	6 Zyl.		 0429 4194 1,42 mm 1 □ MLS 0429 4195 1,52 mm 2 □ MLS 0429 4196 1,62 mm 3 □ MLS					3x		6x		 0420 2260 81x104x11 FPM 0420 2332 130x150x13 FPM/ACM	
TCD 2013 L6 4V	6 Zyl.		 0490 0688 109,5 Ø 1,15 mm 1 □ 0490 0689 109,5 Ø 1,25 mm 2 □				24x		3x		3x		 0420 2260 81x104x11 FPM 0420 2332 130x150x13 FPM/ACM
TCD 2015 V6	6 Zyl.		 0426 4004 146 Ø 1,4 mm 1 □ 0426 4005 146 Ø 1,6 mm 2 □ 0426 4006 146 Ø 1,8 mm 3 □	6x			24x		6x		6x		 0422 5441 115x142x15,5 AB FILZ RD FPM 0422 5442 115x140x15,5 AB FILZ LD FPM
TCD 2015 V8	8 Zyl.		 0426 4004 146 Ø 1,4 mm 1 □ 0426 4005 146 Ø 1,6 mm 2 □ 0426 4006 146 Ø 1,8 mm 3 □	8x			32x		8x		8x		 0422 5441 115x142x15,5 AB FILZ RD FPM 0422 5442 115x140x15,5 AB FILZ LD FPM
8220.02.842	6 Zyl.		 128 Ø	2x							6x	 Kork	 105x130x12/13 RD FPM 115x140x12/13 LD FPM
8360.05.670	6 Zyl.		 117,5 Ø						2x		3x	 Kork	 75x100x17 RD 125x150x15 LD FPM

DEUTZ																				
TCD 7.8 L6 [NEW]	6 Zyl.																			
TCD 2011 L04 W TD 2011 L04 W	4 Zyl.																			
TCD 2012 L04 4V [NEW]	4 Zyl.																			
TCD 2012 L06 4V [NEW]	6 Zyl.																			

DEUTZ													
TCG 2015 V6	6 Zyl.												
		S38548-00 ⑫ ⑬ ⑯ 0293 1717 	H06271-00 6x 0426 4004 146 Ø 1,4 mm 1 H16271-10 6x 0426 4005 146 Ø 1,6 mm 2 H26271-20 6x 0426 4006 146 Ø 1,8 mm 3 	X83062-01 U 6x 0422 1064 X83454-01 0 6x 0422 4392 	N92016-00 6x 0415 3728 (4x) P76791-00 24x 0415 3728 	X87726-01 6x 0422 0148 	X59809-01 6x 0422 8309 	X54814-01 6x 0426 3576 	P77384-01 K ← 0422 5441 115x142x15,5 AB FILZ RD FPM P77385-01 K → 0422 5442 115x140x15,5 AB FILZ LD FPM				
TCG 2015 V8	8 Zyl.												
		S38548-01 ⑫ ⑬ ⑯ 0293 1718 	H06271-00 8x 0426 4004 146 Ø 1,4 mm 1 H16271-10 8x 0426 4005 146 Ø 1,6 mm 2 H26271-20 8x 0426 4006 146 Ø 1,8 mm 3 	X83062-01 U 8x 0422 1064 X83454-01 0 8x 0422 4392 	N92016-00 8x 0415 3728 (4x) P76791-00 32x 0415 3728 	X87726-01 8x 0422 0148 	X59809-01 8x 0422 8309 	X54779-01 8x 0426 3578 	P77384-01 K ← 0422 5441 115x142x15,5 AB FILZ RD FPM P77385-01 K → 0422 5442 115x140x15,5 AB FILZ LD FPM				